




HAZ WASTE







Cedar Chenical, Order objectives and anthorities

- 1. Hydrogeologic characterization and groundwater monitoring accomplished under 90 86-027
- 2. "Finding of Fact" exception should include a para detailing Part B withdrawal for Bio Treatment Units and subsequent closure of all KCRH storage units thereby leaving Cedar with no operating units for which interin status may be claimed. However Cedar has not LOIS because they have never had and official NOD or LOIS notification from this Department. Also note in "ORDER" section that Cedar will either su be denied IS officially?

 3. Take Davids comments on the hydrogeologic study and SWM and incorporate into both Finding of Fact" and "order" sections.

CHARLES W. METCALF. 1840-1924 WILLIAM P. METCALF. 1872-1940 JOHN W. APPERSON. 1896-1985

CHARLES METCALF CRUMP
JERRE G. DUZANE
JOHN B. MAXWELL, JR.
ALLEN T. MALONE
PHILIP G. KAMINSKY
ROBERT L. DINKELSPIEL
MICHAEL E. HEWGLEY
JAMES F. RUSSELL
JOHN L. RYDER
THOMAS R. BUCKNER
TONI CAMPBELL PARKER
MELODY W. OLIVER
WILLIAM B. MASON. JR.
STEVEN N. DOUGLASS
RANDY S. GARDNER
KAREN R. WILLIAMS

· ALSO ADMITTED IN MISSISSIPPI

SAMUEL RUBENSTEIN


LAW OFFICES APPERSON, CRUMP, DUZANE & MAXWELL

SUITE 2110

ONE COMMERCE SQUARE
MEMPHIS, TENNESSEE 38103
901/525-1711

TELECOPY 901/521-0789

August 27, 1990



EAST OFFICE

SUITE 100
KIRBY CENTRE
1755 KIRBY PARKWAY
MEMPHIS, TENNESSEE 38120
901/756-6300
TELECOPY 901/757-1296

Mr. Mike Bates, Manager Hazardous Waste Division Department of Pollution Control & Ecology 8001 National Drive Little Rock, Arkansas 72209

> Re: Cedar Chemical Corporation West Helena, Arkansas

Dear Mike:

By letter of June 28, 1990, I sent you Woodward-Clyde's final Site Characterization Report which was prepared in connection with Cedar's proposed construction of a DCA manufacturing plant and related facilities. I am enclosing with this letter two additional documents which supplement the report. The first is a summary of analytical results reported with respect to soil sample extracts in the area of the so-called "tank farm" by Sorrells Research, Inc. (and where applicable, split sample results analyzed by Cedar). The underlying data is maintained by Joe Porter at the facility. The second enclosure is a copy of a letter dated August 6, 1990 from Woodward-Clyde to John Miles, Plant Manager, at the West Helena Plant with respect to the tank farm. We recently concluded closing of the construction loan and Cedar is proceeding with the project.

with respect to the buried drums which were discovered on the Plant site last spring, Cedar has identified several qualified hazardous waste disposal contractors and we are prepared to send them the removal plan prepared by Woodward-Clyde for the purpose of receiving competitive bids. We would prefer to initiate this effort following the entry of a Consent Administrative Order for the reasons which we discussed in our meeting this summer. Please submit the draft CAO so that Cedar can make arrangements for removal of the drums at the earliest possible date and proceed with a facility investigation per the guidance plan which Sammy Bates sent to Joe Porter by letter of April 13, 1990, and the provisions of the CAO referred to above.

2822 O Neal Lane
Post Office Box 66317
Baton Rouge, Louisiana 70896
504 291-1873

Woodward-Clyde Consultants

August 6, 1990

Mr. John Miles
Plant Manager
Cedar Chemical Corporation
Post Office Box 2749
West Helena, Arkansas 72390

Re:

WCC File No: 90B550C

West Helena

DCA Tank Farm Location

Dear John:

Woodward-Clyde Consultants (WCC) and Cedar Chemical Corporation (Cedar) have carried out an environmental investigation of the DCA tank farm area. The objective has been discovery of any major pollution sources such as:

- o buried drums that might best be excavated and disposed now, and
- prevention of potential for migration of contamination as a result of construction activities.

Par

As a result of a magnetometer survey, trenching and 23 samples in the tank farm area it can reasonably be concluded that excavation beneath the tank farm area is not required prior to construction of the tank farm in order to mitigate the potential for environmental impairment. A sketch of the DCA Site is attached; a new tank farm area is depicted on the sketch to be moved south of the original proposed location. The new tank farm location is an appropriate area for construction.

Consulting Engineers, Geologists and Environmental Scientists

Offices in Other Principal Cities



Woodward-Clyde Consultants

Mr. John Miles August 6, 1990 Page 2

There is precedent in Arkansas for construction atop an area where there is soil or groundwater contamination as long as the following precautions are taken:

- Footings, pilings or foundations should not penetrate into groundwater without special design precautions.
- The concrete foundation should be constructed such that it simulates an engineered cap. Waterstops should be used on all joints, silicon calk should be used to further seal the joints, a sealant should be used on all concrete surfaces. A drawing depicting acceptable construction is attached by way of example.
- Access is allowed for construction of recovery wells adjacent to the facility in the event that such becomes necessary. By constructing the tank farm Cedar is giving up the option for the near future to further treat the soils in place through fixation; therefore, it will also be prudent to allow access for shallow injection wells to force subsurface flow directly underneath the tank farm area and eventually desorb the contaminates from the soil.

If you have any questions, please call.

Very truly yours,

Dick Karkkainen Vice President Associate


RDK/lbh


.

cc: Allen T. Malone Joe Porter Randal Tomblin Tom Lodice

P02/					
02/		3	3		
2	i	5		C	
-		>	-	r	
	į	9	_		
		Э	_	κ,	

Samples of Jul Soil samples of	extracted by	Cedar. And	alysis of e	xtracts by	Sorrells R	esearch, In	c. except a	s noted		8/14/90	-
							M		1	Porter/G	Satterfi
	71	-							300		T TE
	81	#2	#3	料	#5	#6	柳	#8			
2,3-DCA	50.20	MD	ND N	MD	MD	NO	1,200.00	ND			
3,4-DCA	640.00	40.10	9.60	ND	14.60	63.00	4,591.00	19.00			
2,3-0CMB	MD	MD	MD	ND	MD .	ND	ND	ND			
3,4-DCMB	MD	MD	ND	ND CH	ND	CM	309.00	ND			
Propanil	MD	ND	ND	MD	1.60	100.00	14,159.00	79.00			
o-DCE	ND	ND CH	ND	MD	ND	ND	1,041.00	ND			
Phenol	MD	40	ND	ND	ND	ND	MD	ND			
nisole	ND O	MD	MD	NED	ND	ND	ND NA	ND			
lethoxychlor	f: IND	iD .	NO	ND	MD.	MD	WD	l'O			
			10			NO.	MD.			77-77	
MBP -Sorre.ls	16 917 00	834.00	7,809.00	3.00				10,160.00			

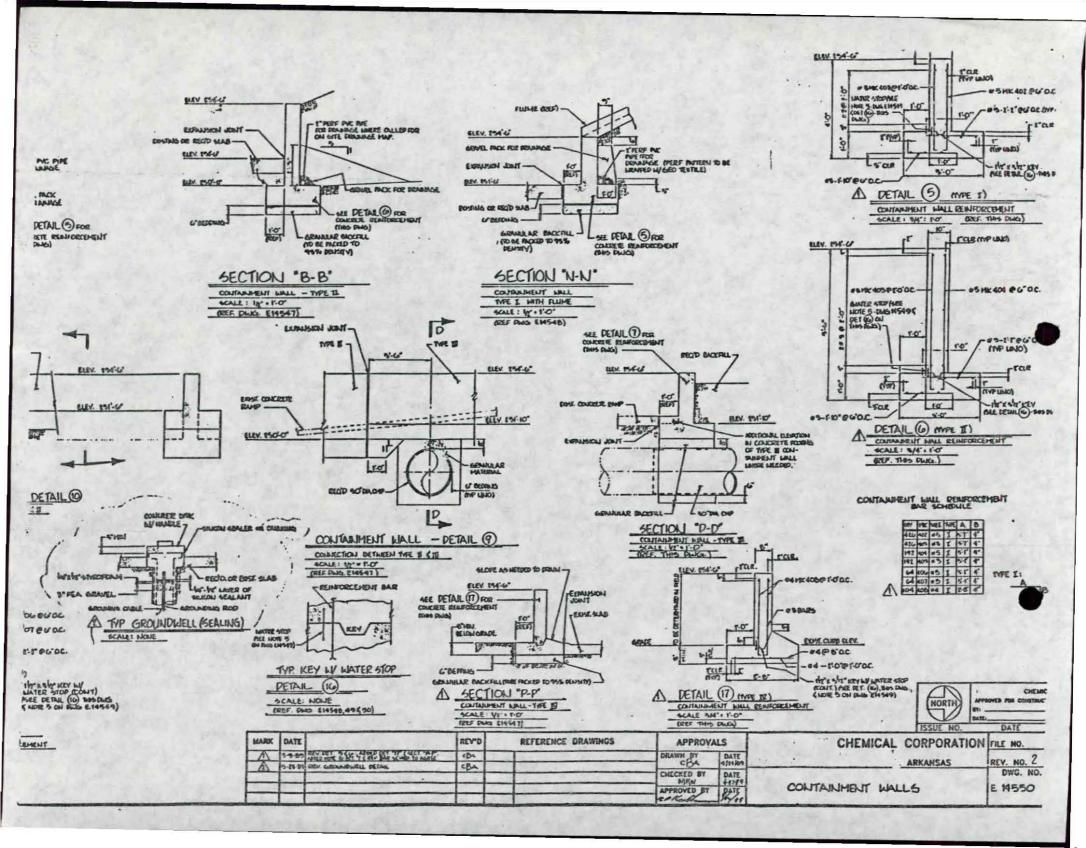

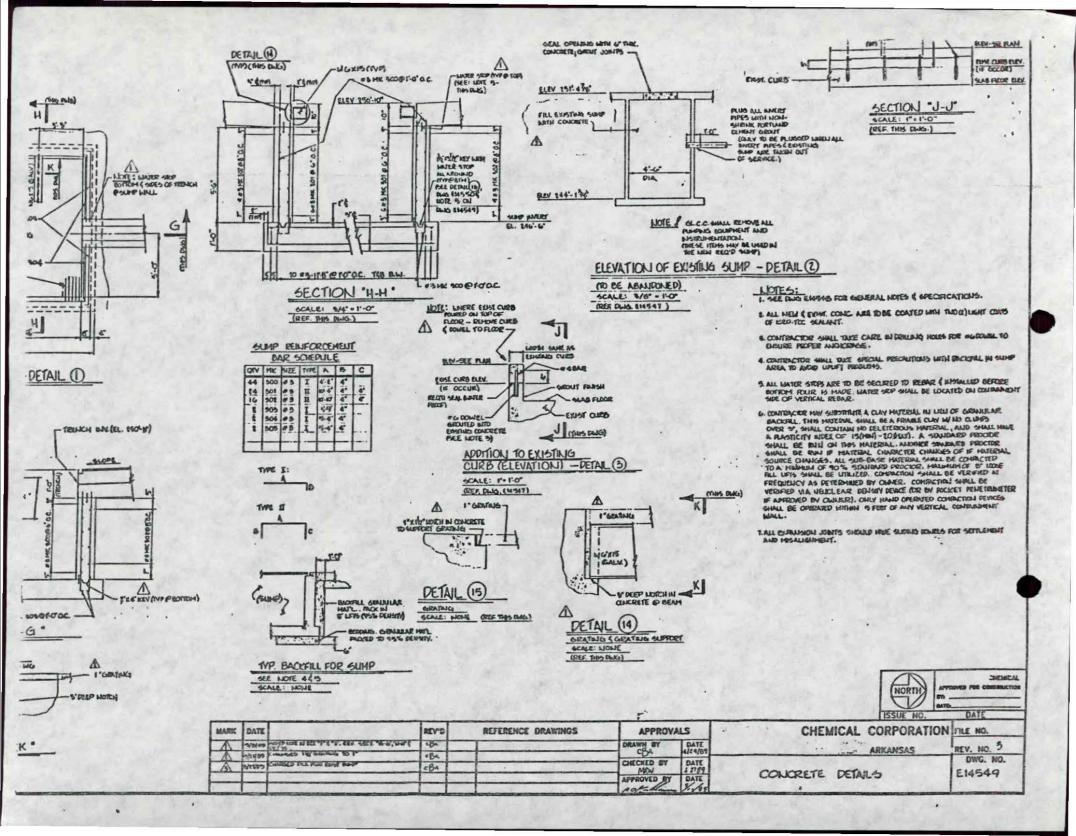

Davidk

CEDAR CHEMICAL CORPORATION

MEDIA: AIR, WATER, SOLID, HAZARDOUS Box 2749, Hwy. 242 S. • West Helena, AR 72390

SORT: PERMIT COMPLIANCE

(501) 572-3701 • Fax No. 501-572-3795 SORT: PERMIT COMPLIANCE

FEES,

August 23, 1990

David Hartley Arkansas Dept. of Pollution Control & Ecology P. O. Box 9583 8001 National Drive Little Rock, AR 72209

Re: Final Groundwater Report - CAO LIS 86-027 Engineering Evaluation

Dear David:

In our letter of June 19, we submitted summaries of all the information generated in our groundwater monitoring program. We presented this to two engineering firms for their evaluation. A combined summary of their reports is attached.

We believe that the original intent of the Groundwater Monitoring Plan has been fulfilled. It has indicated two areas of concern and it has raised additional questions about the aquifer beneath the site.

The original plan has laid a good foundation for a remedial investigation. To determine the extent of constituents detected, additional soil samples and additional monitoring wells will be required. Wells around the surface impoundments will help to determine the impact of mounding caused by their volume. One or more wells may have to be located offsite to better define the impacts of seasonal levels and nearby agricultural land use. Additional data will then go forward into the development of remedial alternatives.

We request that the Department review our evaluations and comment on the direction of our program. Please call us if you have questions.

Sincerely,

Joe E. Porter

Environmental Engineer

J.H. Miles A.T. Malone \Joe\DH0823

CHAPLES W MITCALF, 1840-1924 LAW OFFICES WILLIAM P METCALF, 1872-1940 JOHN W APPERSON, 1896-1985 APPERSON, CRUMP, DUZANE & MAXWELL CHARLES METCALF CRUMP JERRE G DUZANE JERRE G DUZANE
JOHN B MAXWELL, JR
ALLEN T MALONE
PHILIP G KAMINSKY
ROBERT L DINKELSPIEL
MICHAEL E HEWGLEY
JAMES F. RUSSELL ONE COMMERCE SQUARE MEMPHIS, TENNESSEE 38103 901/525-1711 JOHN L. RYDER TELECOPY 901/521-0789 THOMAS R BUCKNER TONI CAMPBELL PARKER MELODY W OLIVER WILLIAM B MASON, JR TELECOPY 901/757-1296 STEVEN N. DOUGLASS July 26, 1990 RANDY S. GARDNER SAMUEL RUBENSTEIN Mr. David Hartley Geologist Hazardous Waste Division Arkansas Department of Pollution Control & Ecology 8001 National Drive Little Rock, Arkansas 72209 Re: Compliance Evaluation Inspection ARD 990660649 Our Client: Cedar Chemical Corporation Dear David: This is in response to your letter dated June 26, 1990, addressed to Mr. Joe Porter at Cedar Chemical Corporation's West Helena Plant, received June 29, 1990. As requested, Joe Porter is submitting under separate cover for your approval a Supplement to the Groundwater Monitoring Program implemented pursuant to Paragraph 10 of the Consent Administrative Order in LIS 86-027. The supplement will specifically address the manner in which well water purged when samples are drawn in accordance with the approved groundwater monitoring program will be contained, stored and disposed of. Cedar proposes that the supplement be adopted as part of the new Consent Administrative Order which was discussed at our meeting in Little Rock on June 4, 1990. Until the supplement is approved by the Department, no additional groundwater samples will be drawn. The purpose of this letter is to address your conclusion that purged groundwater drawn from the wells "is considered hazardous waste." Such a conclusion would have implications far beyond Cedar's method of disposing of purged monitoring well water and could ultimately impede Cedar's ability to implement corrective measures contemplated following completion of the RFI under the new Consent Administrative Order. As we understand it, your interpretation is based on RCRA Regulation Section 261.33. We recognize that water which is contaminated as a result of clean-up of the disposal or spill of any commercial product (or off specification product) listed in

PPERSON, CRUMP, DUZANE & MAXWELL Mr. David Hartley July 26, 1990 Page Two this section would, under the mixture rule, be considered RCRA hazardous waste. However, we do not believe that groundwater recovered from monitoring wells located on the West Helena Plant meets this definition. The source of the contamination has yet to be determined and, in fact, that is exactly what Cedar expects to establish as a result of the expanded RFI, which we discussed at our meeting in Little Rock last month. The only discarded commercial products at West Helena of which we are aware are the drum burial area discussed in Woodward-Clyde's removal plan submitted to Mike Bates in June 1990, and the drums which are contained in a vault located under a warehouse on the plant site. There is no indication that the contents of these drums have leaked or in any way contaminated groundwater on the site. At this point, according to the people at the plant, the most likely source of the contamination appears to be process waste water disposed of on the site by a prior owner/operator during the period 1971 - 1972, which was the only period in which dinoseb was produced at the plant. Dinoseb process waste water is not a listed hazardous waste. Another possible source would be de minimis losses of commercial chemical products, as that term is used in the de minimis exception to the mixture rule contained at Section 261.3(a)(iv)(D). Based partly on that rule, it seems sensible and environmentally sound for Cedar to containerize and dispose of purged well water in the biological treatment pond on site, the discharge of which as you know is subject to regulation under the Cedar's NPDES Permit. The proposed plan would be followed pending completion of the RFI/CMS process under the new CAO. should point out that samples drawn from the existing groundwater monitoring wells will only generate an estimated 120 gallons of water per sampling event. By way of comparison, approximately 35,000 gallons of water per day are discharged through the biological treatment system in accordance with the NPDES Permit. I have reviewed the issue which this letter addresses with environmental consulting firms, including Woodward-Clyde,

APPERSON, CRUMP, DUZANE & MAXWELL Mr. David Hartley July 26, 1990 Page Three and I believe there is ample precedent to conclude that groundwater drawn from monitoring wells on the West Helena site cannot properly be designated hazardous waste under RCRA unless the groundwater can be shown to be a "characteristic" hazardous waste. Woodward-Clyde's experience in dealing with EPA on other sites in similar situations has shown that where the source of contamination is not known, the groundwater is assumed not to be hazardous under the RCRA mixture rule. We would hope that you would construe the Arkansas Hazardous Waste Management Code in a similar manner. Based on the information supplied above, I hope that you will be able to approve the plan for handling and disposing of purged monitoring well water submitted by Joe Porter. We would like to discuss this matter with the Department in conjunction with our initial discussions of the new proposed Consent Administrative Order. Cedar is also interested in expediting removal of the buried drums recently discovered at the West Helena Plant, but for purposes of preserving its contribution rights against the former owner of the Plant, it prefers to wait to do so in conjunction with an administrative order which will provide, as an interim measure, for the implementation of the Woodward-Clyde removal plan which was submitted to the Department last month. Accordingly, we would appreciate it if you would arrange to have a draft Consent Administrative Order submitted to us, and arrange a conference to discuss all of these matters at the earliest convenience of the persons involved. Sincerely yours, Allen T. Malone ATM: jw cc: Mr. Mike Bates, Manager Hazardous Waste Division Department of Pollution Control & Ecology cc: Mr. Joe Porter

CHARLES W. METCALF, 1840-1924 WILLIAM P. METCALF, 1872-1940 JOHN W. APPERSON, 1896-1985

CHARLES METCALF CRUMP JERRE G. DUZANE
JOHN B. MAXWELL, JR.
ALLEN T. MALONE
PHILIP G. KAMINSKY
ROBERT L. DINKELSPIEL
MICHAEL E. HEWGLEY
JAMES F. RUSSELL
JOHN L. RYDER
THOMAS R. BUCKNER
TONI CAMPBELL PARKER
MELODY W. OLIVER
WILLIAM B. MASON, JR.
STEVEN N. DOUGLASS
RANDY S. GARDNER

SAMUEL RUBENSTEIN OF COUNSEL

LAW OFFICES APPERSON, CRUMP, DUZANE & MAXWELL


SUITE 2110

ONE COMMERCE SQUARE
MEMPHIS, TENNESSEE 38103

901/525-1711

TELECOPY 901/521-0789

July 26, 1990



EAST OFFICE

SUITE 100
KIRBY CENTRE
1755 KIRBY PARKWAY
MEMPHIS, TENNESSEE 38120
901/756 6300
TELECOPY 901/757-1296

MEDIA: AIR, WATER, SOLID, HAZARDOUS
SORT: PERMIT, COMPLIANCE
FEES.

Mr. David Hartley
Geologist
Hazardous Waste Division
Arkansas Department of Pollution
Control & Ecology
8001 National Drive
Little Rock, Arkansas 72209

Re: Compliance Evaluation Inspection

ARD 990660649

Our Client: Cedar Chemical Corporation

Dear David:

This is in response to your letter dated June 26, 1990, addressed to Mr. Joe Porter at Cedar Chemical Corporation's West Helena Plant, received June 29, 1990. As requested, Joe Porter is submitting under separate cover for your approval a Supplement to the Groundwater Monitoring Program implemented pursuant to Paragraph 10 of the Consent Administrative Order in LIS 86-027. The supplement will specifically address the manner in which well water purged when samples are drawn in accordance with the approved groundwater monitoring program will be contained, stored and disposed of. Cedar proposes that the supplement be adopted as part of the new Consent Administrative Order which was discussed at our meeting in Little Rock on June 4, 1990. Until the supplement is approved by the Department, no additional groundwater samples will be drawn.

The purpose of this letter is to address your conclusion that purged groundwater drawn from the wells "is considered hazardous waste." Such a conclusion would have implications far beyond Cedar's method of disposing of purged monitoring well water and could ultimately impede Cedar's ability to implement corrective measures contemplated following completion of the RFI under the new Consent Administrative Order.

As we understand it, your interpretation is based on RCRA Regulation Section 261.33. We recognize that water which is contaminated as a result of clean-up of the disposal or spill of any commercial product (or off specification product) listed in

APPERSON, CRUMP, DUZANE & MAXWELL

Mr. David Hartley July 26, 1990 Page Two

this section would, under the mixture rule, be considered RCRA hazardous waste. However, we do not believe that groundwater recovered from monitoring wells located on the West Helena Plant meets this definition. The source of the contamination has yet to be determined and, in fact, that is exactly what Cedar expects to establish as a result of the expanded RFI, which we discussed at our meeting in Little Rock last month.

The only discarded commercial products at West Helena of which we are aware are the drum burial area discussed in Woodward-Clyde's removal plan submitted to Mike Bates in June 1990, and the drums which are contained in a vault located under a warehouse on the plant site. There is no indication that the contents of these drums have leaked or in any way contaminated groundwater on the site.

At this point, according to the people at the plant, the most likely source of the contamination appears to be process waste water disposed of on the site by a prior owner/operator during the period 1971 - 1972, which was the only period in which dinoseb was produced at the plant. Dinoseb process waste water is not a listed hazardous waste.

Another possible source would be de minimis losses of commercial chemical products, as that term is used in the de minimis exception to the mixture rule contained at Section 261.3(a)(iv)(D). Based partly on that rule, it seems sensible and environmentally sound for Cedar to containerize and dispose of purged well water in the biological treatment pond on site, the discharge of which as you know is subject to regulation under the Cedar's NPDES Permit. The proposed plan would be followed pending completion of the RFI/CMS process under the new CAO. I should point out that samples drawn from the existing groundwater monitoring wells will only generate an estimated 120 gallons of water per sampling event. By way of comparison, approximately 35,000 gallons of water per day are discharged through the biological treatment system in accordance with the NPDES Permit.

I have reviewed the issue which this letter addresses with environmental consulting firms, including Woodward-Clyde,

APPERSON, CRUMP, DUZANE & MAXWELL

Mr. David Hartley July 26, 1990 Page Three

and I believe there is ample precedent to conclude that groundwater drawn from monitoring wells on the West Helena site cannot properly be designated hazardous waste under RCRA unless the groundwater can be shown to be a "characteristic" hazardous waste. Woodward-Clyde's experience in dealing with EPA on other sites in similar situations has shown that where the source of contamination is not known, the groundwater is assumed not to be hazardous under the RCRA mixture rule. We would hope that you would construe the Arkansas Hazardous Waste Management Code in a similar manner.

Based on the information supplied above, I hope that you will be able to approve the plan for handling and disposing of purged monitoring well water submitted by Joe Porter. We would like to discuss this matter with the Department in conjunction with our initial discussions of the new proposed Consent Administrative Order. Cedar is also interested in expediting removal of the buried drums recently discovered at the West Helena Plant, but for purposes of preserving its contribution rights against the former owner of the Plant, it prefers to wait to do so in conjunction with an administrative order which will provide, as an interim measure, for the implementation of the Woodward-Clyde removal plan which was submitted to the Department Accordingly, we would appreciate it if you would last month. arrange to have a draft Consent Administrative Order submitted to us, and arrange a conference to discuss all of these matters at the earliest convenience of the persons involved.

Sincerely yours,

Allen T. Malone

ATM: jw

cc: Mr. Mike Bates, Manager Hazardous Waste Division

Department of Pollution Control & Ecology

cc: Mr. Joe Porter

STATE OF ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE:(501)562-7444 FAX:(501)562-4632

July 25, 1990

CSN: HOUS PERMIT NO.

MEDIA: AIR, WATER, SOLID, HAZARDOUS
SORT: PERMIT, COMPLIANCE
FEES:

Mr. Joe Porter Cedar Chemical Corporation P. O. Box 2749 West Helena, AR 72390

RE: Final Groundwater Report for CAO LIS 86-027

Dear Mr. Porter:

This will acknowledge receipt of the final groundwater report dated June 19, 1990. I have reviewed the report and determined it to be inadequate. Cedar Chemical Corporation submitted a plan for the groundwater monitoring system in the September 28, 1988, letter. The final report of this plan was to contain a summary and engineering evaluation of the facility's impact on the uppermost aquifer in addition to water level measurements and laboratory analysis. You were advised to proceed with implementation of this plan on December 2, 1988, and this plan was conditionally approved by the June 28, 1989, letter from the Department. Be advised that failure to submit a report consistent with the approved plan will be considered a violation of paragraph 10(c) of the CAO. Although the CAO does not address specific time frames for submittal of this report, a report should submitted as soon as practicable.

If you have any questions or if I can be of assistance, feel free to call me.

Sincerely,

David Hartley Geologist

Hazardous Waste Division

David Hatter,

DH/ckh:LTR972

D. Hordy

MEDIA: AIR, WATER, SOLID, HAZARDOUS

SORT: PERMIT, COMPLIANCE

CEDAR CHEMICAL CORPORATION

P.O. Box 2749, Hwy. 242 S. • West Helena, AR 72390 (501) 572-3701 • Fax No. 501-572-3795

July 24, 1990

FEES

David Hartley, Geologist
Arkansas Department of Pollution Control &
Ecology
8001 National Drive
P.O. Box 9583
Little Rock, AR. 72209

Re: Compliance Fyelvetics Decompliance Fyelvetics Decompliance Fyelvetics Decompliance

Re: Compliance Evaluation Response

ARD 990 660 649

Dear David:

In reply to your letter of June 26, we are submitting our plan to handle purged ground water. For this purpose, our Ground Water Monitoring Well Plan has been revised with the attached procedure for sampling.

This procedure makes certain assumptions concerning our interpertation of the definition of the ground water. This letter addresses the technical details of the sampling procedure while a separate letter from Allen Malone will address other aspects noted in your letter of June 26.

Sincerely,

Joe E. Porter

Environmental Engineer

cc: J. Miles

A. Malone

Groundwater Monitoring Plan
Sampling of Monitoring Wells - Revised July 1990

Each monitoring well is constructed of a two inch stainless steel pipe with a section of stainless steel, screened pipe. Each well is complete with a one-half inch tube and a three-fourth inch tube. Nitrogen is forced into the one-half inch tube creating an air lift for pumping the well pipe.

Prior to collection of samples for laboratory analysis, wells are purged to assure that water representative of the aquifer has entered the well. The amount purged will consist of a minimum of three (3) casing volumes or to dryness. The exact volume is calculated at each sampling period and is based upon the water level.

Purged well water will be air lifted (using nitrogen) from each well and pumped directly to a drum. Purged well water will not be discharged directly onto the ground. When purging is complete, samples will be collected. Sample bottle rinsate will be poured into the drum. Drums containing purged well water (approximately 120 to 150 gallons per sampling event) will be moved to a process area. The purged well water will be pumped to the plant biological waste treatment system. Drums will be labeled for groundwater use and retained for the next sampling event.

STATE OF ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501) 562-7444 FAX: (501) 562-4632

July 17, 1990

CSN: 54 068 PERMIT NO.

MEDIA: AIR, WATER, SOLID, HAZARDOUS
FEES:

FEES:

Allen T. Malone Apperson, Crump, Duzane & Maxwell Suite 2110 One Commerce Square Memphis, TN 38103

RE: Cedar Chemical Corporation

West Helena Plant

Dear Mr. Malone:

We have received your letter dated June 28, 1990, which transmitted Cedar Chemical Contractor's final site Characterization Report regarding proposed new construction on the West Helena Plant grounds. Your letter also requests confirmation that the report forwarded by Joe Porter (Cedar Chemical) on June 10, 1990, completed the tasks under the Consent Administrative Order (CAO) LIS 86-027.

Our staff has given the documents referenced above preliminary reviews. Based on these reviews the following observations are offered. The groundwater monitoring/investigation plan which was approved for implementation under CAO LIS 86-027 requires that a summary and engineering evaluation of the facilities impact on the upper most aquifer be included as part of the final report. Our preliminary review has found the final report incomplete in this area.

The Site Characterization Report prepared by Cedar's consultant indicates levels of Dinoseb, Propanil, and other constituents in the area of the proposed tank farm and process area ranging from trace levels to inexcess of 160 ppm. The contamination which has been characterized in the proposed project area will of necessity be incorporated into a site-wide investigation as we discussed during our meeting of June 1990.

While the reported levels are not extensive enough to warrant removal or immediate action or that would preclude

Cedar from preceding with the project the Department is concerned with any level of chemical contamination of the environment. In follow up to our recent meeting and the corrective action investigation outline previously provided to Cedar, my staff will communicate with Joe Porter (Cedar) in the near future to transmit a proposed consent administrative order for the corrective action activities.

I hope this addresses the issues raised in your June 28, 1990 letter. If further information is needed, please feel free to contact myself or Sammy Bates of my staff.

Sincerely,

Mike Bates

Chief

Hazardous Waste Division

cc: Sammy Bates

MB: CW

Cedar from preceding with the project the Department is concerned with any level of chemical contamination of the environment. In follow up to our recent meeting and the corrective action investigation outline previously provided to Cedar, my staff will communicate with Joe Porter (Cedar) in the near future to transmit a proposed consent administrative order for the corrective action activities.

I hope this addresses the issues raised in your June 28, 1990 letter. If further information is needed, please feel free to contact myself or Sammy Bates of my staff.

Sincerely,

Mike Bates

Chief

Hazardous Waste Division

cc: Sammy Bates

MB: CW

CEDAR CHEMICAL CORPORATION P.O. Box 2749. Hwy. 242 S. • West Helena, AR 72390 (501) 572-3701 • Fax No. 501-572-3795 PERMIT NO. MEDIA: AIR, WATER, SOLID: MAZARDOUS June 19, 1990 SORT: PERMIT, COMPLIANCE FEES: Mike Bates Arkansas Department of Pollution Control & Ecology P.O. Box 9583 8001 National Drive Little Rock, AR Consent Administrative Order, LIS 86-027 Dear Mike: Pursuant to the above referenced Order, a final report of installation and analysis of a groundwater monitoring well system is attached. This report includes the following information: Piezometer elevations from Aug 1988 to June 1990 2. Charts of each piezometer water level Monitoring well water elevations from Aug 1989 to June 1990 3. Charts of each monitoring well water level 4. 5. Analytical data for each monitoring well Engineering report including boring logs 6. and well descriptions. Over the next several weeks we will be developing plans to determine the nature, extent, and cause of groundwater values. Further assessment is required to determine the relationship in different elevations of water levels and our recent findings on the plant site. Sincerely, Joe E. Porter Environmental Engineer cc: J.H. Miles A. Malone J.R. Tomblin

STATE OF ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501) 562-7444 FAX: (501) 562-4632

July 17, 1990

CSN: 540068 PERMIT NO.
MEDIA: AIR, WATER SOLID, HAZARDOUS
SORT: PERMIT, COMPLIANCE
FEES

Allen T. Malone
Apperson, Crump, Duzane & Maxwell
Suite 2110
One Commerce Square
Memphis, TN 38103

RE: Cedar Chemical Corporation

West Helena Plant

Dear Mr. Malone:

We have received your letter dated June 28, 1990, which transmitted Cedar Chemical Contractor's final site Characterization Report regarding proposed new construction on the West Helena Plant grounds. Your letter also requests confirmation that the report forwarded by Joe Porter (Cedar Chemical) on June 10, 1990, completed the tasks under the Consent Administrative Order (CAO) LIS 86-027.

Our staff has given the documents referenced above preliminary reviews. Based on these reviews the following observations are offered. The groundwater monitoring/investigation plan which was approved for implementation under CAO LIS 86-027 requires that a summary and engineering evaluation of the facilities impact on the upper most aquifer be included as part of the final report. Our preliminary review has found the final report incomplete in this area.


The Site Characterization Report prepared by Cedar's consultant indicates levels of Dinoseb, Propanil, and other constituents in the area of the proposed tank farm and process area ranging from trace levels to inexcess of 160 ppm. The contamination which has been characterized in the proposed project area will of necessity be incorporated into a site-wide investigation as we discussed during our meeting of June 1990.


While the reported levels are not extensive enough to warrant removal or immediate action or that would preclude

DATE	1_PIEZO	2_PIEZO	2A_PIEZO	3_PIEZO	3A_PIEZO	4_PIEZO	5_PIEZO	6_PIEZO	6A_PIEZO	7_PIEZO
08/24/88	168.02	167.90	181.81		179.11	167.29			183.06	167.30
08/30/88	167.77	167.40	181.81		179.11	168.21	167.73	167.54	182.81	167.55
09/19/88	170.35	170.15	181.81		179.11	170.46	169.89	169.87	182.15	169.89
10/07/88	170.27	170.06	181.81		179.11	170.38	169.89			
10/13/88	170.52	170.15	181.81	170.52	179.11	170.54	169.89	169.96	181,31	169.80
10/21/88	170.60	170.31	181.81	170.68	179.11	170.63	170.14	170.04	181.23	169.97
10/28/88	170.77	170.48	181.73	170.85	179.11	170.79	170.23	170.29	181.65	170.14
11/04/88	171.02	170.65	181.73	171.10	179.11	171.04	170.48	170.46	167.90	
11/11/88	170.85	170.56	181.73	170.93	179.11	170.88	170.31	170.29		170.22
11/18/88	171.02	170.90	181.73	171.35	179.11	171.29	170.73	170.71	181.40	
11/29/88	173.27	172.90	181.73	173.18	179.11	173.21	172.48	172.54	183.98	
12/16/88	173.27	172.98	181.73	173.18	179.11	173.21	172.56			
01/06/89	175.18	174.81	181.73	175.18	179.11	175.29	174.48	174.54	187.23	174.39
01/20/89	176.77	176.48	181.73	176.77	179.11	176.96	176.14	176.12		
01/27/89	176.60	176.15	181.73	176.43	179.11	176.63	175.81	175.79	188.65	175.72
02/02/89	176.85	176.56	181.73		179.11	177.04	176.23	176.29		176.22
02/10/89	176.77	176.48	181.73	176.85	179.11	176.96	176.23	176.21	189.81	176.05
02/24/89	178.68	178.40	181.73	178.77	179.11	178.79	178.06	178.04	190.31	178.05
03/03/89	179.02	178.73	181.73	179.10	179.11	179.13	178.48	178.46	190.90	178.47
03/10/89	178.93	178.65	181.73	179.02	179.11	179.13	178.48	178.37	190.73	178.30
03/31/89	178.93	178.65	181.73	179.02	179.11	179.29	178.48	178.37	190.06	178.39
04/07/89	178.85	178.56	181.73	179.02	179.11	179.13	178.39		190.15	178.30
04/14/89	178.18	177.98	181.73	178.35	179.11	178.46	177.81	177.71	189.40	177.72
04/21/89	177.60	177.56	181.64		179.03	177.96	177.06	177.12	188.65	176.97
04/28/89	177.52	177.48	181.64	177.77	179.03	177.79	176.98	176.96	187.90	176.89
05/05/89	177.35	176.98	181.64		179.03	177.54	176.81	176.79	187.40	176.72
05/12/89	178.10	177.65	181.64	178.18	179.03	178.21	177.48	176.37	187.48	177.39
05/19/89	176.68	176.40	181.64	176.68	179.03	176.71	175.98	175.96	187.06	175.89
05/26/89	176.92	176.43	181.31	175.90	179.13	176.98	176.01	176.04	187.80	175.97
06/02/89	176.15	175.68	181.31	176.15	179.13	176.31	175.31	175.29	187.33	175.22
06/09/89	176.20	175.68	181.31		179.13	176.31	175.26	175.29	187.08	175.22
06/16/89	177.90	177.43	181.31	177.95	179.13	178.06	177.21	177.19	188.28	177.12
06/23/89	177.25	176.83	181.31	177.30	179.13	177.46	176.46	176.39	188.18	176.42
06/30/89	176.80	176.38	181.31	176.85	179.13	177.06	176.06	175.99	187.58	175.97
07/07/89	179.20	178.83	182.76	179.45	179.18	179.46	178.76	178.59	189.13	178.52
07/14/89	178,50	178.13	182.81	178.70	179.48	178.86	178.06	177.94	189.43	177.92
07/21/89	177.50	177.08	182.21	177.60	179.43	177.81	176.81	176.69	189.18	176.72
07/28/89	176.60	176.18	181.31	176.70	179.28	176.91	175.91	175.84	188.63	175.77
08/04/89	176.40	175.98	181.31	176.55	179.13	176.76	175.86	175.79	188.53	175.77
08/11/89	174.35	173.83	181.31	174.85	179.13	175.21	174.36	174.19	187.58	174.22
08/16/89	171.30	170.98	181.31	171.35	179.13	170.51	170.36	170.09	186.28	170.22
08/25/89	173,30	172.83	181.31	173.45	179.13	173.66	172.61	172.54	185.83	172.52
09/01/89	173.75	173.33	181.31	173.85	179.13	174.06	173.01	172.99	186.28	172.92
09/08/89	173.15	172.83	181.31	173.65	179.13	173.76	173.01	172.84	185.48	172.87
09/18/89	174.65	174.23	181.31	174.85	179.13	174.96	174.11	174.04	185.28	173.97
09/22/89	174.65	174.23	181.31	174.85	179.13	173.96	174.11	174.09	184.98	174.02
10/05/89	175.60	175.13	181.31	175.75	179.13	175.86	175.01	174.94	186.23	174.92
10/13/89	175.45	175.03	181.31		179.13	175.76	174.91	174.84	185.53	174.77
10/17/89	175.60	175.13	181.31	175.70	179.13	175.86	175.01	174.94	185.48	174.87


Piezometer Elevation Report


DATE	1_PIEZO	2_PIEZO	2A_PIEZO	3_PIEZO	3A_PIEZO	4_PIEZO	5_PIEZO	6_PIEZO	6A_PIEZO	7_PIEZO
10/20/89	175.80	175.38	181.31	176.00	179.13	176.06	175.21	175.19	186.13	175.12
10/27/89	175.75	175.33	181.31	175.90	179.13	176.01	175.16	175.09	185.78	175.07
11/03/89	175.65	175.23	181.31	175.75	179.13	175.86	175.06	174.99	185.23	174.92
11/10/89	175.80	175.33	181.31	175.90	179.13	176.01	175.21	175.19	185.78	175.07
11/17/89	175.80	175.33	181.31	175.90	179.13	176.01	175.16	175.14	185.68	175.07
11/27/89	176.10	175.68	181.31	176.25	179.13	176.36	175.46	175.49	186.73	175.42
12/01/89	175.95	175.53	181.31	176.05	179.13	175.71	175.31	175.29	186.33	175.22
12/08/89		175.43	181.31	176.00	179.13	176.11	175.26	175.24	185.83	175.17
12/11/89	175.85	175.38	181.31	175.95	179.13	176.11	175.26	175.19	185.78	175.12
12/15/89	175.75	175.23	181.31	175.80	179.13	175.96	175.11	175.09	185.53	174.97
12/21/89	175.55	175.08	181.31	175.65	179.13	176.26	174.96	174.89	185.33	174.82
12/28/89	175.50	175.03	181.31	175.60	179.13	175.71	174.81	174.84	185.23	174.72
01/05/90		176.03	181.31	176.50	179.13	176.76	175.81	175.84	187.23	175.72
01/12/90	176.95	176.48	181.31	177.00	179.13	177.26	176.31	176.29	187.93	176.17
01/19/90	176.25	176.68	181.31	177.30	179.13	177.51	176.56	176.59	188.23	176.47
01/26/90	177.90	177.43	181.31	178.00	179.13	178.21	177.26	177.24	188.93	177.17
02/02/90	178.80	178.33	181.31	178.85	179.13	179.06	178.11	178.09	189.53	178.02
02/08/90	179.70	179.28	182.21	179.85	179.28	179.96	179.06	179.04	190.13	178.97
02/16/90	179.95	179.53	182.66	180.05	179.73	180.26	179.36	179.29	190.28	179.27
02/23/90	180.10	179.68	180.86	180.20	179.88	180.46	179.51	179.44	190.58	179.42
03/02/90	179.85	179.48	182.86	180.00	180.13	180.21	179.31	179.24	190.53	179.22
03/09/90	180.45	180.03	183.16	180.50	180.28	180.81	179.86	179.79	190.63	179.77
03/19/90	180.55	180.23	183.26	180.75	180.38	181.06	180.06	179.94	190.73	179.92
03/23/90	180.05	179.73	183.66	181.25	180.48	180.56	179.56	179.44	190.33	179.47
03/30/90	180.25	179.88	183.41	180.45	180.73	180.76	179.76	179.59	190.43	179.62
04/06/90	180.05	179.73	183.46	180.25	180,63	180.56	179.61	179.44	190.03	179.42
04/12/90	180.20	179.83	183.56	180.40	180.78	180.66	179.66	179.54	190.03	179.57
04/19/90	179.90	179.53	183.31	180.10	181.18	180.31	179.41	179.29	189.98	179.27
04/26/90	179.70	179.33	183.06	179.90	181.48	180.06	179.21	179.04	189.88	179.07
05/07/90	179.80	179.48	183.26	180.00	181.73	180.11	179.31	179.19	189.83	179.17
05/11/90	179.35	179.03	182.91	179.55	181.63	179.71	178.86	178.69	189.38	178.72
05/18/90	179.15	178.83	182.46	179.35	181.63	179.51	178.66	178.54	189.13	178.52
05/24/90		179.53	183.61	180.05	182.08	180.26	179.36	179.24	189.78	179.22
06/01/90		179.03	182.66	179.55	181.98	179.71	178.86	178.74	189.13	178.72
06/08/90			182.56	179.70	182.03	179.81	179.01	178.89	189.18	178.87
Average f	176.36	176.00	181.84	176.49	179.50	176.59	175.80	175.73	187.08	175.69
									=======	

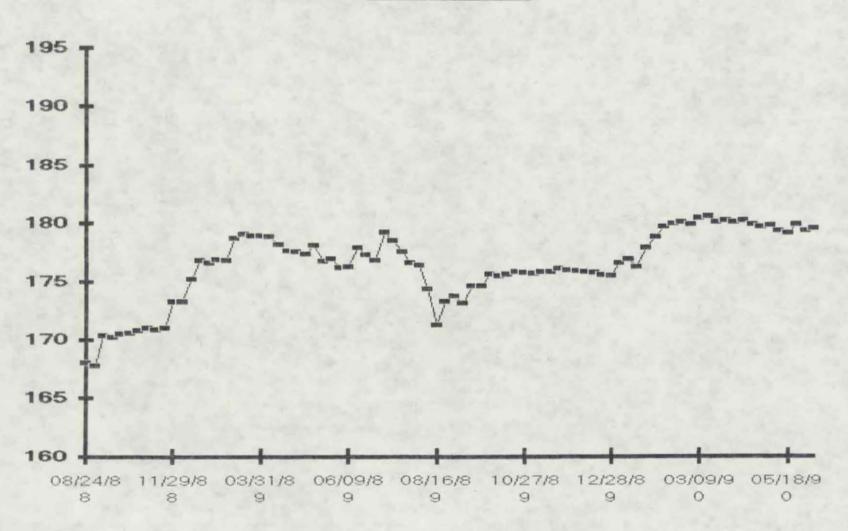

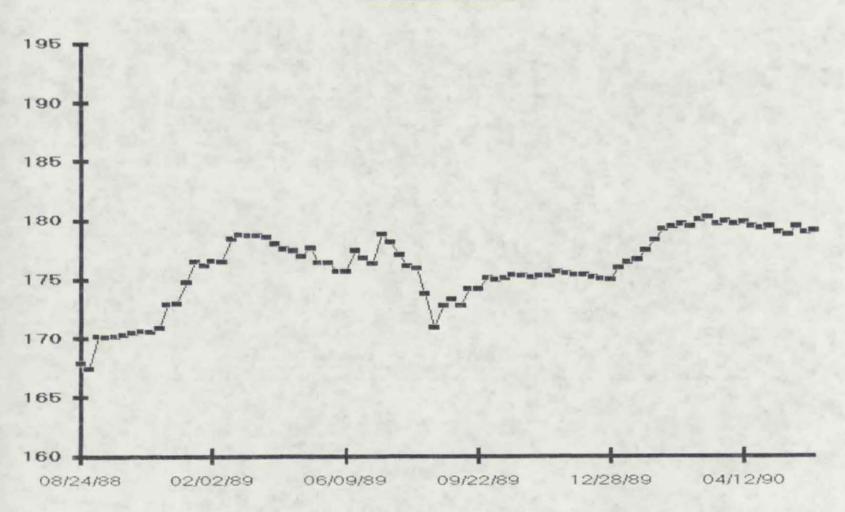



Piezometer 2A

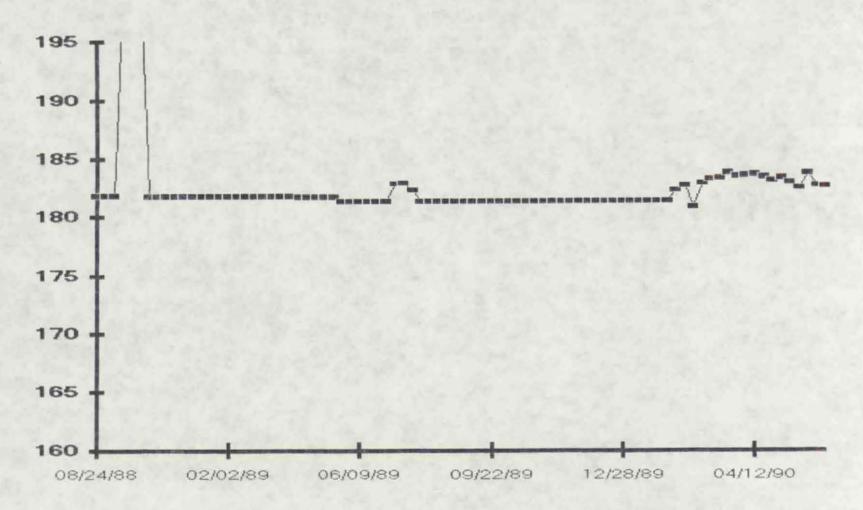

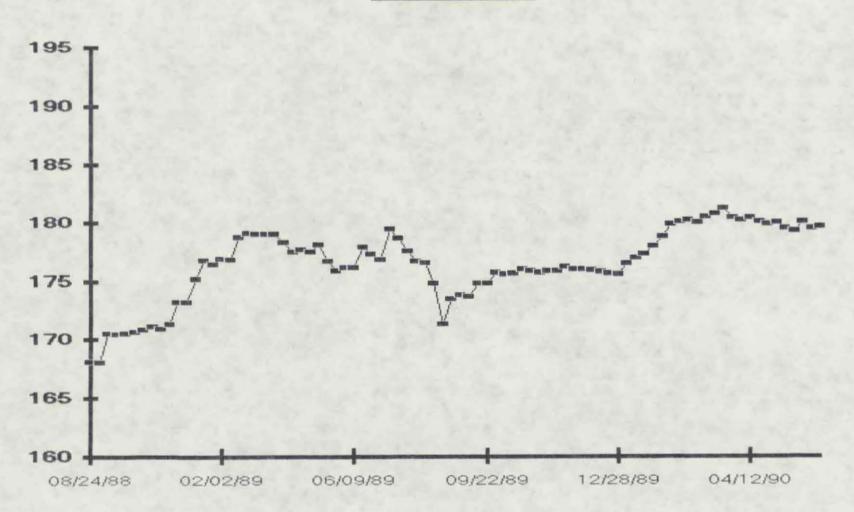

Piezometer 3a

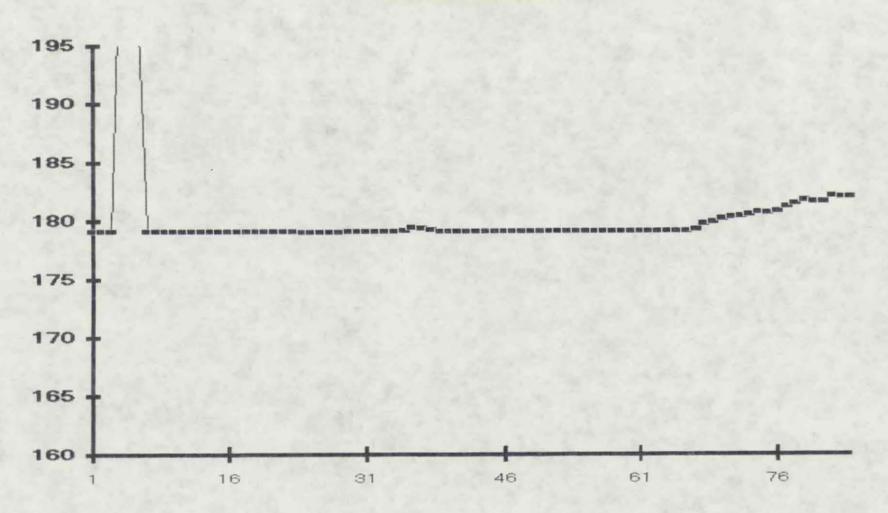

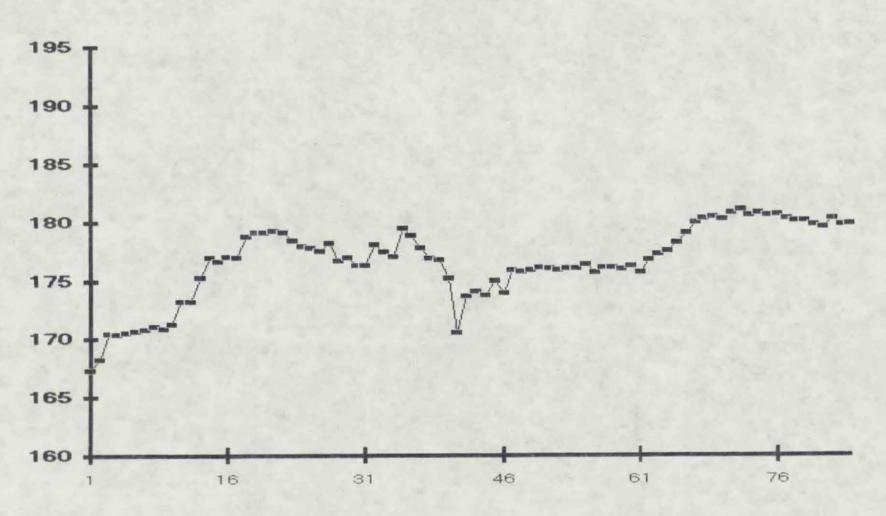



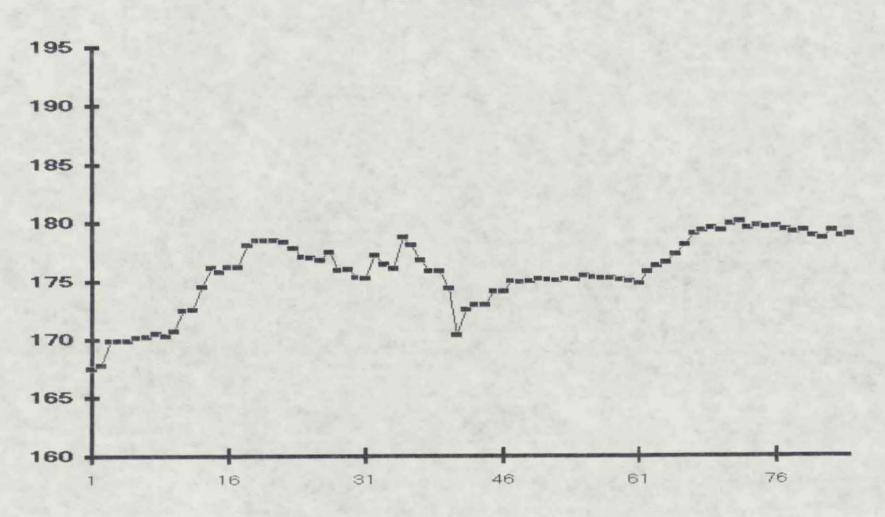



Chart9

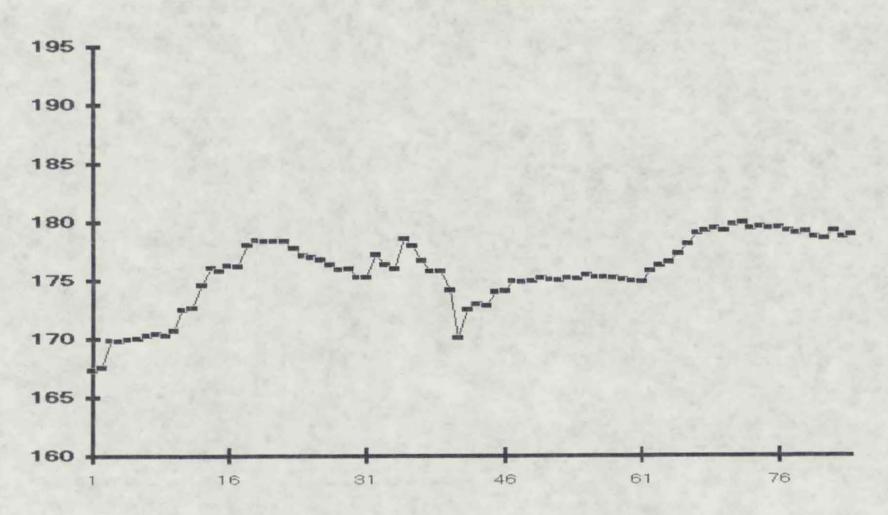


Piezometer 6A

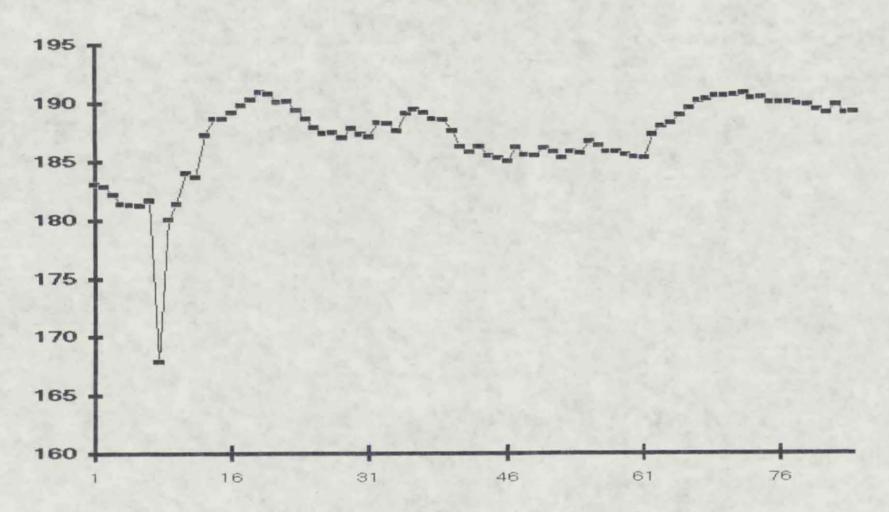



Piezometer 7

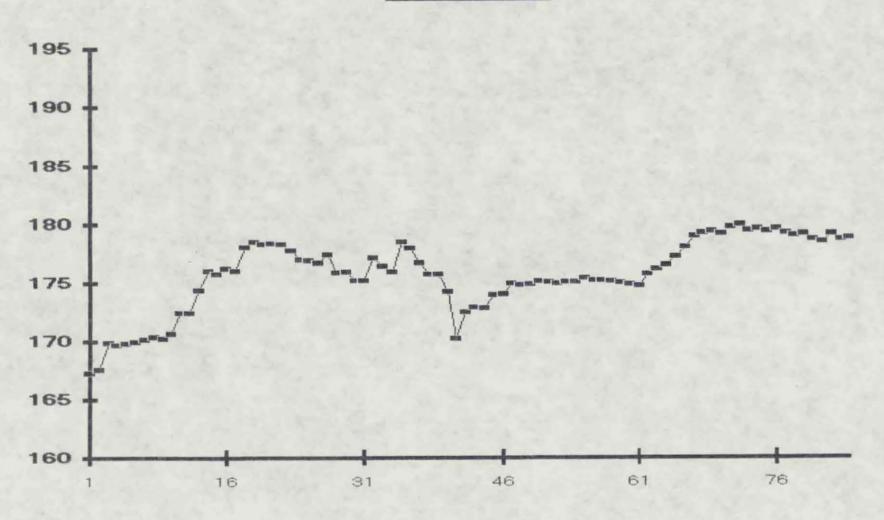



DATE	MW_1	MM_2	MW_3	MW_4	MW_6	MW_6A	MW_6B	MW_6C	MW_7
08/25/89	184.43	172.86	172.48	184.68	172.04	172.08	185.53	185.64	172.32
09/01/89	184.43	173.31	172.88	184.88	172.49	172.48	186.03	186.14	172.77
09/08/89	183.98	172.91	172.68	184.28	172.34	172.38	185.23	185.34	172.72
09/18/89	184.08	174.21	173.88	184.18	173.54	173.53	184.98	185.09	173.82
09/22/89	183.88	174.21	173.88	183.93	174.54	173.58	184.73	184.74	173.87
10/05/89	184.93	175.11	174.78	185.08	174.49	174.48	186.03	186.09	174.72
10/13/89	184.78	175.01	174.63	184.63	174.34	174.38	185.28	185.34	174.62
10/17/89	184.63	175.11	174.73	184.48	174.44	174.48	185.33	185.34	174.52
10/20/89	185.13	175.36	174.98	184.93	174.69	174.68	185.93	185.99	174.9
10/27/89	185.08	175.26	174.93	184.78	174.59	174.63	185.53	185.59	174.92
11/03/89	184.43	175.16	174.83	184.18	174.49	174.53	184.98	185.04	174.7
11/10/89	184.68	175.31	174.98	184.58	174.64	174.68	185.58	185.64	174.92
11/17/89	184.73	175.26	174.93	184.53	174.64	174.68	185.48	185.54	174.97
11/27/89	185.73	175.61	175.28	185.63	174.99	174.98	186.53	186.64	175.2
12/01/89	185.33	175.46	175.08	185.28	174.79	174.83	186.08	186.19	175.0
12/08/89	184.78	175.36	175.03	184.83	174.74	174.73	185.53	185.64	175.0
12/11/89	184.68	175.31	174.98	184.78	174.74	174.73	185.53	185.59	174.9
12/15/89	184.33	175.16	174.83	184.53	174.59	174.58	185.23	185.34	174.8
12/21/89	183.88	175.01	174.68	184.28	174.39	174.43	185.08	185.14	174.6
12/28/89	183.68	174.96	174.63	184.23	174.29	174.33	184.98	185.04	174.5
01/05/90	185.13	175.96	175.63	186.33	175.34	175.38	186.98	187.09	175.5
01/12/90	186.03	176.41	176.08	187.43	175.79	175.83	187.68	187.79	176.0
01/19/90	186.23	176.71	176.38	187.73	176.09	176.08	187.93	188.04	176.2
01/26/90	187.18	177.36	177.03	188.43	176.74	176.78	188.63	188.79	177.0
02/02/90	187.98	178.26	177.93	189.03	177.64	177.63	189.23	189.34	177.8
02/08/90	188.83	179.21	178.88	189.73	178.49	178.53	189.83	189.94	178.8
02/16/90	189.28	180.46	179.13	189.93	178.79	178.78	190.03	190.04	179.0
02/23/90	189.53	179.61	179.28	190.28	178.89	178.93	190.28	190.39	179.2
03/02/90	189.53	179.41	179.08	190.18	178.69	178.73	190.23	190.34	179.0
03/09/90	189.83	180.01	179.63	190.88	179.29	179.33	190.33	190.44	179.5
03/19/90	190.03	180.21	179.83	191.38	179.44	179.43	190.43	190.54	179.7
03/23/90	189.83	179.66	178.88	190.83	178.89	178.98	190.08	190.14	179.2
03/30/90	190.08	179.81	179.48	191.08	179.09	179.13	190.13	190.24	179.4
04/06/90	189.73	179.66	179.33	190.58	178.94	178.98	189.78	189.84	179.2
04/12/90	189.78	179.76	179.48	190.63	179.04	179.08	189.78	189.84	179.3
04/19/90	189.63	179.51	179.18	190.43	178.74	178.78	189.73	189.84	179.1
04/26/90	189.43	179.31	178.98	190.08	178.54	178.58	189.58	189.69	178.9
05/07/90	189.23	180.41	179.08	190.03	178.69	178.68	189.58	189.69	179.0
05/11/90	188.83	178.96	178.63	189.48	178.19	178.23	189.08	189.19	178.5
05/18/90	188.53	178.76	178.43	189.18	178.04	178.08	188.88	188.94	178.4
05/24/90	188.98	179.51	179.18	189.83	178.74	178.78	189.53	189.59	179.0
06/01/90	188.33	178.96	178.63	189.13	178.24	178.28	188.88	188.94	180.5
06/08/90	188.28	179.11	178.78	189.13	178.39	178.38	188.93	189.04	178.7

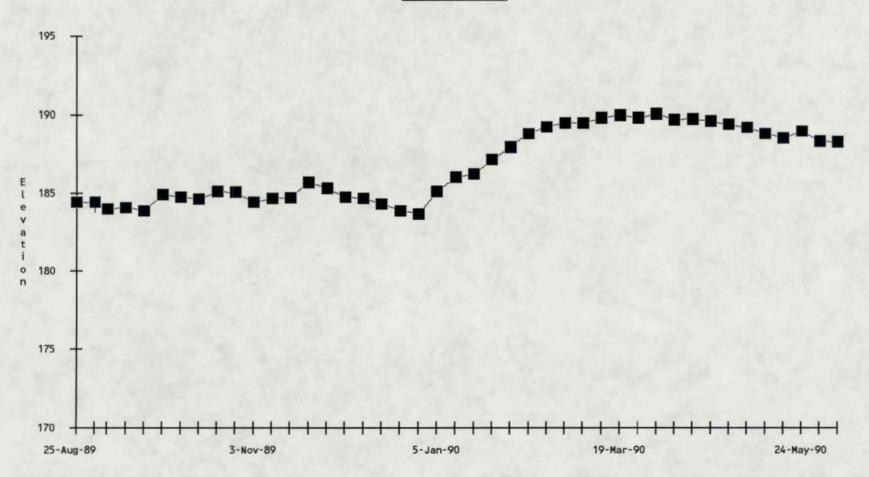


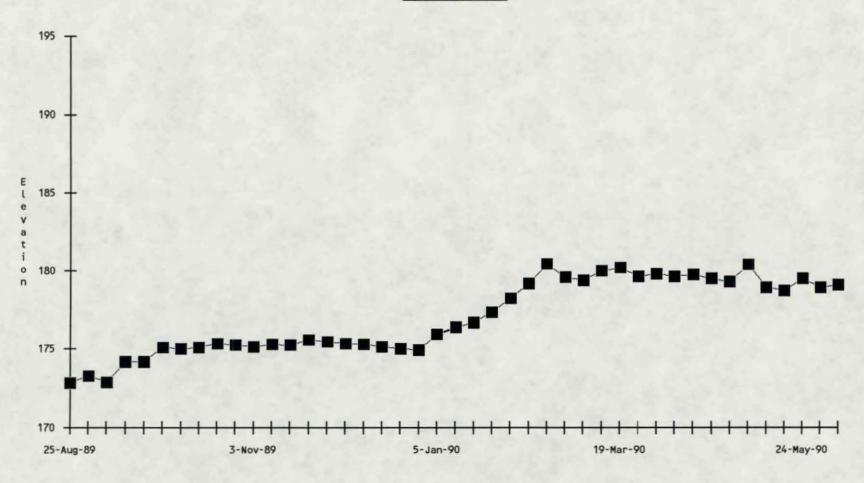


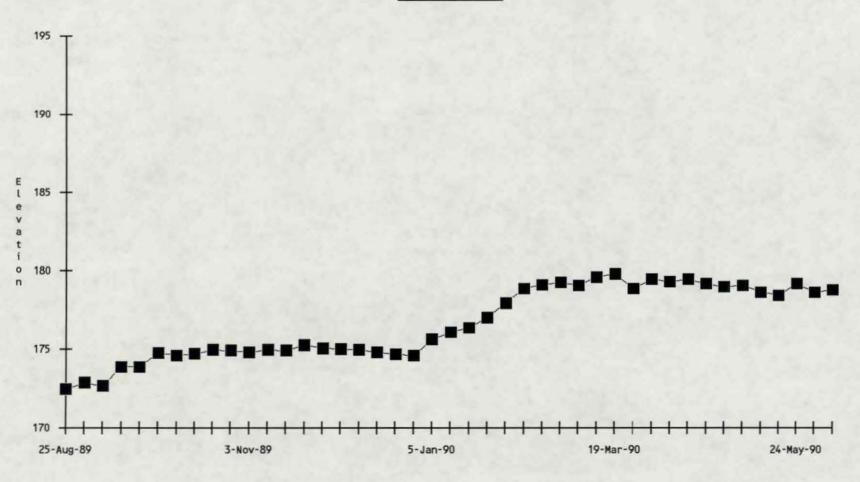


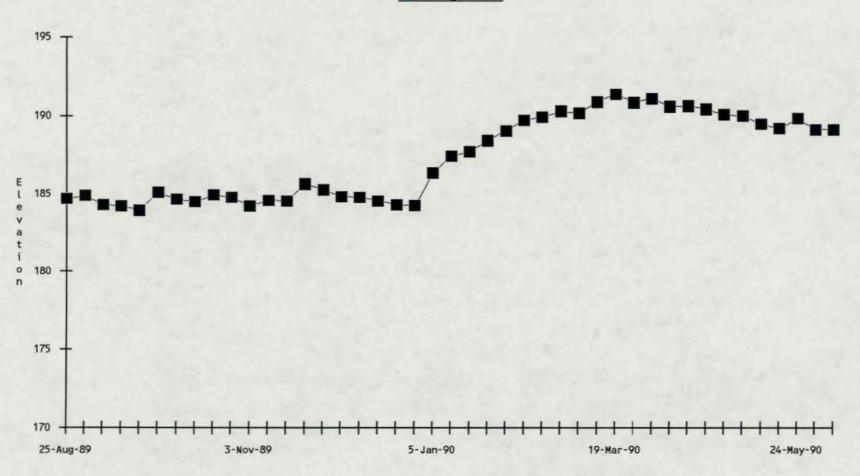


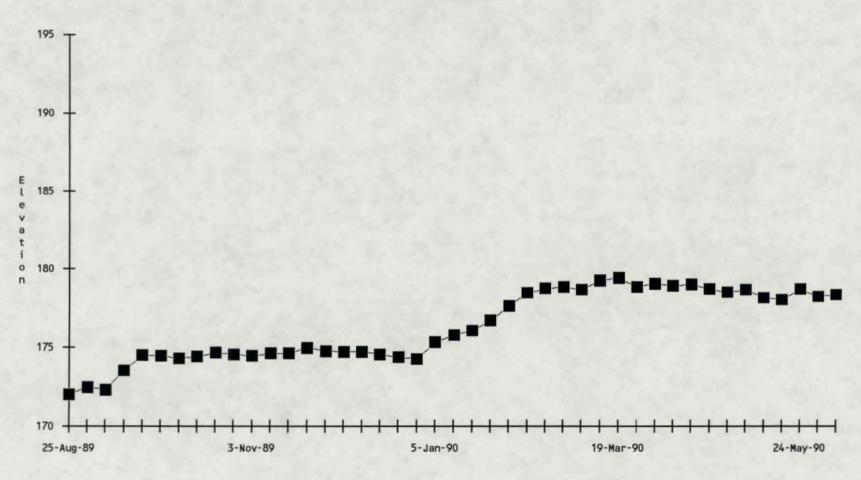





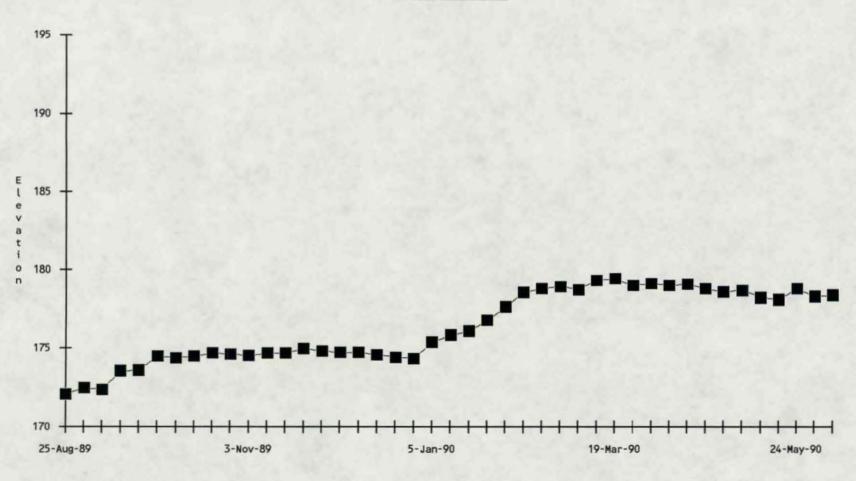

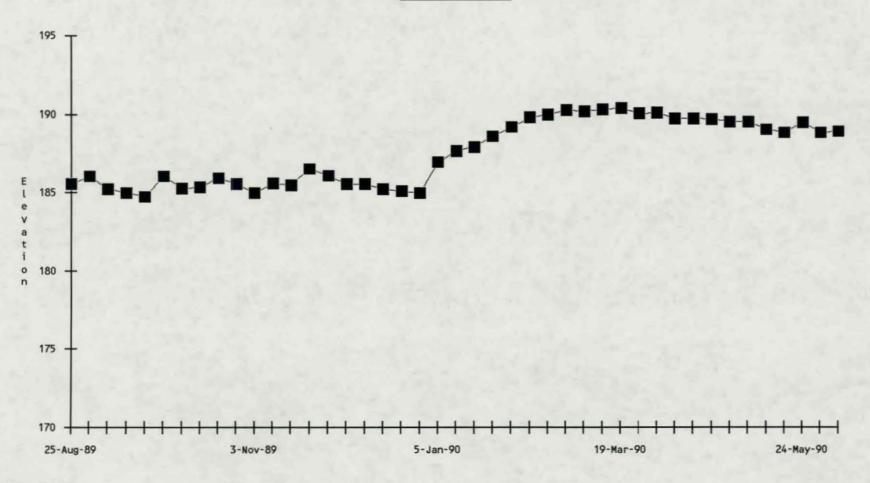


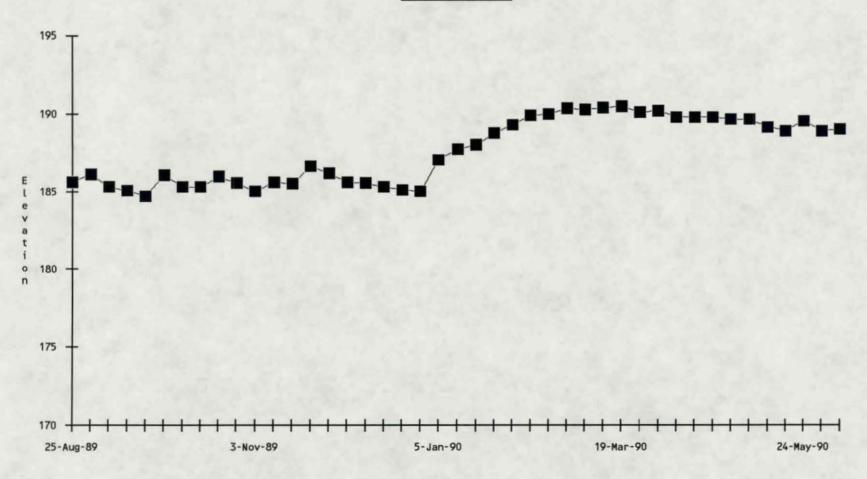

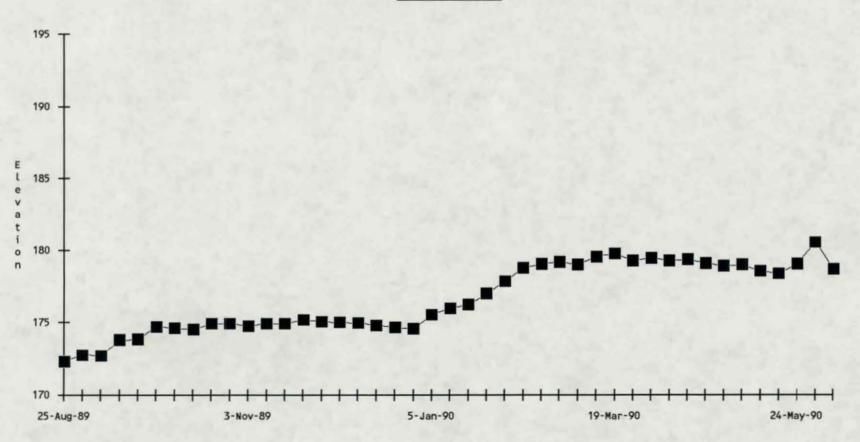



Date V	Well	рН	Spec_Cond	TOH	TOC	Comment
10/17/89 1	1	6.71	1850	0.783 0.765	4.64	Field Duplicate
12/11/89 1		7.28	1900			
02/16/90 1		7.38				
04/26/90 1	1	6.94	2000	0.988	4.76	
Average	for 1	7.07	1937	0.768	4.93	
10/17/89 2	2	6.58	860	0.037	2.06	
12/11/89 2	2	7.42	900	0.065		
12/11/89 2				0.077		Field Duplicate
02/16/90 2		7.81	850			
04/26/90 2	2	7.18	800	0.167	1.93	
Average	for 2	7.24	852	0.073	2.31	
10/17/89	3	6.39	4500	6.570	38.40	
12/11/89	3	6.66	3250	4.970	26.20	
02/16/90 3				3.360	24.44	Field Duplicate
02/16/90	3	6.70	3500	4.370		
04/26/90	3	6.43	4500	6.890	36.01	
Average	for 3	6.54	3937	5.232	30.00	
10/17/89	4	6.82	2800	1.840	10.10	
12/11/89		7.42	2500		9.72	
02/16/90	4	7.49	2900	1.970		
04/26/90				2.153		Field Duplicate
04/26/90	4	7.32	2600	2.059	11.72	
Average	for A	7.26	2700	1.960	11.33	
Average	101 4	1.20	2700	1.900	11.55	
10/17/89	6	7.56	1100	0.081	3.64	
12/11/89	6	7.77	1000	0.273	19.34	
02/16/90	6	8.00	1100	0.053	22.80	
04/26/90	6	7.69	1100	0.089	13.56	
Average	for 6	7.75	1075	0.124	14.83	
10/17/89	6A	7.76	700	0.201	2.31	
12/11/89	6A	7.52	700	0.035	2.37	
02/16/90	6A	7.71	760	0.062	2.81	
04/26/90	6A	7.46	775	0.072	2.94	
Average	for 6A	7.61	733	0.092	2.60	



Date	Well	рН	Spec_Cond	TOH	TOC	Comment
10/17/89 12/11/89 02/16/90 04/26/90	6B 6B	7.33 7.46 7.37 7.23		31.500	84.70	
Average	for 6B	7.34	3375	37.125	65.60	
10/17/89 12/11/89 02/16/90 04/26/90	6C 6C	7.43 7.54 7.07 7.04		50.800 44.800 12.200 24.400	74.80 101.80	
Average	for 6C	7.27	2075	33.050	80.48	
10/17/89 12/11/89 02/16/90 04/26/90	7 7	7.62 7.83 8.08 7.65			8.77 14.03	
Average	e for 7	7.79	1037	3.090	10.16	
10/17/89 12/11/89 02/16/90 04/26/90	F Blan F Blan			0.023 0.029 0.022 0.141	0.66	
Average f	or F Bl	0.00	0	0.053	1.47	

•

10501 Stagecoach Road P.O. Box 5239 Little Rock, AR 72215 501-455-2536 Fax: (501) 455-4137

January 2, 1990 LR89-237

Cedar Chemical Corporation P. O. Box 2749 West Helena, AR 72390

Attention: Mr. Joe Porter

RE: Monitoring Well Installation

Cedar Chemical Company West Helena, Arkansas

Gentlemen:

Attached are the logs of the monitoring wells installed for the Cedar Chemical Company in West Helena, Arkansas. The well locations are shown on Plate 1. Soil stratigraphy and results of field tests are summarized on the log forms, Plates 2 through 10. The well completion diagrams are shown on the right-hand portion of the log forms.

The monitoring wells were installed using a potable water supply. Decontamination procedures were used between wells. The wells were each developed using an engine-driven compressor.

If you have any questions regarding this data or installation procedures, please contact us.


Very truly yours,

GRUBBS, GABNER & HOSKYN, INC.

Richard E. Ackley, P.E.

REA/jj

Copies Submitted: Cedar Chemical Corporation (3)
Attn: Mr. Joe Porter

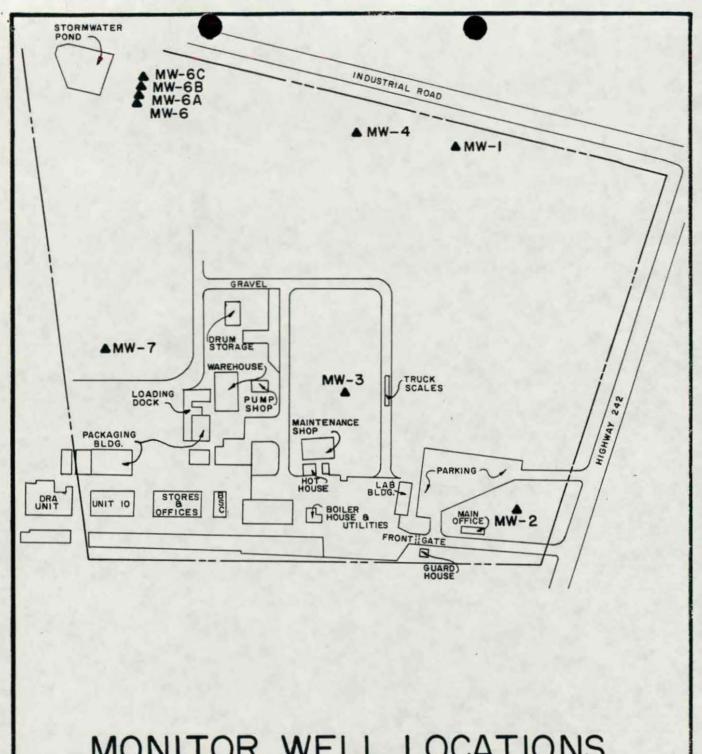

MONITOR WELL LOCATIONS

CEDAR CHEMICAL COMPANY WEST HELENA, ARKANSAS

SCALE |" = 170'



30L LES	DESCRIPTION OF MATERIAL	PER FT	RY WT	0.2	0.4	esion,	<u> </u>	_		4
SAMPLES	F. EL: 196.47	BLOWS	UNIT DRY WT	PLAS LIM +			TENT,		LIQU LIMI	T
	e tan fine sandy silt								8	
Very	stiff tan silty clay					Pr	otec	tive	Cove	&► 8r-7
Very	stiff tan silty clay									0
Stif	f gray silty clay					Ce	ment	Gro	ut —	2
	ootletss and gray below 6 ft					8				
						2-i	nch	diam	eter	1
							nles	s st	eel	,
3.5	and light gray below					rise				0
						8				
					-					
										0
5		-				8				
	at 20 ft									
	m at 20 ft 21 ft				3	Ве	nton	ite	Seal	7
5					(8	Fi1	ter	Sand	2
	- 1-1 20 E 646					-				
-tar	y below 30.5 ft6 and light gray and firm			0		S1	otte	d Sc	reen	2
5 bel	ow 34.5 ft			8			.010		pts)	
COMPLETION	DEPTH: 35 ft DE									

FT)r	ES		ER FT	Y WT FT	0.2	0.4		-0-	/SQ F1		4
DEPTH, FT	SYMBOL	SAMPLES		BLOWS PER	UNIT DRY WT	PLAS LIMI	ric T	co	VATER NTENT	%	LIQU	ID T
	121	1	SURF. EL: 197.65			10	20	30	40	50 6	50 7	0
			Stiff to very stiff tan claye silt	y				Pro	tect	ive C	over	-2-
5 -								Ce	ement	Grou	it —	2
	1	I	Stiff brown and tan silty clay									
10								st		diam ess s		2
	\mathcal{U}			à								
15			Firm brown clayey silt									
20			Firm to soft gray and brown silty clay to very silty clay w/ferrous stains and									
25-			rootlets -Gray below 24 ft					Ве	enton	ite S	eal-	7
30-			Dense tan and gray silty fine sand -w/gray sandy silt seams at					SI (I	lotte	d Scr	een	~
35			29 to 30 ft						Fi	lter	Sand	~
30									18			
	COMP	LE		PTH	TO W	TER			DA			

	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL	BLOWS PER FT	UNIT DRY WT		CO 2 0.4 STIC	-	0.8	1.0	FT L;	2 I	.4
1	SΥ	SAI	SURF. EL: 197.50	BLOW	UNIT	LII	WIT		WATE			LIM	IT
	9839		Stiff tan silty clay -w/gravel on surface -slight odor			10	20	Pr	otec	tive	e Co		2
									Ceme	ent (Grou	ıt –	2.
5 -										8			
_								st	inch ainl				
0									8				
5			Stiff to firm gray silty clay -w/dark gray stains and odor -tan and gray without odor below 18.5 ft					(8				
20-							8		Bento	onit	e Se	eal-	2.
30			Loose to medium dense gray sandy silt					F	ilte:	r Sa	nd	_	2.
			-tan and gray silty clay below 34.5 ft						lotte 0.010				~
35			Dense dark gray sand										

Cedar Chemical Company West Helena, Arkansas

LOCATION: See Plate 1 TYPE: Wash COHESION, TON/SQ FT UNIT DRY WT BLOWS PER 0.2 0.4 0.6 0.8 1.0 1.2 DEPTH. DESCRIPTION OF MATERIAL PLASTIC WATER CONTENT, % LIQUID (Based on Boring 4) SURF. EL: 196.99 70 10 20 30 40 50 60 Stiff tan clayey silt Protective Cover--w/some silty clay pockets Cement Grout -5 Stiff gray silty clay 2-inch diameter -w/ferrous stains and nodules stainless steel -tan and gray below 8 ft riser 10 Stiff tan and gray clayey silt -w/some silty clay pockets and seams 15 -firm and wet below 18 ft 20 Bentonite Seal -gray below 24 ft 25 Filter Sand 30 -more clayey below 32 ft Slotted Screen (0.010" Slots) 35 COMPLETION DEPTH: DEPTH TO WATER 35 ft IN BORING: DATE: DATE: 8/14/89

Stiff brown clayey silt -w/odor Very stiff gray and tan silty clay -w/ferrous stains Stiff to firm greenish gray silty clay -w/odor -tan and gray below 15.5 ft Firm to stiff tan clayey silt -w/ferrous stains and slight odor -gray below 25 ft Loose to medium dense gray fine sandy silt Dense gray fine to coarse sand -w/gravel below 65 ft -w/gravel below 70 ft Filter Sand Slotted Screen (0.010" Slotte)	DEPTH, FT	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL SURF. EL: 196.59	BLOWS PER FT	UNIT DRY WT LB/CU FT		O. STIC	4 0	.6 0	TER TENT,			Т	
Clay -w/ferrous stains Stiff to firm greenish gray silty clay -w/odor -tan and gray below 15.5 ft Firm to stiff tan clayey silt -w/ferrous stains and slight odor -gray below 25 ft Loose to medium dense gray fine sandy silt Dense gray fine to coarse sand We gravel below 65 ft -w/gravel below 70 ft Filter Sand Solots S										Pro	tect	ive	Cove	17.	
Silty clay -w/odor -tan and gray below 15.5 ft Firm to stiff tan clayey silt -w/ferrous stains and slight odor -gray below 25 ft Loose to medium dense gray fine sandy silt Dense gray fine to coarse sand -w/gravel below 65 ft -w/gravel below 70 ft -w/gravel below 70 ft	5			clay						Ceme	nt (_	ح.	0
-w/ferrous stains and slight odor -gray below 25 ft Loose to medium dense gray fine sandy silt Dense gray fine to coarse sand -w/gravel below 65 ft -w/gravel below 70 ft Tilter Sand Slotted Screen (0 010 51 51 50 51				silty clay -w/odor				6		nch				er-2	
-w/ferrous stains and slight odor -gray below 25 ft Loose to medium dense gray fine sandy silt Dense gray fine to coarse sand -w/gravel below 65 ft -more gravel below 70 ft Slotted Screen (0.010) Slotted									8						0
Loose to medium dense gray fine sandy silt Dense gray fine to coarse sand We will be a sand silt Dense gray fine to coarse sand Dense gray fine to coarse sand Solution of the sand silt The sand silt s				-w/ferrous stains and slight odor					8						,
Loose to medium dense gray fine sandy silt Dense gray fine to coarse sand -w/gravel below 65 ft -more gravel below 70 ft 50/5" Filter Sand Slotted Screen								8							
fine sandy silt Dense gray fine to coarse sand	·O†	1		I and to medium denote grow				8	8						
-w/gravel below 65 ft -w/gravel below 65 ft -w/gravel below 70 ft -more gravel below 70 ft 50/6" Filter Sand Slotted Screen (0.010" Slotted)	0	111	Z	fine sandy silt Dense gray fine to coarse			8								
Slotted Screen (0.010" Slotte)	0-	0 0	X	-w/gravel below 65 ft	50/	6":				Ber	ton	ite S	eal	2	0.0
C IVY CVI I		-, v:00	K.A	-more gravel below 70 ft						Slo	tte	Scr	een	2.	

DEPTH, FT	SYMBOL	DESCRIPTION OF MATERIAL SURF. EL: 196.46	BLOWS PER FT	UNIT DRY WT	0.2 PLASTI LIMIT	COH 0.4 C	ESION, TO	1.0 1. 1T, %	LIQUI	ID T	
	1	Stiff brown clayey silt					Prote	ctive	Cover	. ~	
5 -		Very stiff gray and tan silty clay -w/ferrous stains					Cemen	t Grou	= -	2	0.
-15		Stiff to firm greenish gray silty clay -w/odor -tan and gray below 15.5 ft						h diam less s			
-20 -25 -30		Firm to stiff tan clayey silt w/ferrous stains and slight odor -gray below 25 ft									
35-							Bento	nite S	eål -	2	
40							Fi	lter S	and -	2.	
45		Loose to medium dense gray fine sandy silt						ed Scr 0" Slo		2.	
	COMP	30 20		TO WA	TER			ATE:			

TYPE:	Wash	E		De		HESION, T	ON/SQ FT		T
SYMBOL SAMPLES	DESCRIPTION OF MATERIAL SURF. EL: 196.47	BLOWS PER	UNIT DRY WT	PLAS	TIC	0.6 0.8 WAT CONTE	ER ENT,%	LIQUID LIMIT	
	Stiff brown clayey silt -w/odor					Pro	tective		2
5	Very stiff gray and tan silty clay -w/ferrous stains					2-: sta	inch diainless	ameter	
0	Stiff to firm greenish gray silty clay -w/odor								- Q
5	-tan and gray below 15.5 ft					Ber	ntomite	Seal-a	
201	Firm to stiff tan clayey silt -w/ferrous stains and slight odor -gray below 25 ft					Fil	ter San	1-2,	
30						S1.	otted S.	treen lots)	2
	TION DEPTH: 30 ft DE 8/9/89 IN	PTH	TO WA	TER			DATE:		

LOG OF MONITOR WELL NO. 6C Cedar Chemical Company

West Helena, Arkansas

1		S		R FT	TW"			_	ON, TO	_			
DEPTH, F	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL	BLOWS PER	UNIT DRY WT	PLAS		-	WATER	2	1.2 LI	QUID MIT	
٥)	SURF. EL: 196.40	BLC	2	10	20	30		50	60	70	
			Stiff brown clayey silt -w/odor					P	roted	ctive	Cov	er ~	-
									Ceme	ent (Grout	7.	6 . 0 .
5	W	+	Very stiff gray and tan silty					+			iame s st		
	W		clay -w/ferrous stains						rise		30	2	
	\mathcal{H}		-w/lellous stains					-	Bent	tonit	e Se	al Z	
									F11	ter S	Sand -	2-	
0	1	+	Stiff to firm greenish gray										
	1		silty clay -w/odor						Slo	tted	Scre	en	
			w/ oddi						(0.	010"	Slot	(s) Z	
5				_		1		1		+	+		
	13												
								+		-			
	COME	L	TION DEPTH: 15 ft DE	DTU	TO WA	TER		_		1			

	T	SAMPLES	DESCRIPTION OF MATERIAL	PER FT	UNIT DRY WT		0.2		_		TON/	SQ 1		1.	4
2	2	SAMI		BLOWS PER	UNIT D		ASTI			CON	TER TENT,			LIMI	T
133	8 10	4	SURF. EL: 196.86	_			10	20	30	0 4	0	50	60	7	0
**	000		Loose tan sandy silt Loose gray silt w/gravel and odor (yellow tint)							THE RESIDENCE	tect ver	ve	+	2	
7	4		Stiff to firm tan silty clay					+					1		
7										С	emen	E G	rou	ıt-	2
1		ı							,		⊗				
	1								st	ain	h di less				
1									ri	ser		-		-	
	H												1		
								8							
5			Stiff tan and grayyclayey				+	+	8			-	+		
			silt												
			Firm tan and gray silty clay w/ferrous stains					8					1		
	1		W/ICIIOUS SCULINS												
5/	1	H	Stiff gray clayey silt				-	(8	+	8		+	+		
=			50111 810, 510,o, 5110							Ben	toni	te	Sea	al -	2
	7		Stiff gray silty clay w/some wood fragments and sand			11				8			8		
5			seams							Fi1	ter	San	ıd -		2-
			Dense gray silty fine sand -less silty fine to medium				1				tted				
5			sand below 40 ft					+		(0.	010'	SI	ots	3) 1	2
	**	+					-	+	+				+		-
	MP	F	TION DEPTH: 42 ft DE	DTU	TO W			1		-		_			\sqcup

STATE OF ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501) 562-7444 FAX: (501) 562-4632

CSN. 54-0068 PERMIT NO.

SORT: PERMIT, COMPLIANCE

MEDIA: AIR, WATER, SOLID, HAZARDOUS

CERTIFIED MAIL

June 26, 1990

Mr. Joe Porter Cedar Chemical Corporation P. O. Box 2749 West Helena, AR 72390

Compliance Evaluation Inspection

ARD990660649

Dear Mr. Porter:

On February 26, 1990, I performed a routine Compliance Evaluation Inspection of your facility pursuant to the Arkansas Hazardous Waste Management Act (Act 406) of 1979, as amended and the Arkansas Hazardous Waste Management Code (Code). The inspection revealed that you are not in compliance with the regulations. The violation(s) discovered are summarized in this letter and documented in the enclosed inspection report:

Purged well water was observed discharging directly onto the ground. Contaminated ground water is considered hazardous waste. Disposal of hazardous waste at an unpermitted site within the State of Arkansas is a violation of Section 4 of the Arkansas Hazardous Waste Management Code (Code). Chemical Corporation must stop discharging contaminated ground water onto the ground.

You should immediately undertake to correct the violation(s) noted above. You must submit a written report stating what is to be done to contain the purged water, a description of how it will be stored, and how it is to be disposed of within thirty (30) days of receipt of this letter.

The above cited violations are considered unlawful acts according to Section 12 of Act 406 and as such are subject to the penalties of Section 13 of Act 406. Failure to comply may result in the escalation of enforcement actions including the assessment of civil penalties.

If you should have any questions regarding this matter, please do not hesitate to contact me.

Sincerely,

David Hartley, Geologist Hazardous Waste Division

DH/ckh:LTR924

Enclosure

6-4-90 de le l'Illen T. Malone Cedas Chenical Dick Karkanien - Cedas Chenical - ASPCAE, Derick, Dick C. Ken, David, Mike, and I - Recovered containers on-site in a bin now (dinoseh) - CAP to be accomplished thru RATFA via our order or permit - Auto LOIS or is NOD needed? NOD needed! - Site remains subject to RCRA corrective action since it was to snce an interim-status facility. - Permitting if necessary will require state/EPA
joint permit - CAD now with CAP outline with timeframes. - Either amend G.W.M. CAD or institute a new CAD (referenced above) - Need for immediate actions (interim measures) in the Proposed CAD 1. Identify SWMU'S (via "exposure assessments") 2. Information on releases or potential releases. 3. Interin measures recommendations (areas that meed immediate attention)
4. Dispute resolution provisions?
Right of Contribution? NCP? RATFA? * Wait for final report on present CAO and issue new CAO.

BY DEROX TELECOPIER 7010 : 5-30-90 11:41AM :

9015210789+ 34750;# 1

CHANGE'N METCAL MICHES HILLIAN P METCAL MYZHAO HILLIAN AMPERSON 1308 985

GANGE CONTRACTOR

LAW OFFICES

APPERSON, CRUMP, DUZANE & MAXWELL

SUITE 2110

ONE COMMERCE SQUARE
MEMPHIS, TENNESSEE 38103

901,525 1711

TELECOPY 901 521-0789

16

EAST OFFICE

SUITE IOO RIPBY CERTRE 1795 K PBY PARKWAY MEMPHAS, TENHESSEE 36119 901: 756 8300 TELECOPY GUILLET 1295

TELECOPIER TRANSMITTAL COVER SHEET

DATE: 5-3 0	CSN: 540068 PERMIT NO. MEDIA: AIR, WATER, SOLID, NAZARDOUS SORT: PERMIT, COMPLIANCE
10: Mr. Mike Betes	FEES
TELECOPIER NUMBER: (501) 562-1	4632
NUMBER OF PAGES, INCLUDING THIS SHEET:	3
Allen T. Malone	
THE WOOD DO NOT RECEIVE ALL PAGES OR HAVE A	NY PROBLEMS 25-1711.
TELECOPY OPERATOR:	a seren

03943

CHARLES W. METCALF, 1842 1924 MICHAY F. METCALF, 1872 1940 OF N. S. AFPERSON, 1856 1985

CHOICES METCALF CRUMP CHOICE & DUZANE CHOICE MAXWELL JR OF G KAMINSKY SEAT . DINKELSPIE. SAFE E HEWGLEY HOSE RUSSELL HAL BYDER TONI CAMPBELL PARKER MELODY W DLIVER WILLIAM B MASON, JR STEVEN N. DOUGLASS RANDY S. DARDNER

RAMUE RUBENSTEIN OF COURSEL

LAW OFFICES APPERSON, CRUMP, DUZANE & MAXWELL

SUITE 2110

ONE COMMERCE SOUARE

MEMPHIS, TENNESSEE 38103

901:525-1711

TELECOPY 901/821-0789

May 30, 1990

T199EE 3819

FAX (501) 562-4632

Mr. Mike Bates, Manager Hazardous Waste Division Department of Pollution Control & Ecology 8001 National Drive Little Rock, Arkansas 72209

> Re: Cedar Chemical Corporation West Helena, Arkansas

Dear Mr. Bates:

Joe Porter, the Environmental Engineer at Cedar's Nest Welcome Plant, Dick Karkkainen with Woodward-Clyde Consultants, and I would like to meet with you and other members of your staff to discuss the following topics:

- Status of implementation of the revised "Site Characterization and Drum Disposal Area Delineation Work Plan" which was forwarded to you yesterday by Woodward-Clyde, including revisions to the plan.
- Timing of implementation of the Removal Action Work Plan which was sent to you in draft form last month.
- Proposed timing and scope of plant wide facility investigation/corrective measures study.

Cedar has arranged for financing for construction of the DCA Project which will be constructed in the area covered by Woodward-Clyde's work plan, plus an office building and additional facilities to be constructed on the West Helena site. The closing is scheduled in the near future, but a better understanding of each of the three topics will be required by the banks before they are willing to close the loan. I will participate in a conference call with the banks on June 7, 1990. Accordingly, it is important that we meet sometime prior to then, the earlier the better. Any time between June 1 and June 6, would be acceptable.

Sincerely yours,

Allen T. Malone

APPERSON, CRUMP DUZANE & MAXWELL

Mr. Mike Bates May 30, 1990 Page Two

cc: Mr. Joe Porter Mr. Richard D. Karkkainen

RCRA INSPECTION

SITE IDENTIFICATION

1100000011	RD 990660649		2-16-90	
Site Name		Street (or other	identifier)	
Sedar Chemical Corporation		P.O. Box 2749		
City	State	Zip Code	County Na	
West Helena	AR	72390	Phillips	
Site Operator Information				
Name		Telephone Number		
Same	City	(501) 572 - 3701 State		
			Lip code	
Chemical manufacturing of Site Description	pesticides			
Type of Ownership Federal State	County	Municipal	Private	
Type of Ownership Federal State	County	Municipal	Private	
Federal State	sporter Trea			
Federal State Generator Trans	sporter Trea	tment Storage	Disposa	
Federal State Generator Trans	sporter Treat Small-generator INSPECTION INFORMA	tment Storage	Disposa	
Federal State ✓ Generator Trans Non-generator S Principal Inspector Informati Name	sporter Treat Small-generator INSPECTION INFORMA	Title	Disposa Exempted	
Federal State Generator Trans Non-generator S Principal Inspector Informati	sporter Treat Small-generator INSPECTION INFORMA	tment Storage	Disposa Exempted	
Federal State Generator Trans Non-generator S Principal Inspector Informati Name	sporter Treat Small-generator INSPECTION INFORMA	Title	Disposa Exempted	
Federal State Generator Trans Non-generator S Principal Inspector Informati Name Oavid Hartley	sporter Treat Small-generator INSPECTION INFORMA	Title Hazardous Was	Disposa Exempted Le Juspector code & No.)	
Federal State Generator Trans Non-generator S Principal Inspector Informati Name Oavid Hartley Organization	sporter Treat Small-generator INSPECTION INFORMA	Title Hazardous Was Telephone No. (area (501) 567-74	Disposa Exempted Le Juspector code & No.)	
Federal State Generator Trans Non-generator S Principal Inspector Informati Name David Hartley Organization ADPC+ E	sporter Treat Small-generator INSPECTION INFORMA	Title Hazardous Was Telephone No. (area	Disposa Exempted Le Juspector code & No.)	

coda/chemical ARD 990660649 2-16-90

PHOTO #: / of

OFFICIAL PHOTOGRAPH
U.S. ENVIRONMENTAL PROTECTION AGENCY

SUBJECT: Yallow stained soil
LOCATION: Cedar Chemical - near home
yard
CITY: W. Helena COUNTY: Phillips STATE: AR

DATE: 2-16-90 TIME: 13:30

WEATHER: (SUN) [HAZE] [CLOUDY] [RAIN] [SNOW]

PHOTOGRAPHER (SIg.) Deve Hatter

WITNESS: Joe Parler

CAMERA: Poutax K-1000

FILM TYPE: 35mm ASA: 200 T: 1/ F:
NEGATIVE LOCATION: ADPCHE FILE #: HW

PROCESSED BY: ukl Wark
PHOTO #: 0 of 7

OFFICIAL PHOTOGRAPH
U.S. ENVIRONMENTAL PROTECTION AGENCY

SUBJECT: Yellow Stained Soil LOCATION: Codar Chemical - Bone yard

DATE: 3-16-90 TIME: 13:30

WEATHER: (SUN) [HAZE] [CLOUDY] [RAIN] [SNOW]
PHOTOGRAPHER (Sig.) Dave Hatten

CAMERA: Peutax K-1000

FILM TYPE: 35 mm ASA: 200 T: 1/ f:
NEGATIVE LOCATION: ADDCIE FILE #: H
PROCESSED BY: Wal Man

PHOTO #: 3 of 7







P-6 08110

OFFICIAL PHOTOGRAPH
'U.S. ENVIRONMENTAL PROTECTION, AGENCY

SUBJECT: Off-Spec Product Containers LOCATION: Codar Chemical - Product 1 Off- Spec

Product Storage Area

CITY: W. Heleno COUNTY: Phillips STATE: AR

DATE: 3-16-90 TIME:

WEATHER: (SUN) [HAZE] [CLOUDY] [RAIN] [SNOW]

PHOTOGRAPHER (Sig.) Down Hartles WITNESS: Soe Autor

CAMERA: Pentax K 1000

FILM TYPE: 35 Man ASA: 200 T: 1/ f:
NEGATIVE LOCATION: ADPCIE FILE #: HU

PROCESSED BY: Wal Mart
PHOTO #: 4 of

Cedar Chemical

ARD 99066649

OFFICIAL PHOTOGRAPH
U.S. ENVIRONMENTAL PROTECTION AGENCY

SUBJECT: OCP-Spor Product Containers LOCATION: Codar Chemical - Product 1 Def - Spor

CITY: W. Helena COUNTY: Phillips STATE: AR

DATE: 2-16-90 TIME:

WEATHER: (SUN) [HAZE] [CLOUDY] [RAIN] [SNOW]
PHOTOGRAPHER (SIg.) Down Harlie

WITNESS: Joe Porter CAMERA: Poutax K 1000

FILM TYPE: 35 mm ASA: 900 T: 1/ f:

NEGATIVE LOCATION: ADDCIE FILE #: HW PROCESSED BY: Wal Mart

PHOTO #: 5 of

OFFICIAL PHOTOGRAPH
U.S. ENVIRONMENTAL PROTECTION AGENCY

SUBJECT: Off-Spec Product Containers LOCATION: Codar Chemical - Product / Off-

CITY: 62 Helena COUNTY: Phillips STATE: AR
DATE: 2-16-90 TIME:

WEATHER: (SUN) [HAZE] [CLOHOY] [RAIN] [SNOW]
PHOTOGRAPHER (SIg.) Dave Harles

WITNESS: Joe Arter

FILM TYPE: 35 mm ASA: 200 T:1/ f:

NEGATIVE LOCATION: ADACHE FILE #: HO
PROCESSED BY: Wal Want

PHOTO #: 6 of 7







p. 7 of 110 Cedar Chemical ARD990660649 7-16-90

OFFICIAL PHOTOGRAPH U.S. ENVIRONMENTAL PROTECTION AGENCY

SUBJECT: Discharge of purged well water
LOCATION: Codar Chemical

Manitor Wells - 6, 64, 68, 6C

CITY: W. Helena COUNTY: Phillips STATE: AR

DATE: 2-16-90 TIME: 13:20

WEATHER: (ISUN) [HAZE] [CLOUDY] [RAIN] [SNOW]
PHOTOGRAPHER (Sig.) David Hadles

WITNESS: Mark Simpson

CAMERA: Pontax K-1000

FILM TYPE: 35 mm ASA: 200 T:1/ f:

NEGATIVE LOCATION: ADP(+E FILE #: HW

PROCESSED BY: Wal Mart

PHOTO #: 7 of 7



Cedar Chemical Corp. ARD990660649 February 16, 1990

- Vertac Chemical Corporation was dismissed as a party of the action in paragraph 1.
- Cedar ceased discharging any hazardous wastes into the surface impoundments as required in paragraph 2.
- Cedar made hazardous waste determinations and maintains documentation of the determinations with test results as required in paragraph 3.
- 4. Cedar maintains an approved inspection plan. The plan was conditionally approved by the October 22, 1987, letter attached completing paragraph 4 requirements.
- 5. Cedar submitted a narrative description of processes, chemical and physical composition of process wastes generated in the September 15, 1987, letter as required in paragraph 5 of the order.
- 6. Cedar submitted a final closure plan for the hazardous waste storage facilities in their September 14, 1987, letter which was approved and final closure was approved by the December 12, 1988, letter attached. Requirements of paragraphs 6 and 7 were acknowledged by this letter.
- 7. Cedar submitted results of analysis on sludges, sediments and liquids in the surface impoundments on April 27, 1988, for review and paragraph 8 of the CAO was deemed satisfied by the attached June 13, 1988, letter. This letter had a typographical error that stated paragraph 9 (hydrogeologic investigation) was completed but should have stated paragraph 8 (surface impoundment investigation) was completed.
- 8. Cedar submitted a hydro-geologic investigation plan on January 25, 1988, and modifications in a letter dated January 4, 1988. The modified hydrogeologic investigation plan was conditionally approved on March 14, 1988, letter attached. This approved submittal satisfies paragraph 9(a) and 9(b) of the CAO.
- Cedar submitted results of the hydrogeologic investigation plan in a hydrogeologic study on July 27, 1988, as required in paragraph 9(c) of the Order.
- 10. Cedar submitted the groundwater monitoring program on September 28, 1988, and was advised to proceed with the implementation of the groundwater monitoring program by attached letter dated December 2, 1988. Comments from ADPC&E staff on the hydrogeologic assessment and the groundwater monitoring program were made in this letter. A June 28, 1989, letter conditionally approved the groundwater monitoring program pursuant to paragraph 10 (c) of the order.

Cedar Chemical Corp. ARD990660649 February 16, 1990

- 11. Cedar has completed 3 rounds of sampling and is to do the last sampling in April, 1990. A final report on the findings is due shortly after the April sampling event to comply with paragraph 10(c) of the Order.
- 12. Cedar submitted payment for civil penalties outlined in paragraph 11 of the CAO in their August 14, 1987, letter.

Cedar Chemical Corporation is currently in compliance with the CAO. Contaminants have been detected in groundwater samples. Additional work is expected since contamination has been detected. The final report should address this.

At the time of the inspection, monitoring wells were being sampled. All purged water was discharged onto the ground. Laboratory analysis confirmed the water to be contaminated on the day of the inspection. This is considered illegal disposal of hazardous waste. See violation listed below.

Areas of Concern

- 1. Groundwater contamination.
- Closed surface impoundments.
- 3. Buried drums including those in the warehouse foundation.
- 4. Visibly stained (yellow) soils.
- 5. Storage conditions of off-spec products.

Violation

Disposal of hazardous waste at an unpermitted site within the State of Arkansas is a violation of Section 4 of the Arkansas Hazardous Waste Management Code.

p. 8 of 110 Cedar Chemical ARD 990660649

P02/03

34750;# 2

CEDAR CHEMICAL CORPORATION

24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348

REPLY TO: P. O. BOX 2749 WEST HELENA, AR 72390 (501) 572-3701

April 6, 1990

Mike Bates
Arkansas Department of Pollution Control & Ecology
8001 National Drive
P.O. Box 9583
Little Rock, AR 72209

Re: Excavation

Dear Mike:

To follow up on our phone conversation, we have uncovered what we believe to be a small drum burial area. We were digging a trench as part of a construction project on our stormwater drainage system. At approximately 6 feet below grade a drum was uncovered. Continued digging of the area uncovered approximately eight drums in a six foot long, four foot wide trench down to a depth of twelve feet below grade. An area map is attached.

Approximately 250 cubic feed of contaminated soil has been removed. We have ordered a hazardous waste bin from Rollins ChemPak, Inc. for containment of the excavated material. It is currently covered with plastic sheets and does not pose a threat from rainwater run off. The excavated area was filled with fresh dirt and construction continued. There is no analytical data as of now. The material appears to be emulsifier and dinitro compounds.

We will have the firm of Woodward-Clyde involved in additional investigation. We would like to have your assistance and guidance in cleaning up this area.

Sincerely,

Joe E. Porter

Environmental Engineer

co: J.H. Miles

T.J. Lodice

J.R. Tomblin

(oda) Chemical ARD 99 0660649 2-16-90

CEDAR CHEMICAL CORPORATION

24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348



REPLY TO: P. O. BOX 2749 WEST HELENA, AR 72390 (501) 572-3701

March 28, 1990

David Hartley
Arkansas Department of Pollution Control & Ecology
8001 National Drive - P.O. Box 9583
Little Rock, Ar. 72209

Re: Verbal Information Request

Dear Sir:

On March 20 I inventoried our drum area you requested and found the following:

1- Propanil (labeled AgroDavid) - 126 drums

2- Permethrin/Cypermethrin raw materials and product - 82 drums

Item 1 is currently being reworked into another formulation. Item 2 material will either be used by us or forwarded to the ICI plant in Alabama. An exact disposition is to be made this week.

The warehouse foundation is a concrete vault containing off-spec Propanil, off-spec propanil intermediates, and a number of unknowns from a previous owner. The building was constructed in 1975 without an adequate inventory of the contents.

Sincerely,

Joe E. Porter

Environmental Engineer

cc: J.H. Miles

T.J. Lodice

Permethrin - cyclopropanecarboxlic acid Cypermethrin Propanil - propionanilide, 3,4' Dichloro PHONE: (501) 562-7444

CERTIFIED MAIL

June 28, 1989

Mr. Joe Porter Environmental Engineer Cedar Chemical Corporation P.O. Box 2749 West Helena, Arkansas 72390

Dear Mr. Porter:

The Department has completed review of your submissions concerning piezometric data and proposed monitoring well locations pursuant to paragraph 10(a) of the Order. The groundwater monitoring program is hereby approved based on the following conditions:

- The proposed shallow monitoring well for the perched water at boring 6-A should be drilled to a depth of 15 feet with the bottom 5 feet being screened due to the depth to water being below 10 feet for the majority of the year.
- 2. Screen intervals in wells MW-1, MW-2 and MW-3 should be set at 35 to 25 feet below the surface so that the silty clay material above the sand may be screened.
- 3. Monitoring wells should be installed in the area around piezometers B-3 and B-3A as groundwater flows in this direction for a significant time during a calendar year. The apparent perched water in the area of B-3 needs to be investigated.
- 4. Odors were noted during the drilling of several borings. To assist in contaminant identification, an organic vapor detector should be used while drilling to at least a depth of 25 feet below the surface.

p. 11 of 110

Page 2 Cedar Chemical

ARD 990660699

2-16-90

Receipt of this letter shall serve to initiate implementation of the groundwater monitoring plan in accordance with paragraph 10(c) of the Order.

If you have any questions in the above matter, please feel free to contact me.

Sincerely,

Karen Deere Manager, Enforcement Branch Hazardous Waste Division

KD/alb:LTR76

cc: Mark Simpson

DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

PHONE: (501)562-7444

December 12, 1988

Mr. Joe Porter Environmental Engineer Cedar Chemical Corp. P. O. Box 2749 West Helena, AR 72390

RE: Cedar Chemical Corp. Final Closure Tank and Container Storage

Dear Mr. Porter:

The Department has received correspondence dated November 21, 1988, containing the independent certification required for clean closure in respect to the container storage area and storage tanks, T-B112.

The Department hereby approves the final certification for the container storage area and storage tank T-B112. With this approval, all hazardous waste management units are closed at this facility, resulting in a final closure. The requirements of CAO paragraph 7 are also satisfied.

Cedar Chemical Corp. will be required to comply with 40 CFR 262.34 as per accumulation times of hazardous waste with the container storage area.

Sincerely,

No. Acti Makes

Randall Mathis Acting Director

DW/ckh:LTR309

cc: Mike Bates, Chief, Hazardous Waste Division Gary Martin, Manager, Technical Branch, HWD Karen Deere, Manager, Enforcement Branch, HWD Derick Warrick, Engineer, Technical Branch, HWD 8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

PHONE: (501)562-7444

December 2, 1988

Mr. Joe Porter Environmental Engineer Cedar Chemical Corporation P.O. Box 2749 West Helena, Arkansas 72390

Dear Joe:

RE: Consent Administrative Order LIS 86-027

Department staff have completed review of the hydrogeologic assessment report which was submitted on August 4, 1988, and the groundwater monitoring program which was submitted on September 28, 1988.

Comments on the hydrogeologic assessment report are as follows:

- The structure map on Plate 18 is constructed by using only two data points. This may not be an adequate amount of well control to complete this map. A data point near the middle of the site or additional data from USGS that reinforces this structural map should be provided to the Department.
- The map presented for recommending the monitoring well locations needs to show the approximate location of the three (3) closed and capped lagoons. This must be completed before the proper placement of wells can be determined. The area which Borings 6 and 6A were drilled is an appropriate location for the use of a two-well monitoring cluster locating the screens so as to monitor the perched zone and the uppermost sand interval. Screen depths should also be proposed for each monitoring well location.

Comments on the groundwater monitoring program are as follows:

- The Department concurs with the gathering of water elevation measurements from the present to the end of March 1989 as providing enough data for evaluation of seasonal fluctuations in order to properly locate monitoring wells. It is recommended that the piezometers be measured for water levels at least twice a month with potentiometric surface maps being constructed for each measuring event. Also, the perched water observed in piezometer 6A should be monitored.

Page 2

Celar Chemical

ARD 990666649

- Monitoring well locations should be reevaluated and proposed after all water elevation data has been interpreted.
- The recommended well depths of ten feet below minimum seasonal groundwater elevation are acceptable. The location of MW-4 would be an optimum location for a monitoring station screened at a shallow and medium depth if the potentiometric surface remains basically the same as the map in the submittal monitoring well plan. The location for upgradient well M-1 appears to be appropriate.
- The use of stainless steel for construction of well casings and screens is appropriate for all wells. The ground level and top of casing must be surveyed after installation of each well.

If you have any questions about any of the above comments, please feel free to call Mark Simpson or myself. Otherwise, Cedar should proceed with implementation of the groundwater monitoring program.

Sincerely,

Karen Deere Enforcement Branch Manager Hazardous Waste Division

KD: fw:1498

cc: Mark Simpson, ADPC&E

ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TO : Sammy Bates, Inspector, Hazardous Waste Div.

FROM : Jay Justice, Hazardous Waste Chemist, T.S.

DATE : 27-OCT-1988

SUBJECT : Results from analyses on soil samples taken at Cedar

Chemical on August 22, 1988

Six of the seven soil samples taken at Cedar Chemical Company on August 22, 1988, were extracted with an organic solvent and presented to the GC/MS to determine if any semi-volatile organic compounds were present in them. Two of the samples demonstrated that they had some semi-volatile organic compounds present in them. The organic compounds present and their estimated concentrations in the soil are listed below. All concentrations are expressed in mg/kg and reflect the amounts that are expected to be present in the samples if they are completely devoid of moisture. The soil sample that was not analyzed was labeled, "Corner of Hwy 242 and Industrial Park Road".

Southeast corner of storage pad

2,5-Cyclohexadiene-1,4 dione, 2,6-Bis(1,1-Dimethylethyl)	2
Bis (Dimethylethyl) Benzenediol	2
2-Dibenzofuranamine	7
4-Dibenzofuranamine	5

North side of tank TB112

Dichloronitro Benzene	1
Bis(Dimethyl ethyl) Benzenediol 1,1'-(2,2-Dichloroethylidene) Bis (4-methoxy) Benzene Diphenyl Sulfone	5 95 3000

p. 16 of 110 Colar Chemical ARD 990660649 3/16/10



STATE OF ARKANSAS

DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

PHONE: (501) 562-7444

June 13, 1988

Mr. Joe Porter Environmental Engineer Cedar Chemical Corporation P.O. Box 2749 West Helena, AR 72390

Dear Joe:

The Department has completed evaluation of the results of analysis on the sludges, sediments and liquids in the surface impoundments which were submitted by you an April 27, 1988.

As the results of the analysis indicate that no hazardous constituents were detected at significant levels, the requirements of paragraph 9 of the CAO are hereby deemed satisfied. Should be paragraph 8-surface impoundment investigation of 2-16-90. If you have any questions in this matter, please feel free to call.

Sincerely


Karen Deere Enforcement Branch Manager

Hazardous Waste Division

KD: fw:1252

cc: Legal, ADPC&E

p. 17 of 110 Cedar Chemical ARD990660649 2-16-90





DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

PHONE: (501) 562-7444

March 14, 1988

Mr. Joe Porter Environmental Engineer Cedar Chemical Corporation P. O. Box 2749 West Helena, Arkansas 72390

RE: Consent Administrative Order

Dear Joe:

We have reviewed your modified hydro-geologic investigation plan dated January 25, 1988 in conjunction with your letter dated January 4, 1988. The Department is hereby approving the investigation pursuant to the following conditions:

- Submission of an implementation schedule for the investigation within fifteen (15) days of receipt of this letter.
- An explanation of plant north versus true north should be shown on all site drawings submitted.
- All the work outlined in the January 4 letter is completed and documented in the final report.
- 4. Regional information is provided to document the conclusion that the bottom of the upper most aquifer is not deeper than 100 feet below the surface.

If you have any questions in this matter please feel free to call.

Sincerely,

Karen Deere Manager, Enforcement Branch Hazardous Waste Division

KD/ckh:LTR3

cc: Legal file /Jim Rigg

p. 18 of 110 Karn JAN 08 1988 Cedar Chemical ARD 990660649 2-16-90

CEDAR CHEMICAL CORPORATION

24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348

REPLY TO: P. O. BOX 2749 WEST HELENA, AR 72390 (501) 572-3701

Jan 4, 1988 =

Karen Deere Arkansas Department of Pollution Control & Ecology 8001 National Drive - P.O. Box 9583 Little Rock, Arkansas 72209

Re: Hydrogeologic Assessment Plan

Dear Karen,

We have reviewed your comments of December 2, 1987 and also discussed technical aspects with Charles Johnson. The following items have been addressed. We have asked our consulting firm, Geologic Associates, Inc., to rewrite their proposal to classify certain items.

Per your letter:

- we have asked Geologic Associates to review published material concerning the regional geology and hydrogeology of the area.
- the hydrogeologic assessment report will include:
 - (a) narrative description of geology
 - (b) geologic cross sections
 - (c) geologic maps (d) boring logs
 - (e) raw data and interpretation
 - (f) narrative description of groundwater with flow patterns
 - (g) potentiometric maps with flow lines
 - (h) raw data and analysis of slug or pump tests (we prefer pump test)
 - well construction logs
- we will locate one addition well cluster in the area bounded by Hwy 242, the industrial park road, and the active plant area.
- borings will be advanced to delineate a bottom confining layer.
- At least one boring will be placed in an area of the DNBP contamination. Precautions will be taken to prevent cross-contamination between the well and surface soil.
- The soil sampling system is defined on page 2 as a CME continuous sampling system utilizing a nominal 2.5 inch inside diameter, split barrel sampler. More details will be provided.

p. 19 of 110 Codar Cheuncal ARD990660649 2-16-90

- As shown on site drawings, plant north is approximately 15 degrees east of true north. Plant north is an arbitrary designation being convenient because it is perpendicular to the Union-Pacific Railroad tracks. Both designations will be shown on all drawings and noted in narratives.

We agree with the comments about additional borings and/or piezometers. The project is to determine groundwater flow and direction. We will take the steps necessary to demonstrate this. We also agree with your comments concerning PVC versus stainless. We believe PVC will be quite acceptable as piezometers and some initial well sampling. However, for the long term we do intend to use stainless steel for monitoring well construction.

We anticipate this answers any questions concerning the hydrogeologic assessment plan. We are asking Geologic Associates to formalize their plan and should have it in the next two weeks.

Sincerely,

Joe E. Porter

Environmental Engineer

cc: J.H. Miles G.L. Pratt A.T. Malone

Charles Johnson, ADPC & E

STATE OF ARKANSAS

p. 20 of 110 cedas Chemical ARD 990660649 2-16.90



DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

PHONE: (501) 562-7444

Certified P-490 584 033

October 22, 1987

Mr. Joe Porter Environmental Engineer Cedar Chemical Corporation P.O. Box 2749 West Helena, AR 72390

RE: Consent Administrative Order

Dear Joe:

The Department has received and reviewed your submission of September 21, 1987 concerning amendments to the original inspection plan. The resubmission is hereby approved with the following condition:

The Reporting of Accidents, Repairs, and Remedial Action log should be attached to the inspection log originating the response.

Paragraph 4 of the Order has been conditionally satisfied.

The submission dated September 15, 1987 pursuant to paragraph 5 of the Order has also been reviewed.

The sampling and analysis plan contains many references to the use of appropriate containers, preservatives, etc. The plan should detail the step-by-step sampling and analysis procedures, including but not limited to preservatives, chain of custody sheets, field sampling logs, containers used, analytical methods, detection limits, QA-QC for both sampling and analysis. In lieu of revising the plan, all the necessary information may be submitted in the resulting report. However, if the report includes or fails to include actions taken which place the validity of the samples or analytical data in question, resampling may be required. Please let me know what your preference is in this matter.

Also, the plan does not include further testing if any of the samples are determined to meet hazardous waste criteria. extent of contamination would have to be defined.

The closure plan submitted on September 14, 1985 and justification for removal of two tanks from the Part A are currently under review.

p. 21 of 110 cedar chemical ARD 990660649 2-16-90

Page 2

Therefore, please respond to the deficiencies in the sampling and analysis plan for the surface impoundments within thirty (30) days of the date of receipt of this letter.

If you have any questions, please feel free to call.

Sincerely,

Karen Deere, Manager, Enforcement Branch Hazardous Waste Division

KD: fw

cc: Sammy Bates, Inspector, Haz. Waste Div.

Legal file

P. 37 of 110

RECD AUG 17 1987

Cedar Chemical ARD 490660649
3-16-90

CEDAR CHEMICAL CORPORATION

24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348

August 14, 1987

Ms. Karen Deere
Arkansas Department of Pollution
Control and Ecology
8001 National Drive
P.O. Box 9583
Little Rock, Arkansas 72209

Dear Ms. Deere:

RE: LIS 86-127

Enclosed is Cedar Chemical Corporation's check No. 01917 in the amount of \$15,000 which represents the penalty outlined in paragraph 11 of the Consent Administrative Order LIS-86-027.

Sincerely,

Whn C. Bumpers Vice President-Finance/Admin. and Secretary

JCB:nm enclosure

cc: Allen T. Malone, Esquire Mr. Geoffrey L. Pratt

Doice / David A. 23 of 110



UNITED STATES ENVIRONMENTAL PROTECTION AGENCY

Doice - Pls contact

REGION 6

1445 ROSS AVENUE, SUITE 1200 **DALLAS, TEXAS 75202-2733**

Cedar Chemical ARD 990660649 2.16.90

Canellas explan that, prior toany additional field work, they need to aplate their info. more gw into has been
developed under conditions Mr. Doice Hughes of an Order from this Arkansas Department of Pollution Control and Ecology Agencylroproducte up David H.) thanks P.O. Box 9583 Little Rock, Arkansas 72209

Cedar Chemical/Vertax (ARD990660649)

Dear Mr. Hughes:

Enclosed is a copy of the Sampling Inspection Report, dated July 29, 1986, prepared by Ecology and Environment, Inc. for the U.S. EPA.

If you need any additional information, please contact me at (214) 655-6740.

Sincerely yours,

Bart Canellas

Environmental Engineer

BA. Ranellus

cc: Glenda Gross (6H-SA)

ECOLOGY AND ENVIRONMENT, INC.,

REGION VI

MEMORANDUM

TO: Keith Bradley, Region VI RPO

FROM: Miles Bolton, Ground Water Hydrologist MWB

THRU: K. H. Malone, Jr., Region VI RPM Khr

DATE: July 29, 1986

SUBJ: Sampling Mission Results from the Vertac-West Helena Site,

West Helena, AR (AR 361)

TDD# R06-8507-13

INTRODUCTION


FIT was tasked by the USEPA to conduct a sampling mission at the Vertac-West Helena site, West Helena, Arkansas, Figure 1. It was specifically requested that both surface and subsurface soil samples be collected at three inactive surface impoundments located along Vertac's northwestern boundary. It was agreed that three sample stations would be established for each impoundment area.

SITE DESCRIPTION AND HISTORY

On October 19, 1985, FIT members Miles Bolton, Weldon Day and Jeff Dubose met with site representative Joe Porter to discuss the following day's sampling mission and obtain additional site information. A summary of the site history follows:

A man named Kencade started operations at this site around 1970 manufactoring methoxychlor. At that time, ponds were present where the inactive surface impoundments are now located. In 1972 the chemical plant was sold to Jerry Williams who sold the plant to ANSEL later in 1972. In 1973 the plant was again purchased by Jerry Williams. By 1973 the plant was known as Eagle River Chemical. The name was later changed to Vertac, Inc. The predominant chemicals manufactured in the past were dinitro herbicide and propanil. The major chemicals currently being manufactured are methymil, permethrin, sypermethrin, and a hydrocarbon polymer that is composed of kerosine and I sonax 132. Mr. Porter claims that the yellow blocks scattered throughout the inactive portion of the site are where ANSEL buried dinitro drums.

The surface impoundments were created from the ponds around 1972-73. Limestone was added to the narrow impoundment for the acid neutralization of



p. 25 of 110 cedar chemical ARD 990660649 2-16-90

P. 26 of 110 Cedar Chemical ARD 990680649

dichloromaline and proprionic acid. The other two ponds were used as waste disposal. Wash water from Helena Chemical's (AR 1589) chemical formulation operations was also placed into the ponds. Helena Chemical stopped disposing of their wastes in the ponds around 1976-77.

The ponds were closed in 1978. The closure procedure consisted of pumping the water from the pond (the water was removed by Rollins) and the placing a clay cap consisting of native soil and bentonite over the impoundments. An aerial photograph owned by Vertac indicates the narrow pond was approximately 2-4 feet deep and the other two ponds were approximately 5 to 10 feet deep.

SAMPLING RESULTS

Nine surface and nine subsurface samples were collected by FIT members Miles Bolton, Weldon Day, Jeff Dubose, Thomas Lensing and Lloyd Collins on October 20, 1985. Their locations are shown in Figure 3. The subsurface samples were collected using post hole diggers. Since the maximum depth obtainable with post hold diggers is about 5 feet, the samples were collected along the sides of the ponds to ensure penetrating the fill material used to cover the ponds. In all cases, the subsurface soil samples were collected after a lithologic change in the soil profile was evident, indicating the subsurface samples consisted of non-fill material.

Organic and inorganic laboratory results, field sample documents and photographs are attached to this report. The sample stations were lettered A through I. The number 1 was added as a suffix to each letter to indicate surface samples and the number 2 was added to indicate subsurface samples. Note in the laboratory results that organic samples from Stations D1, G-2, H1 and I2 had to be analyzed as medium conentration samples by the laboratory. Table 1 summarizes the organic surface sample results and Table 2 summarizes the organic subsurface sample results. These tables do not list any compounds that were flagged as being present in laboratory blanks, tentatively identified, or below detection limits. Therefore, only those compounds positively identified as being present in the samples are listed.

The organic sample results indicate that the surface fill material for pond #1 is more contaminated than the subsurface material, especially at Station B. The opposite is true for ponds 2 and 3. Only pesticides were positively identified in the subsurface samples.

In contrast to the organic results, the inorganic sample results do not indicate the presence of significant inorganic contamination. The lack of a background sample, however, makes it difficult to draw definite conclusions.

CONCLUSIONS AND RECOMMENDATIONS

It is evident from the sample results that the subsurface material is contaminated with pesticides and other organic compounds and the surface fill material is contaminated with pesticides. Since the surface fill material is contaminated with a variety of pesticides, the possibility that the contamination extends beyond the site boundaries should be considered.

Considering the area's dependence upon ground water, the FIT recommends that monitoring wells be installed around the ponds to determine if the ground water has been affected by the organic compounds. The proposed well locations are shown in Figure 4. These locations would provide water quality and local hydraulic gradient information. Currently, FIT lacks local hydrogeologic information for the area around the site. Therefore, the specific design of the wells will be dependent upon the acquisition of additional hydrogeologic information.

If the EPA desires to determine whether or not the surface soil contamination extends beyond the fill material as a result of wind blown action or possible indiscriminate dumping, then the FIT recommends that surface soil samples be collected outside of the pond area. The proposed locations are shown in the attached aerial photograph, Figure 5. Each sample would be a composite consisting of soil collected at the station and four other locations no more than 10 feet from the station. Based upon these results, a comprehensive sampling plan could be developed to accurately determine the extent of surface pesticide contamination.

p. 28 of 110 (eda/ Chemical ARD 990660649 2-16-90

Table 1. Organic surface soil results from the Vertac-West Helena site (AR 361). Only results that were not flagged are shown.

Concentrations are in parts per billion.

Station	A1	B1	C1	D1	E1	F1	G1	H1	I1
4,4'-DDT		1,813	26		30	34	25		
Methoxychlor	3,984	12,996	241			184	817	221	444
Aldrin		596.1						37	
Dieldrin		1,120							
Chlordane		3,563							
4,4'-DDE		421							

p. 29 of 110 Cedar Chemical ARD 99066 0649 2-16-90

Table 2. Organic surface soil results from the Vertac-West Helena site (AR 361). Only results that were not flagged are shown. Concentrations are in parts per billion.

Station	A2	B2	C2	D2	E2	F2	G2	Н2	12
4,4'-DDT			22				99		1 18
Methoxychlor	216			85,121		5,659	17,266		654,178
Aldrin						1,073.6			5.7
Chlordane						14,360			
1,2 Dichloroethane					190	Section 1		2800	
Phenol		27	19	1,800	840		3,100		
Bis(2-ethyl hexyl) phthalate		670	2900	52			17.14	100	
1,2-dichlorobenzene							331.7		30,000
Gamma-BHC				72.2	98.3		4.11		4,980
Toluene							4,000	34,000	16,000
Ethylbenzene									28,000
Chlorobenzene									2,600
Total xylenes							1,700	3,300	180,000
2-hexanone								75,000	75,000



After reviewing the data obtained from samples taken at the Vertac-West Helena facility the results are as follows:

In the inorganic analysis the spike recoveries for antimony (55%), lead (65%), selenium (0%), silver (60%), tin (17%), manganese (34%) and arsenic (70%) were below QC limits. Any values reported for these metals may be biased to the low side, and actual values may be higher than reported values.

The duplicate analysis for calcium should be used cautiously. All other analysis for inorganics were satisfactory.

For the organic analyss the surrogate recoveries for samples FC284, FC285, FC286 and FC287 were outside of QC limits. These four samples were reextracted and reanalyzed, however the reanalysis was worse than the original analysis so the results from the original analysis was reported. Since the surrogates were out of QC limits both times, this may represent a real matrix interference in the samples and not a lab problem.

For sample FC291 the % RPD for the volatiles were all outside QC limits. Since this was a field rinsate blank the effect was probably minimal.

For sample FC280 the % surrogate recoveries for all fractions were slightly above QC limits. Values reported for this sample may be higher than actual values.

All compounds found in the lab blank were flagged with a B.

The tuning and calibration analysis for these samples were satisfactory.

The analysis of these samples show that each location had a variety of pesticides at varying concentrations.

CASE NUMBER: 4781

SITE NAME/CODE: Vertac W. Helena AR 36

SITE NAME/CO	· vert	ac. w. He.	rena AR	DI		CONCENTR	RATIONS (ppm)					
						EPA Sam	ple Numb	ers				AMBIENT	BACKGROUND 1.
PARAMETER	MFB341	MFB350	MFB342	MFB351	MBF343	MFB354	MFB344	MFB355	MFB345	MFB356	MFB346	Western U.S. 2.	Eastern U.S. 2.
latrix type	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	ŜŌĪĒ	5011.	SOIL	Soil	Soft
Tuminum	3570	3690	3710	2760	3320	3240	2870	2750	5330	6920	3000	58,000	33,000
Intimony								28R			7 - 2 - 2	.47	.52
rsenic	11R	6.3R	16R	4R	6.9R	7.8R	20R	212R	7.2R	9,98	4,6R	5.5	4.8
arium	111	84	144	110	90	87	109	68	118	122	88	580	290
Bery um												0.68	0.55
ar um												I	I
ai - rum	13,100*	6650*	4700*	21,500*	15.200*	23.900*	16.100*	217 000*	8610*	1470*	11.900*	18,000	3,200
hromium			5.2					5.4				41	33 ·
obalt												7.1	5.9
opper	12	8	6.1	7.5	8.2	7.6	7	4.3	6.9	9.9	6.2	21	13
ron	10,500	10,400	8160	9530	9880	10,400	9250	5330	11 400	12,200	8670	21,000	14,000
.ead	7.8R	7.3R	9.4R	5.9R	7.4R	6.8R	6.3R	3.3R	7.7R	B. 5R	7.2R	17	14
lagnesium	6850	3950	2390	11,700	8550	12,500	8850	12.300	5190	360	6760	7,800	2,300
langanese	627R	444R	640R	500R	636R	579R	661R	459R	582R	515R	519R	380	260
ercury	0.081	0.038	0.095	0.067	0.079	0.050	0.057	0.019	0.048	0.083	0,067	0.046	0.081
lickel												15	11
otassium	483		490	2.91		Os LULI A I			328	788	379		
elenium												.23	.30
ilver													The State of the S
odium	542	485	469	712	388	502	566	734	550	822	465	10,000	2,600
hali	•											9.1	7.7
in												.90	.96
arı ium												70	43
inc	40	32	27	32	38	37	34	31	36	34	33	55	40
yanide		A 4	0.54R		0.52R				D.53R	1.4R	0.60R		
tation No.	Δ1	Λ2	B1	B2	C1	C2	D1	D2	E1	E2	F1	1. Value	s obtained from
ample		INACTIVE	INACTIVE	INACTIVE	INACTIVE	INACTIVE	INACTIVE	INACTIVE	INACTIVE	INACTIVE	INACTIVE		Concentrations
tation	IMPOUND-	IMPOUND-	IMPOUND-		IMPOUND-	IMPOUND-		IMPOUND-	IMPOUND-	IMPOUND-	IMPOUND-		Other Surface
ocation	MENT,	MENT,	MENT	MENT,	MENT,	MENT, NORTH	MENT	SOUTH	MENT	MENT,	MENT,		of the Conter-
	NORTH POND	NORTH POND (SUB-	POND	NORTH POND (SUB-	NORTH	NORTH POND (SVB-	SOUTH	POND (SUB-	SOUTH	SOUTH POND (SUB-	POND	dated 198	ited States", 4. U.S.G.S.

SURFACE)

96 W longitudinal line

which bisects Region VI.

10/31/85

SURFACE

SURFACE) SURFACE) SURFACE -indicates a value estimated or not reported due to the presence of interference.

⁻spike sample recovery is not within control limits. -duplicate analysis is not within control limits.

minous United States", dated 1984. U.S.G.S. Professional Paper 1270. 2. Reference for East/ West Division is the

. 32 of Codas Chamical ARD 990660649 2-16-90

CASE NUMBER: '4781

SITE NAME/CODE: Vertac, W. Helena AR 361

CONCENTRATIONS (ppm) AMBIENT BACKGROUND 1. EPA Sample Numbers PARAMETER MFB357 MFB347 MFB358 MFB348 MFB359 MFB349 MFB360 Western Eastern U.S. 2. U.S. 2. Matrix type Soil Soil SOIL SOIL SOTI SOIL SOTI SOIL SOTI. 58,000 33,000 Aluminum 2830 2910 4240 4020 3780 4180 3640 Antimony .47 .52 5.5 4.8 Arsenic 6 6R 6 OR 58R 4.9R 7.6R 5.9R 32R 290 Bariu 580 117 116 70 103 110 79 117 0.68 0.55 Bery um ar um 18,000 3,200 alcium 13 500* 11 100* 2310* 25 100* 50 500* 22 300* 96 200* hromium 41 33 7.3 6.2 7.9 5 1 128 8.5 cobalt 7.1 5.9 21 opper 13 11 8.5 11 9 9 9.4 12 21,000 14,000 ron 9970 10 800 9350 10.500 8430 11800 5680 ead 17 14 6.4R 4.8R 6.1R 8.5R 9.2R 5.1R 6.9R lagnesium 7,800 2,300 3720 5940 13.500 6700 11.700 7320 1390 380 260 langanese 702R 482R 439R 594R 342R 650R 274R 0.046 0.081 ercury 0.063 0.045 0.070 0.075 0.084 0.070 0.042 lickel 15 Π 11 10 34 otassium 736 453 823 277 975 elenium .23 .30 ilver odium 10,000 2,600 532 627 597 594 642 628 568 hal 9.1 7.7 in .90 .96 an. 70 43 ium 16 16 inc 55 40 39 37 38 38 46 17 31 yanide 0.56R tation No. I. Values obtained from F? G1 G2 H2 11 12 ample INACTIVE INACTIVE "Element Concentrations INACTIVE INACTIVE INACTIVE INACTIVE INACTIVE tation IMPOUND-IMPOUND-IMPOUND-Soils and Other Surface IMPOUND - IMPOUND-IMPOUND- IMPOUND-MENT. MENTI MENT, ocation MENT, MENT, MENT. MENT Materials of the Conter-WEST WEST WEST WEST . WEST SCUTH WEST minous United States". POND POND. POND POND POND POND POND dated 1984. U.S.G.S. (SUB-(SUB-(SUB-(SUB-SURFACE Professional Paper 1270. SURFACE) SURFACE) SURFACE -indicates a value estimated or not reported due to the presence of interference. 2. Reference for East/

-spike sample recovery is not within control limits. -duplicate analysis is not within control limits.

West Division is the 96 W longitudinal line which bisects Region VI.

10/31/85

Cedar Chemical Corp. ARD990660649 February 16, 1990

INTRODUCTORY NARRATIVE

Cedar Chemical is located just south of Helena-West Helena in the Helena-West Helena industrial park approximately 1 1/4 miles from the intersection of U.S. Hwy. 49 and AR Hwy. 242 on Hwy. 242. The plant was owned by several companies before Cedar Chemical Corporation and has historically manufactured insecticides, herbicides, polymers, and organic intermediates. The plant employs 80 to 90 people and operates 24 hours per day, 7 days per week. The plant currently manufactures, Propanil, Permethrin, Cypermethrin, DuPont CNT and Phillips MES, although the plant was designed to be versatile and is capable of manufacturing a variety of batch chemical processes. In addition to manufacturing, Cedar Chemical operates a biological treatment system for waste waters from some of the manufacturing processes. Some waste waters must be sent off-site for disposal due to the high toxicity, these wastes are accumulated in storage tanks and shipped off-site within 90 days. Cedar Chemical is currently a generator only and maintains 90 day storage in containers and tanks.

There are 3 pre-RCRA surface impoundments that were closed by Helena Chemical, operators at the time, in 1978. These closed ponds were used for disposal and treatment of unknown wastes by previous owners. The plant was known to produce methoxychlor, dinitro herbicides and many other pesticides during the active life of these ponds. Ecology and Environment, Inc. was tasked by the US EPA to conduct a sampling mission on October 19, 1985, to evaluate both surface and subsurface soil samples in the closed pond area. The Ecology and Environment investigation shown that both the surface and subsurface soils of the closed impoundments were contaminated with a variety of pesticides and recommended that monitoring wells be installed around the perimeter of the ponds to detect groundwater contamination. Wells were not installed around these ponds but an approved monitoring system was installed as part of CAO LIS 86-027 dated July 16, 1987.

Several areas around the plant ground were observed to contain yellow-colored soils. This is a result of the former operators, Ansel Corporation, burying dinitro herbicides (Dinoseb) on site according to information I have reviewed. There is no information available regarding the type, quantity or location of these wastes. Approximately 250 drums of herbicide wastes are buried under the warehouse foundation. An accurate description of these wastes is presently not available. Vertac Chemical was the operators who encapsulated these drums.

On April 6, 1990, ADPC&E was notified by Cedar Chemical of 8 drums being dug up as a result of a construction project on the stormwater drainage system. An investigation has been proposed but has presently not begun.

Cedar Chemical entered a Consent Administrative Order (LIS 86-027) on July 16, 1987, as a result of the May 30, 1986, inspection by ADPC&E. Events of the CAO are as follows:

CASÉ NUMBER: 4781

SITE NAME/CODE: Vertac, W Helena AR 361

	VIII THE TAX			10 to	CONCEN	TRATIONS	(ppb)				
					EPA 3	NTRATIONS Sample Nur	nbers		.,	Drinking Wat	ter Criteria
PARAMETER	MFB352	MFB353	MFB361							Primary	Secondar
Matrix type	WATER	WATER	WATER								
Aluminum	The same of the sa	The state of the s	1						1		
Antimony		978				1 1 1 1					
Arsenic										50	
Barium										1000	
Beryllium		710.77				-					
Cadm										10	
Calcium	144*	168*	156*								
Ch ium										50	
Cobalt										THE RESERVE	
Copper		The same									1000
ron											300
ead										50	
Tagnesium							1			THE PERSON NAMED IN	
langanese											50
Hercury	0.052	0.032	0.041							2	
lickel				1	THE PERSON						
otassium											
elenium										10	
filver										50	
odium	217	222	217								
hallium											
in .											
anagrum											-
ir				100			The second	The state of the s			5000
yanıde								-			
Fatter II			<u> </u>								
tation No.	O. de .	Outers	Puller				-	-	1		-
	RINSATE BLANK	RINSATE BLANK	RINSATE BLANK								

⁻indicates a value estimated or not reported due to the presence of interference.
-spike sample recovery is not withing control limits.
-duplicate annalysis is not within control limits.

Cedar Chemical ARD 990660649 2-16-90

Site Name/Code Vertac, W. Helena AR 0361

Table II: ORGANIC ANALYSIS SUMMARY

Case Number 4781

Concentration ppb Page 1 of 1

ample Station Number and ocation	Fraction		RINSATE BLANK 8/20/85	BLANK 8/21/85						
ompound No.	/Class				700					
PA SAMPLE NUMBER		FC291	FC292	FC300						
ATRIX		FC291 WATER	WATER	WATER						
	VOA/1	5B		5B						
	VOA/1	5B		5B						
Benzene	VOA/1	5B		1						
	ABN/1	5B 20JB	20JB	220B						
Oxirane	VOA/3	9J								
dexamethylcyclotrisiloxane	VOA/3	62.JB		41.JB						
	VOA/2			950B						
	ABN/1			20J						
hoxychlor	Pest/1			0.69						
nknown 2042	ABN/3			18J						
Inknown 2056	ABN/3			27J						
	ABN/3			12J						
		O mari								
		BINER								
						-				
							The Control			
							11 - 400			
-										
~										

2. Specif ed Hazardous Substance. 3. Ientalively Identified.

VOA - Volatile ABN - Acid Base/Neutral Pest - Pesticide

J - Indicates an estimated value for tentatively identified compounds compounds found below detection limit.

P - Present in sample, but not reported by lab.

Table II: ORGANIC ANALYSIS SUMMARY

Site Name/Code Vertac, W Helena AR 0361 Case Number 4781 Concentration ppb Page1 of4 A1 **B2** C1 D1 FI F2 Sample Station Number and Location Scan Fraction Compound No. /Class EPA SAMPLE NUMBER FC293 FC283 FC294 FC296 FC280 FC289 FC281 FC290 FC282 FC295 FC285 FC284 MATRIX SOIL SOIL. 16R Methylene Chloride VOA/1 16B 9B 12B 22B 1.7B 840B 36B 21B 10B 9B 150B 6B Chloroform VOA/1 7B 7B 7 B 6B 7B 7 B 7B 840B 110B 6B VOA/1 nzene 7B 7B 840B 6B VOA71 VOA/I 7J **7**J I.1.1- trichloroethane VOA/I 190 1,2-dichloroethane Ethylbenzene VOA/I VOA/I Chlorobenzene VOA/2 Acetone 14B 13B 150B 12B 12B 12B Total xylenes VOA/2 VOA/2 2-hexanone ABN/I 2078J 459J 465J 465J 436J 405J 475J N-nitrosodiphenylamine ABN/I 800 840 Phenol ABN/I 405J 1,2-dichlorobenzene ABN/I 670 900 405J 475J Ris-(2-ethyhexyl) phthalate 1813 30 26 4.4-DDT Pest/1 421 4 4-DDE Pest/1 216 12,996 241 04.6J 106.8J 85,121 3984 99.6J 114J 184 5659 Methoxychlor Pest/1 596.1 1073.6 Aldrin Pest/1 1120 0.9J 22.8J Dieldrin Pest/1 3563 Chlordane. Pest/1 14 360 98.3 Gamma-BHC (lindane) Pest/1 31JB 340JB 30JB 74JB В4ЈВ 1500JB 280JB 92JB 90JB 36JB Hexamethycyclotrisiloxane VOA/3 20 JB 100J 91 Methoxybenzene VQA/3 131 1600J 62 Unknown VOA/3 247 100J known Alkane VOA/3 263 143 known Alkane VOA/3 441 Unknown Alkane VOA/3 1,2-dichloro-3-nitrobenzene ABN/3 590J 420J 180J 650J Unknown Alkane ABN/3 3901 960J 1518 ABN/3 450J Unk, carboxylic acid Unk. polynuclear aromatic 1937 10003 ABN/3 2222 1100J 280J 160J Unknown Alkane MBN/3 530 230J 80J Unknown Alcohol ABN/3 390J 1798 230J 30J 300J 7201 ABN/3 Unknown Amine 1842 290J 2600J 11001 Unknown ABN/3 2100J 508 Unknown ABN/3 1684 2500J 11007 ABN/3 Unkown Ketone 1677 260J 660J ABN/3 Unknown Alkane 80J 2394 8101 130J Unknown ABN/3 400J 401 240J Link. Subsituted Benzene ABN/3 13001 1025 Unknown Alkane ABN/3 4801 1218 ABN/3 Unknown Alkane 5101 1456 Unknown Amine ABN/3 10001 1580 1700J Unknown. ABN/3 11001 1364 ABN/3 340.1 Unk. Carboxylic Acid Unknown Alkane ABN/3 1700J 1941 Priority Pollutant. VOA - Volatile B - The analyte is found in the lab blank.

Specif ed Hazardous Substance.
 Tentatively Identified.

ABN - Acid Base/Neutral Pest - Pesticide J - Indicates an estimated value for tentatively identified compounds compounds found below detection limit.

P - Present in sample, but not reported by lab.

ample Station Number ocation		Fraction	A1	Α2	B1	В2	C1	C2	D1	D2	El	E2	F1	F2	
ompound	No.	/Class													
PA SAMPLE NUMBER		70.000	FC280	FCCCC	FC281	na290	FC282	FC293	FC283	FC294	F284	FC295	FC285	FC296	
ATRIX	-		SOIL	FC289 SOIL	SOII.	COTI	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL.	
nknown	1993	ABN/3	DVIII	13011	- a	-	SOIL	SOLL	1	100.00	10020	15010	430J	- SWATE	
nknown Alkane	2002	ABN/3		1					1	1		1	250J		
own	2320	VRN/3			-								700J		
wn	2345	ABN/3		-									510J		
mkhown	1526	ABN/3												1800J	
nknown	1544	ABN/3												1100J	
nknown Alcohol	1558	ABN/3						The Diff						11 00J	
nk. CArboxylic Acid	1752	ABN/3									30 144			19005	
nknown	1403	ABN/3													
nk. Substituted Benzen	e1412	ABN/3													
								1							
1-									-						100
							-		-	-	-	-			
				-			-	-	-	-	-	-	-		
La contraction of the last of							-	-	-	-	-		-		
				-			-	-	-	-	-	-			
						-	-	-	-	-	-	-			_
				-		-	-	-	-	-	-	-	-		
				-		-	-	-	-	-	-	4	-	_	_
			_				-	-	-		-	-	-	-	
	-		-		-	-	-	-	-	-	-	-	-		
				-	-		-	-	-	-	-	-	-	-	
							-	-	-	-	-	-	-	-	
				-				-	-	-	-	-	-	-	
				-			-	-	-	-	-		-		
	-	-		-		-	-	-	-		-		-		
		-	-	-			-	-	-		-	-	-		-
			-	-			-	-	1	-	_	-	-		
		-									-		-		
				-	-		-	-		-	-	-	-		
				-			-	1			-		1		
				-	-		1						1		
			-												7.01
A-															

							-		-		1				

^{2.} Specif ed Hazardous Substance.
3. Tentatively Identified.

ABN - Acid Base/Neutral Pest - Pesticide

J - Indicates an estimated value for tentatively identified compounds compounds found below detection limit.
 P - Present in sample, but not reported by lab.

Table II: ORGANIC ANALYSIS SUMMARY Case Number 4781

Site Name/Code Vertac, W. Helena AR 0361 Concentration pp b Page 3 of 4

		G1	G2	н1	Н2	11	12								-
Sample Station Number and Location	Fraction	4								36					
Compound No.			1			A THE									
EPA SAMPLE NUMBER	701055	20000	FC297	00007				-	-	-	-	-	-		
MATRIX		FC286	-	FC287	FC298	FC288	FC299	-	-	-	-	-	-		
	-	SOIL	SOIL	SOIL	SOIL	SOIL	SOIL		-	-	-	-	-		
Methylene Chloride	VOA/1	15B	2700B	2300B	3300B	17B	1710B			-	-	-	-		
Chloroform	VOA/1	7 B	845B	790B	-	7B	1710B		-	-	-	-	-		
enzene	VOA/1	7.B.	845B		-		1710B				-	-	-		
Luege	VOA/1		4000	790J	34,000		16,000								
1.1.1-trichloroethane	VOA/1					7J									
1.2-dichloroethane	VOA/1		-							-					
Ethylbenzene	VOA/1		845.I		1600J		28,000								
Chlorobenzene	VOA/1						2600								
Acetone	VOA/2	13B	5200B	4600B		42B									
Total xylenes	VOA/2		1700		3300		180,000								
2-hexanone	VOA/2				75,000		75,000								
N-nitrosodiphenylamine	ABN/1	4443	2254.1				13,680J								
Pheno1	ABN/1		3100												
1,2-dichlorobenzene	ABN/1	THE HE	2254J				30,000				- C. I. S.				
Bis(2-ethylhexyl) phthalate	ABN/1		I I I I I I I			440J	1								
4,4-DDT	Pest/1	25		100		21.3J									
4,4-DDE	Pest/1	-		-										F 8 5 F 1 F 1	
Methoxychlor	Pest/1	817	17.266	221		444	654,178								
Aldrin	Pest/1	-	1	37						-	-				
Dieldrin	Pest/1													W	
Chlordane	Pest/1						-			-	-				
Gamma- BHC (lindane)	Pest/1		-				4980	-	-	-	-	-	-	-	
Hexamethycyclotrisilaxane	V0A/3	85JB	520JB	930JB	1000JB	860 111	46JB		-	-	-	-	-		
Methoxybenzene	V0A/3	O J J D	28,000J	930JB	200,000	1	140,0003		-	-	-		-		
Unknown 62	VOA73		850J	2000J	2007	-	2000J		-	-	-	-	-		
Unknown Alkane 247	VOA/3	-	0303		-		120000		-	-		-	-		
	V0A/3		-		-	-	-		-	_		-	-		
203	V0Λ/3		-		-		-		-	-		-	-		
On nown Alkane 441 1,2-dichlaro-3-nitrobenzene	ABN/3	-	1.5 0001				1		-	-		-			
	ABN/3		15,000J		-		740,000J			-					
	ABN/3		-				-			-		-	_		
Unk. carboxylic acid 1518 Unk. polynuclear aromatic 1937	ABN/3						-			-		-			
	ABN/3		1				-					-	100		
6666	ABN/3					2121	-		-	-	-				
Unknown Alcohol 530	The state of the s					310J									
Unknown Amine 1798	ABN/3	250J				7403									
Unknown 1842	ABN/3	270J	1900J			230J									
Unknown 508	ABN/3														
Unknown Ketone 1684	VRN/3														
Unknown Alkane 1677	ABN/3		1												
Unknown 2394	ABN/3	LOTE IN													
Mrk. Substituted Benzene401	ABN/3		3300J			380J	56,000.1								
Unknown Alkane 1025	ABN/3		1900J				71,000.1								
Unknown Alkane 1218	ABN/3										and the same				
Unknown Amine 1456	ABN/3		2200J				24,000J	-							
Inknown 1580	ABN/3						123,0000								
Unk. Carboxylle Acid 1364	ABN/3									1					
Unknown Alkane 1941	ABN/3		-				1		-	-		-	-		

^{1.} Priority Pollutant.
2. Specif ed Hazardous Substance.
3. Tentatively Identified. VOA - Volatile

ABN - Acid Base/Neutral Pest - Pesticide

B - The analyte is found in the lab blank.

J - Indicates an estimated value for tentatively identified compounds compounds found below detection limit.
 P - Present in sample, but not reported by lab.

P - Present in sample, but not reported by lab.


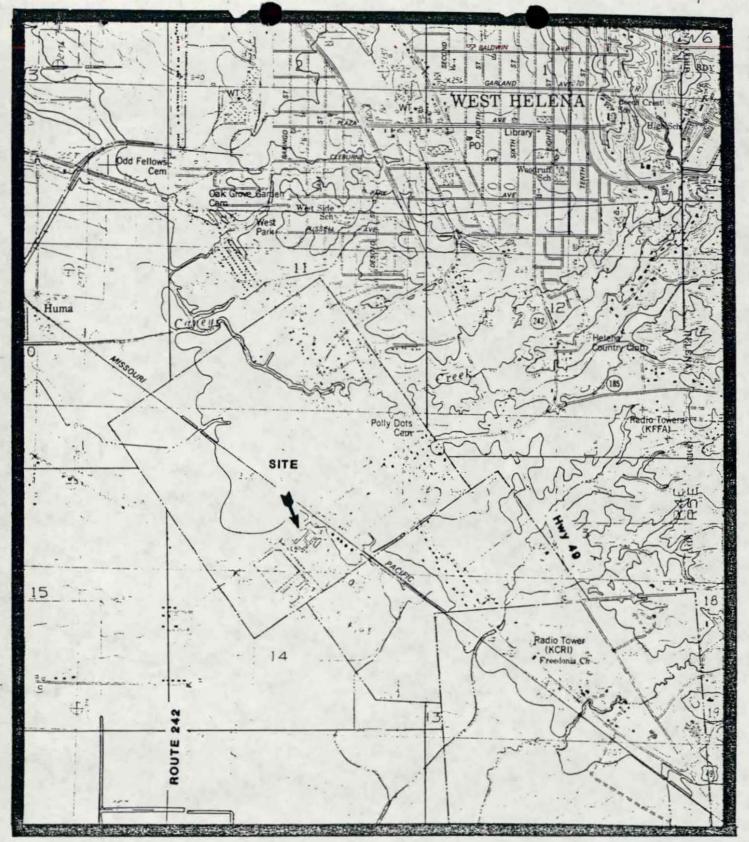


Figure 1. Site location map for the Vertac-West Helena site in West Helena, Arkansas (AR 361).

Scale: 1 inch \approx 2,000 Ft.

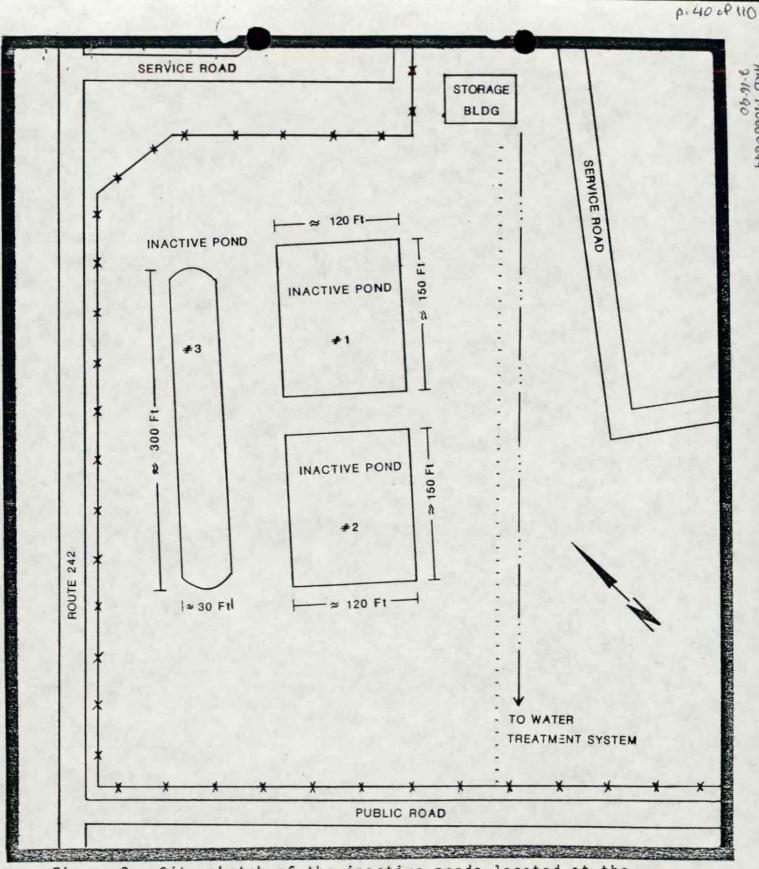

Site sketch of the inactive ponds located at the Figure 2. Vertac-West Helena site (AR 361). The pond boundaries and dimentions are estimates.

-··- Open culvert Berm - Fence

Not drawn to scale


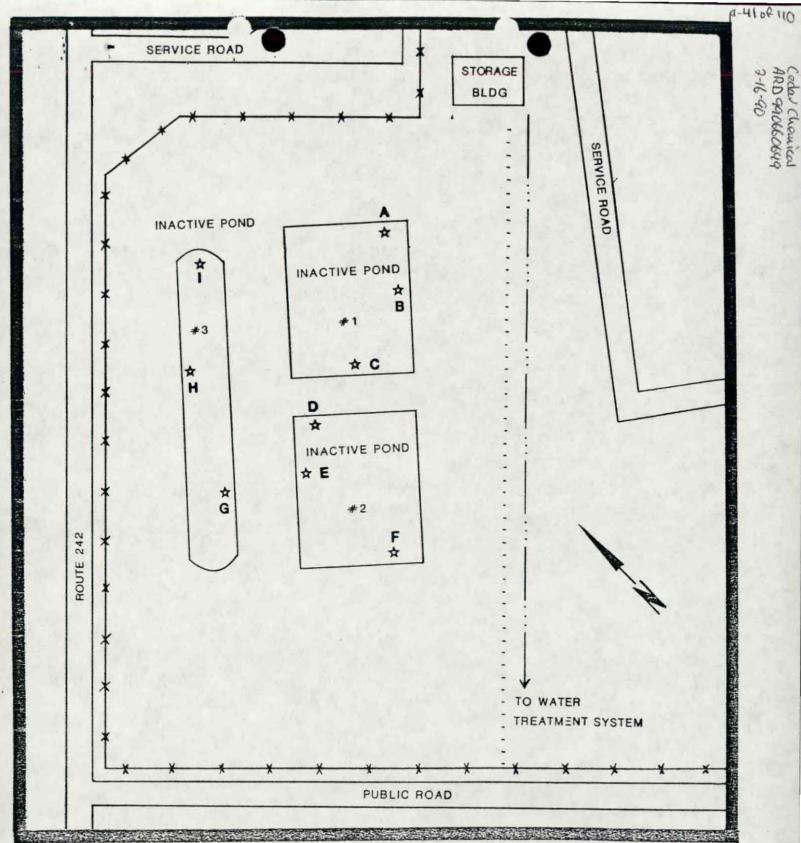


Figure 3. Sample station locations at the Vertac-West Helena site (AR 361).

Not drawn to scale

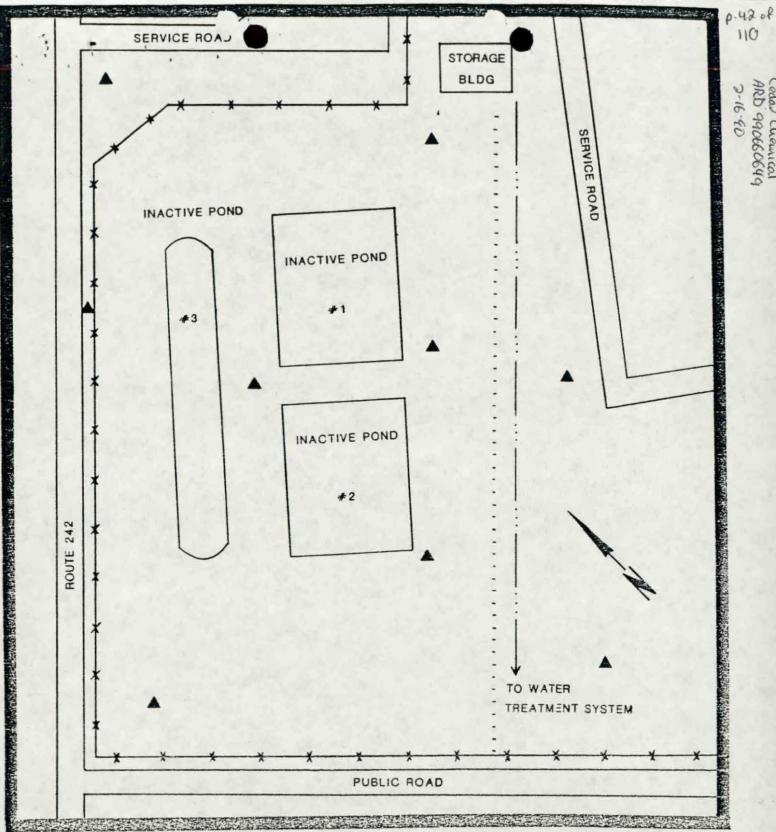

ARD 99060649

Proposed monitoring well locations for the Vertac-West Figure 4. Helena site (AR 361).

X Fence Well locations ..____ Open culvert Berm

Not drawn to scale

		p. 24.4110
		ARD 990660649
	UNITED STATES ENVIRONMENTAL PRO	
		TEDION AGENCY
DATE:	Aug 6, 1986	SION VI
	1986 113 -	
SUBJECT:	Potential Hazardous Waste Site	4: 0.51
	Wall SUFE	
FROM:	Control or property	- WESTERNIEN
	Keith Bradley, FIT RPO Hazardous Waste Section (6E-SH)	MAR 23 1990
	nazardous wasse becoron (ob-sh)	U) WHY 5 3 1990
TO:	Martha McKee, Chief	
	Compliance Section (6H-ES)	
	Site Name: Vertee - W Helena	1.4.
		are
	Location: West Helena, Arc	
	Hazsit No.: AR 36/	
	TDD No.: RG-8507-13	
	A. Deliverables:	
	1. Preliminary Assessment (Form 2070-2)	attached ()
	2. Site Inspection Report (Form 2070-3)	attached ()
	3. Sampling Inspection Report	attached 🔀
	4. Other:	attached ()
		Yes () No 🖂
	B. Were drinking water wells sampled?	100 () 110 ()
	C. Analytical Data:	
	C. MIALY SECOL SALES	
	1. None collected	()
	2. Field data	()
	3. Contract lab results	attached 🖂
	4. Houston lab results	attached ()
	D. Comments:	
	Restride entoninants mere	detected in
	1 1/ 0	+ 11
	payetes from this site. Du	10 the
	and the state of t	<u> </u>
	a purpueles ust in this are	2 FII
	The state is	A TITLE
	reimmeras to mount	- Lagrang
		-
	wells.	
	- It heliminery of W-SW us	e should be
		4
	sexued on this uto.	
-	11	4.78
•		
		200
	1 . 1 - 1 Cabon 1 6W-GD	
	cc:(circle) Cabra (6W-S) Gazda (6E-E)	
	Taylor(6H-CE)	

ENVIRONMENTAL PROTECTION AGENCY Office of Enforcement

Codar Chemical ARD 990660649 2-16-90

CHAIN OF CUSTODY RECORD

REGION 6
First International Bldg., 1201 Elm St.
Dallas, Texas 75270

PROJ.	PROJ. NO. PROJECT NAME 2361 Vertoc, West Helena									/	/	//				
A12 361		Vert	lac ,	, w	est 1	Helen	a	NO.		,	//	//	//	///		
SAMPLE	RS; (Sign	ature) L	des		Thon	9-4 11.	Livery	OF		/	/	/	//	///		
	900		1	1	12			CON-	1	//	//	/	/	//	REMARKS	
STA.NO.	DATE		COMP.	GRAB		STATIC	ON LOCATION	TAINERS	/	//	//	//	//			
AI	6/20/85	836		X	Inactiv.	e Inpu	nament North And	1					133	Tay # 6-11765		Splits
BI	8/2018	8 34-		.1			ndment North And	-1						6-11770		,
BI	8/20/55	848					dment North ford	1						6-11776		G
DI	8/2485					,	nducet Suil April	1						6-11782		1.
EI	8 20/8						adinent south fond	1						6-11788	3 44 45	٧,
FI	8/20/65	9:00					dinery South Bond	t						6-11789		te.
61	3/30/85						wheat hose and	. (6-11800		
# 1	812085						Snew west foul	1						6-11801		1.
II	1/2055	9:11-		X	Inachie.	Indu	want west field	1						6-11812		**
A2	17/24/5	12:21		X	Imatio	e Imp	candment North loss	1						6-11815		11
B2	8/20/5	15:02		X	Incerio	e Ling	conduced Northson	1						6-11816		11
C2.	Profis	13:17		1	Imelise	Impo	conduced Northson	1						6-11817	h	
5	3/24/55	13:30		X	That Tive	Impor	end went Southlow	1						6-11818		~
						1										4
•							1									
Relinguish	Ser	15 1	way.		Date /		Received by: (Signature)		Relino	quished	by: (Signatu	ure)	Date / Time	Received by: (Sig	nature)
Relinquish					Date /	Time	Received by: (Signature)		Relino	uished	by: (5	Signatu	ire)	Date / Time	Received by: (Sig	nature)
Relinquish	ed by: (Signature)			Date /	Time	Received for Laborators (Signature)	y by:		Date /	Time		Remark	s		
		Distr	ributio	n: Ori	ginal Accor	npanies S	hipment; Copy to Coordinat	or Field Files								

ENVIRONMENTAL PROTECTION AGENCY Office of Enforcement

Cedas Chemical ARD 990660649 2-16-90

REGION 6 First International Bldg., 1201 Elm St. Dallas, Texas 75270

	Office of Enforcement 2-16-90 PROJ. NO. PROJECT NAME						OF CUS	TOD	Y RE	COR	D				ional Bldg., 1201 Elm S as, Texas 75270
HR3	361	Vertu			est Helen	14	NO.			/.	3/	//	////		
SAMPLER	RS: (Signa	ture!	fee	fa	Thomas	Lorens	OF CON-		/	O No	1/3	2//		REMA	ARKS
STA. NO.	DATE	TIME	COMP.	GRAB	STA	TION LOCATION	TAINERS	/	rs /	112		//			
A1] zoids	828		X	Inactive Insu	indicent, North Pond	1	1					6-11754		MFB 34
BL	3/120105	83742		X	Inactive Imp	andmont, North Pand	1	1	#				6-11767		MF.334.
	8/20/05	5. 3.9				oundment, Kirth Ponul	1	1					6-11771		MFB343
DI	हारणंड	123				In Brit Bul	1	1					6-11777		MFB 344
=1	1/20105	828				infinent South Bad	1	1					6-11783		MFB 345
	8/20/05	400		Y		modernant South Bod	(1					6-11791		MFB 346
	1150100	LINE CONTRACTOR		77 7 7		oundment, wat Pand	(1					6-11795		MFB 347
11	diales	912		X	Inactive To	gransmit best And	1	1					6-11806		MFB3Y8
II	8170185	9/16				Runfmant, Last find	1	1					6-11807		11173 349
	1/20/5			X		rate Blank	す	33	1	/			6-12003,	6-12004	MFB 35
Hank				X	Field Ring	ate Blank	汉	21	1	1			6-12009,6	-12008	WIF8 35
	10117	15:57		X	Theclise Im	equilment, North Poro	1	1					6-12014		MFB 35
	8/20/5			X	Inactive Im	orandment, Northland	1	1					6-12020		MFB 35
ران	9/2015			X	Inoctive Ir	morand must , World lose	1	1					6-11953		MIFB 35
D2	2/20/3	12:20		X	Inactive Ting	budsond, South Pend	1	1					6-11958		MFB 355
lelingvishe	1927/	ignature)	1	81.	Date / Time	Received by: (Signature)		100000		ed by	; (Sign	ature)	Date / T 8/21/85 13	me Receive	d by: (Signature)
elinquishe	01 61	((A)	7		Date / Time	Received by: (Signature)		Relin	quish	ed by	: (Sign	ature)	Date / T	me Receive	d by: (Signature)
telinquishe	ed by: (S	ignature)			Date / Time	Received for Laborator (Signature)	y by:	10.0	Date	e /Tim	ne	Rema	rks Station HI will No. 851.	619C	Case No.

Office of Enforcement 2-16-90

CHAIN OF CUSTODY RECORD

REGION 6
First International Bldg., 1201 Elm St.
Dallas. Texas 75270

							OTIA	114 01 000	100				1		Dallas, Texas 75270
PROJ.		PROJEC			, ,	11 1					/	(ig)	SK	////	
AR3				200	Jest,	Helen	a	NO.			1	17	0/20	////	
SAMPLE	RS: (Sign	nature) 1	-lo	Kins				OF	100	1	Cal.	/\\\	3/	///	
	7-7	Tienes	011	an	mig			CON-	1	/	1/0	1/5	//	///	REMARKS
STA. NO.	DATE		COMP.	GRAB	-		ON LOCATION	TAINERS	/		1/4 m	2/2/2/	//		
EZ	08/21	0840	,	X	South	Pond	nactive Impoundmen		X					6-11822	MFB 356
F2	08/21	0325		x	South.	Ponel	etive Impourament	11	X					6-11829	'MFB 357
60	65	2350	13	×	1 1	Marin	mactive improvedment		X					6-11835	M FB 358
HZ	85	2955	ID	X	Libert	Pand !	Inactive Impoundent	IV	X					6-11842	MFB 359
HZ TZ	85	1035		X	Suhsu	Hace, 1	nactive Imporredness	1	X			P.		6-11847	M F B 360
Blank	85	1100		×			te Blanck	20	-	X	X			6-11849 6-1	
							Ja Gardina				Í	70		15 17271 16 1	, 330
17:13															
						10.00									
					PAGE.			N CONTRACTOR		100					* *
1639						19		73 EU							
					7.11										
	7 S.				N. S.										
	12.1							7							
									1						
Relinquist	ned by:	(Signature)	200	8	Date 21/85	/Time	Received by: (Signature Roll					y: Isig	nature)	Date / Time 821/85 13:00	Received by: (Signature) Federal Express
Relinquist	ned by:	(Signature)	1		Date	/Time	Received by: (Signatur	re)	Reli	nquis	hed b	y: (Sig	nature)	Date / Time	Received by: (Signature)
Relinquish	ned by:	(Signature)			Date	/ Time	Received for Laborate (Signature)	ory by:		Dat	te /Ti		Rem	marks elect Express 7	851764675
1.	1	Distr	ributio	on: Or	iginal Acco	mpanies S	hipment; Copy to Coordin	nator Field File	s				7	Case 7 478)	

				3-16-9	D.	CHAIN	OF CUS	TOD	Y R	ECOF	RD					Dalla	s, Texas 7	5270
PROJ. NO.	PROJEC	TNA	ME	W							1.1		//	/				
AZ 361	Verta	10,1	we.	et Hel	ene		NO.			/	/.	//	///	//				
SAMPLERS: ISI	inature)		11	hell.	. 1.	, ,	OF	1	,	10.51	134		//	/				
4 FF	5012		VV				CON-		/	1	x0/ x	//	///			REMAR	RKS	
STA. NO. DATE	TIME	COMP.	GRAB		STATI	ON LOCATION	TAINERS	/	(X)	() () () () () () () () () ()	10,5	//	//		*		6	
N1 5/248	828	0	X	Iriacti	e Inf	undivent, North ford	8	2	2	14	-		6-1176	346-	11761	G-11750	15-112	100
81 300h	5 57 54 E		X	Tirretive	Tur	wornt, North Band	4	1	1				6-1176	1 1 10-	11768	6-11 (33 V	6 11/30	FC 280
	1 248					undamil, North Bod	1	10	1-	2:			10-11/13	27 V 6	-1177	41		HC 282
101 1/2018	150					gulment, South Park	4	1	1	a			11			'V w'		
E1 (10)3.	923					udnest, South Book	4	1	1	7			6-1173	7.76	-11780			re 284
F1 Y 812018:	(400				1100	indiment, South and	4	1	10	20			1-11.70	10 6	11792	1-11793	6-11294	FC 283 FC 284 FC 285 FC 286 FC 287
Cit- 1/20/55	705		346			Monent, Wat Plad	4.	1º	1	2.00			6-1179	7 V6	-11798	مرا خ		FC 2860
, V	5 908				•	want Wast And	V	11	14	-2. V			6-118	030	-1150	Cr	i	FC 287
II 1 1/20/0	1111		2.34	***		. Onent, Wat Rand	¥	1×	1	3			10-113	09V	- 1181	04	7	C 2Pr
					1.00													
						·P												1
												<u> </u>						
			1		1													
	,	4.1.00	10116 4	- database														1
			1/2															
Relinquished by:	(Signature)		6	Date .	Time (2:00	Received by: (Signature)					1: (Sign		8/2		/Time /3∵∞	Received Federa		sture)
Relinquished by:	(Signature)	7		Date /	Time	Received by: (Signature)		Relin	nquisl	hed by	: (Sign	ature)		Date	Time	Received	by: (Signa	iture)
Relinquished by:	Relinquished by: (Signature) Date / Time Received for Laborator (Signature)		y by:		Dat	e /Tir	ne	Rema	Remarks Station At QN/QC Firbith 851764653 4731 Solde Let # 65204222									
	Dist	ributio	n: Or	iginal Accor	npanies S	Shipment; Copy to Coordinat	or Field File	s		*		43	791	Bei+1	· /et #	6520	W222	

4.75

Codas Chemical **ENVIRONMENTAL PROTECTION AGENCY** ARD990660649 Office of Enforcement 2-16-90

Organic

REGION 6 First International Bldg., 1201 Elm St.

CHAIN OF CUSTODY RECORD Dallas, Texas 75270 PROJ. NO. PROJECT NAME Vertac, West Helena AR361 NO. SAMPLERS: (Signature) & . Col A. Collers OF REMARKS CON-TAINERS TIME STATION LOCATION STA. NO. DATE South Pond 08/21 840 FC 295 85 6-11320 16-120231 Subspitace, Inactive Impoundment 08/21 0205 0450 6-11825 6-118270 FC296 South Pond 85 6-118261 6-118281 Subsuiface, Inactive Impourdant west Pond Subsuiface, Inactive Impourdant most fored 08/21 00 10 ID 6-118312 6-11833 45 FC 297 4-118324 6-11834 1-11837 6-11839 -1-11838 2-11840 08/21 04301) H FC 298 85 0655 65 1035 Subscriber, Inactive Impoundment 6-11844 6-11845 4 FC 299 26-11851 6-11853 6-11848 85 1100 2 Blan 12 Ringate Blank 85 FC 300 Relinquished by: (Signature) (2) Date / Time Received by: (Signature) Relinquished by: (Signature) Date / Time Received by: (Signature) Willenter 8/21/85 11:21 mileu, zallen 8/21/35 13.00 melle w. Ballen Federal Edgress Thomandaturny Relinquished by: '(Signature) Date / Time Date / Time Received by: (Signature) Relinquished by: (Signature) Received by: (Signature) Relinquished by: (Signature) Date / Time Received for Laboratory by: Date / Time Federal Express Airbill#851764686 (Signature) Case # 4781

Distribution: Original Accompanies Shipment; Copy to Coordinator Field Files

, Cedar Chemical ARD 990660649 2-16-90

CHAIN OF CUSTODY RECORD

REGION 6

First International Bldg., 1201 Elm St. Dallas, Texas 75270

).								CHAIN	OF CUS	TOD	YH	COF	1D	257				Dallas, Te	xas 75270
PROJ.		Ver			West	Hei	lena		NO.			/	//	//	//	//	/		
SAMPLE	RS: (Sign	ature)	4	10	POVS	D	and Ler	(max)	OF		1	1		//	//			REMARKS	
STA. NO.	DATE	TIME	COMP.	GRAB			ON LOCATION)	CON- TAINERS	1	29		10/	//	//				
A2"	5/20/55	12:27		V	Tuartive	These	sand went , A	but Pont	4,4	10	11	:2"	-	1	6-12	017	16-15	016-	FC 289
B2	8/20/55	12:30		Ŷ	Timetive	Theyan	undment it	Al Poid	4	1"	j	2			6-120	019-	6-120	015 4	FC 290
2. 4	8/20/55	13:17		X	Inaction	e Imple	andment joll	lorth food	U	10	"1"	5			6-119	159	-1193	10	FC 293
DZ	8/20/55	13:30		X	Thacking	¿ Tho	oundard.	South Br	14.	1-	1"	2"	1		6-11	1600 V	-119	59:-	FC 294
Han t y	Props	9:45	=	Y	Field .	Pir say	e Blank		60	2%	2	120	-		6-1200	0546	1200	6-6-12501	FC 291
Blanks	8/29/5	13:00	100	V	Field	Pinsa	te Blank		6	27	77	25	7		6-10	2010	6-12	504-6-12	FC 291
			,		-,7			*			188	145							The state of
-					4 11												9, 6	1	
												77							
				To the		× 7.1													
																		**	
9							7.07	1 15.		19							4 -		
*	3,71																		
Relinquish	ned by is	Remarke)	un	7 8	Date /		Inches 15				Mary Control of the Control	Pack	i: (Signa	iture)	el.		/Time	Received by:	THE RESERVE TO SERVE THE PARTY OF THE PARTY
Relinquish					Date /	Time	Received by:	(Signature)	,	Relin	quist	ned by	i: (Signa	ture)		Date	/Time	Received by:	(Signature)
Relinquish	ned by: (S	Signature)			Date /	Time	Received for (Signature)	Laborator	y by:		Date	e /Tir	ne *	Remar Air b	11#	PS 1 H s 65	764	212	lase # 4781



UNITED STATE ENVIRONMENTAL PROTECT N AGENCY REGION VI

1201 ELM STREET DALLAS, TEXAS 75270

p.50 of 110 Cedar Chemica) ARD 990660649 2-16-90

RECEIPT FOR SAMPLES

NAME AN	D TITLE	OF EPA REPRES	ENTATIV	E: Mile.	s Bolton	
				FITG	round water H	xdvologist
				mel	gh Balt	~
					(Signature)	
SAMPLES	COLLEC	TED:				
SAMPLE		PLACE			SPLIT S	AMPLE
NUMBER	TIME	COLLECTED	TYPE Subsyrtace	VOLUME	REQUESTED	PROVIDED
6-11815	12:41	- Hosth Poul	\$3.1	3203	Yes	400
6-11816	1245	subscript Compandent North And	substitute soil	3203	yes	yes
6-11817	1317	North Pond	subsurfic +	3203	yes	yes
6-11818	1330	Soul And	substitute Soll	3203	yes	45
					No.	THE SHAPE
	4				-	
		-				
-						
	ACK	NOWLEDGEMENT O	F FACIL	ITY REPRES	ENTATIVE	
The und	ACCOUNT OF STREET	d acknowledges	that t	he samples	described abo	ve have
NAME, T	ITLE AN	D ADDRESS OF F	ACILITY	REPRESENT	ATIVE:	
JOS	ET	Deter - ENVIR	of mental	Engineer	501-57	2-3701
Vertac	Chem	ical CORP- We.		in Point	12390	
Jose	- 8	Tockor	10.00	1	ust 20, 85	
	Signatu		MATERIAL TO		(Date)	

DISTRIBUTION:

One copy facility representative One copy for inspector's records Original to Regional Office



1201 ELM STREET DALLAS, TEXAS 73270

P. 51 08 110 UNITED STATE ENVIRONMENTAL PROTECT N AGENCY Cedar Chemical ARD 990660649 2-16-90

		RECEIP	T FOR SA	MPLES		
NAME A	ND TITLE	OF EPA REPR	ESENTATI	VE: Milos	Borton	
				FIT O	rand water w	linla it
				mi	bu. Bollen	il
				1100	(Signature)	
SAMPLE	S COLLEC	TED:				
SAMPLE NUMBER		PLACE COLLECTED SchSorface	TYPE	VOLUME 1602	SPLIT S REQUESTED	AMPLE PROVIDED
E2	0840	South Ford	Inorganic Wolf Organic	340m1	yes _	708
F2	9850	"	10A			1.6
62	0930	west form	Inoth Von			
# 2	0955	1,	10	_11		10
I2	1035	11	11	n		,,
						-
					T	
			-			
	ACK	NOWLEDGEMENT	OF FACI	LITY REPRES	SENTATIVE .	
	dersigne ollected		es that	the samples	described abo	ve have
NAME,	TITLE AN	D ADDRESS OF	FACILIT	Y REPRESENT	TATIVE:	
JOG	E. T.	enten -E	vilen men	In Exil	veer	
V	Bor Roy	716	p - West Jest Hel	HeleNA P	12390	
T	- 6	Toothe .		A.	sust 21, 1985	
	(Signatu	re)			(Date)	
DISTRI	BUTION:	One copy	facilit	y represent	ative	

One copy for inspector's records Original to Regional Office



UNITED STATE ENVIRONMENTAL PROTECT REGION VI

1201 ELM STREET

p. 52 of 110 cedar Chemical ARD 990660649 2-16-90

DALLAS, TEXAS 75270

N AGENCY

				FIT 6	rand water that	Protocist
				mi	Ver 1 a la	21
				- jne	(Signature)	eau
AMPLES	COLLEC	TED:				
AMPLE		PLACE			SPLIT S	AMPLE
UMBER	TIME	COLLECTED	+ TYPE ontarte	VOLUME	REQUESTED	PROVIDE
11823	0840	In active Ingernation South pend	Soil	3202	yes	yes
11824	0825	11		1,	11	1,
11830	0930	tractice Impoundant	`'.	"	<i>P</i>	
11836	0455	"		T _t	1	17
11843	1020	('	1.	- "	1,	1,
		THE RESERVE	9			
	ACK	NOWLEDGEMENT	OF FACI	LITY REPRES	ENTATIVE	
een col			s that	the samples	described abo	Ve have
AVE TI	TTE AN	D ADDRESS OF	FACTITE	y DEDDECENT	ATIVE.	
AME, 11	-C	D ADDRESS OF	,	0 -	ALLVE.	
Jos 6	Ta	Rtal - ENSIN		t willer	7.gat	
Vers	PO BU		est Hel	ENA, AR	72390	
	8	2		1	sust 21, F85	
Tax	8	NEB		Mu	1137 6 /100	

DISTRIBUTION:

One copy facility representative One copy for inspector's records Original to Regional Office



UNITED STATE ENVIRONMENTAL PROTECT

1201 ELM STREET DALLAS, TEXAS 75270 P. 53 of 110 Codar Chemical ARD 990660649 216-90

8/20/85 (Date)

N AGENCY

RECEIPT FOR SAMPLES

NAME AND TITLE OF EPA REPRESENTATIVE: Miles Boiton

FII-Grand Water Hydrologist

Mills W. Bolton

(Signature)

SAMPLES COLLECTED:

10.	PLACE			SPLIT S	AMPLE
TIME	COLLECTED	TYPE	VOLUME	REQUESTED	PROVIDED
828-		* Gular			
936	. North Bond	Sil	3202	- Xes	Tes
839-		Sirface			
		Soil		Yec	_xes
	Inothic Impundment	Silve			
	North Rond	soil		Ves	yes
		Surface			
		50.1		yes	Yes
			1.		
		521		yes	_ xes
,					
902				yes	tes
				100	
	West find			XEZ	yes
			.,	ves	Jac
	West He new Downs	20.7		1	_ yes
916	wast And	Surface soil .	11	yes	yes
	828- 336 838- 842 8:48 8:50- 853 952- 858 902- 9:05- 9:07- 9:08- 9:12- 9:14-	818 - Inective Imperatment 836 - North Pond 839 - Inective Imperatment 842 - North Pond 8:45 - Inactive Imperatment 8:48 - North Pond 8:50 - Inactive Imperatment 853 - South Road 952 - Inactive Imperatment 954 - Inactive Imperatment 902 - South Pond 9:05 - Inactive Imperatment 9:07 - North Pond	TIME COLLECTED TYPE 828 - Inective Impendment Surface 936 North Pond Si'I 839 - Inective Impendment Surface 842 North Bond Soil 8:45 Inactive Impendment Surface 8:48 North Pond Surface 8:50 - Inactive Impendment Surface 8:50 - Inactive Impendment Surface 8:51 South Road Soil 9:52 - Inactive Impendment Surface 8:58 Sith And Si'I 9:00 - Inactive Impendment Surface 9:00 - Inactive Impendment Surface 9:01 Unst Pond Si'I 9:05 - Inactive Impendment Surface 9:07 Unst Pond Si'I 9:08 - Inactive Impendment Surface 9:07 Unst Pond Soil 9:08 - Inactive Impendment Surface 9:07 Unst Pond Soil 9:08 - Inactive Impendment Surface	TIME COLLECTED TYPE VOLUME 828 - Inechile Impandment Surface 838 - Inechile Impandment Surface 842 Morth Bond Soil 8:45 Inactive Impandment Surface 8:48 Morth Pond Surface 8:50 - Inactive Impandment Surface 8:50 - Inactive Impandment Surface 8:53 South Road Soil 9:51 - Inactive Information Surface 858 Soft And Surface 9:02 Goth Pond Surface 9:05 - Inactive Impandment Surface 9:07 Mast Pond Surface 9:08 June Pond Surface 9:09 June Pond Surface 9:09 June Pond Surface 9:00 June Pond Surface	TIME COLLECTED TYPE VOLUME 8-18 - Inective impossible of Sil 32 02 8-36 North Pond Sil 32 02 8-37 Inective impossible of Sil 45 8-42 North Pond Soil 11 8-48 North Pond Soil 11 8-58 Inactive impossible of Sil 11 8-58 South Rad Soil 11 9-60 Inactive impossible Surface 11 8-58 Soil Panel Soil 11 9-60 Inactive impossible Surface 11 9-6

ACKNOWLEDGEMENT OF FACILITY REPRESENTATIVE

The undersigned acknowledges that the samples described above have been collected.

NAME, TITLE AND ADDRESS OF FACILITY REPRESENTATIVE:

JOE E. PORTER - ENVIRONMENTAL ENGL	sear 501-572-3701
Verthe Chemical Corp - West Helen	AR 72390
THE ENOUTED	August 20, 85
(Signature)	(Date)

DISTRIBUTION:

One copy facility representative One copy for inspector's records Original to Regional Office



UNITED STATES ENVIRONMENTAL PROTEG REGION VI

1201 ELM STREET DALLAS, TEXAS 75270

D.5408110 ON AGENCY Cedar Chemical ARD 990660699 2-16-90

RECEIPT FOR SAMPLES

Miles w. Bolton NAME AND TITLE OF EPA REPRESENTATIVE:

FIT oround water Hydrologist Miles w. Bolton

SAMPLES COLLECTED:

SAMPLE	TTVP	PLACE	Soil	TOI TVE		AMPLE
NUMBER	TIME	COLLECTED	TYPE	VOLUME	REQUESTED	PROVIDED
AI	0836	North Imparament	organics Increases VOA	340m2	yes	yes
<u>B1</u>	0839	11 11	Enorganic Von	1602 802 240m1		" !
61	0845	1/ 1/	Inorganic VOA	11	11	- 11
DI	0853	South Impoundment	VVI	11		11:
EI	0852	" "	JASTSONIE VC A	11	1,	11
FI	0902	11 11	Inorganie VOM	11		
61	0905	wast Important	Inorganie With	11		12
#1	0908	1. 11	Inongrait Ve H	11	1,	
II.	09/6	1) 11	inoromii Mon	11		11

ACKNOWLEDGEMENT OF FACILITY REPRESENTATIVE

The undersigned acknowledges that the samples described above have been collected.

NAME, TITLE AND ADDRESS OF FACILITY REPRESENTATIVE:

- ENVIRONMENTAL Veretre Chemical CORP - West HeleNA BOX 2149 - West HeleNA, AR August 21,1985 (Signature)

DISTRIBUTION:

One copy facility representative One copy for inspector's records Original to Regional Office



UNITED STATENVIRONMENTAL PROTECT AGENCY REGION VI

1201 ELM STREET

p. 55 of 110 Cedar Chemical ARD 990660649 2-16-90

DALLAS, TEXAS 75270

RECEIPT FO	OR SAM	PLES		
NAME AND TITLE OF EPA REPRESEN	TATIV	E: Miles	Botton	
		FIT GV	rand water Hy	drots ist
		mil	Ew. pollon)
			(Signature)	
SAMPLES COLLECTED:				
NUMBER TIME COLLECTED T	Soi/	VOLUME 1002	SPLIT S REQUESTED	AMPLE PROVIDED
A 2 1241 North Impordment In	WA	240m1	yes	Yas
B2 1245 11	1/		71	7,
L2 1317 11	7.	1.	"	
D2 1330 South Impoundment	17	1,	4	17
		-		
	_		_	
				-
	•		1	
ACKNOWLEDGEMENT OF	FACIL	TTV DEPDECE	ENTATIVE	
The undersigned acknowledges to been collected.	hat t	he samples	described abo	ve have
NAME, TITLE AND ADDRESS OF FAC	CILITY	REPRESENTA	ATIVE:	
TOE E. PORTER - ENVIRONME	entral	Engineer		
Vertac Chemical Corp- We PO Bux 2649 - West	51,1	Helena MAN	1390	
THE EXITER		L	of 21, 1985	
(Signature)		4 Mg/	(Date)	
		*		

DISTRIBUTION:

One copy facility representative One copy for inspector's records Original to Regional Office

Miles Bolton | Weldon Day

Date / Time / Direction

Vertec, West Italena site West Helena, AR (AR361)

dar Chemical RD 990660699


8/20/85/8:50/ Southwest + Southeast

Comments: Photographo 1 £ 2

Panoramic View of the

Vertac, West Holena site.

Somples are being collected at thesite.

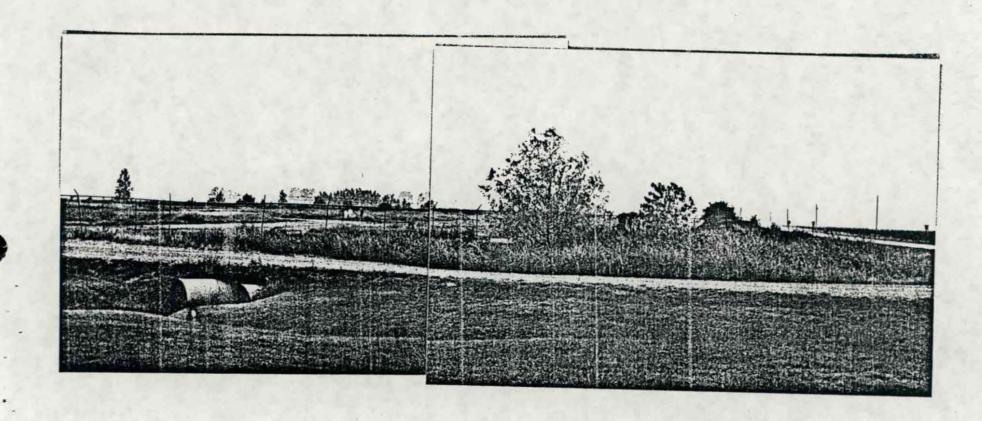

p. 57 of 110 cedar Chemical ARD 990660649 Miles Bolton / Weldon Day


Date / Time / Direction

8/20/85/8:50/ South east

Comments: Photograph 3

Panoramic View Continued.

Vertac-West Helena site West Helena, BR (BR 361)

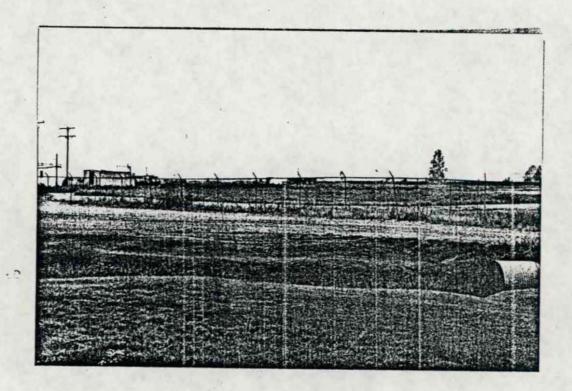

p. 58 of 110 cedar Chemical ARD 990660649 2-16-90

Photographer / Witness

Miles Botton / Weldon Day

Date / Time / Direction

8/20/85/12:42/ East

Comments: Photograph 4

Sample station A

Photographer / Witness

Miles Bolton/ Weldon Day

Date / Time / Direction

8/20/85/12:47/ East

Comments: Thotograph 5

Semple station B

Photographer / Witness

Miles Botton/ Weldon Day

Date / Time / Direction


8/20/85/13:30/ East

Comments: Photograph 6

Semple Station C

vertec - West Helenic site
West Helene, BR

ER 361)

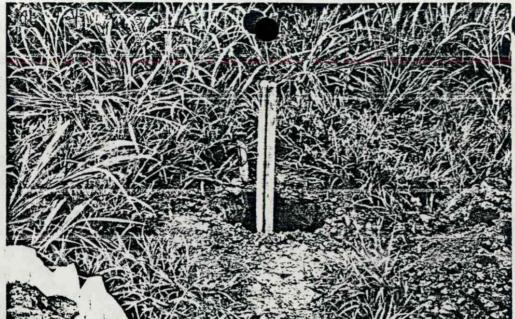

p. 59 of 110 codar Chemical ARD 990660649 2-16-90

Photographer / Witness

Miles Botton / Woldon Day

Date / Time / Direction

8/20/85/13:32/ Fost

Comments: Photograph 7

Sample station D



Photographer / Witness


Miles Bolton/Weldon Day

Date / Time / Direction

8/21/85/8:43/ North

Comments: Photographs 8

Semple station E

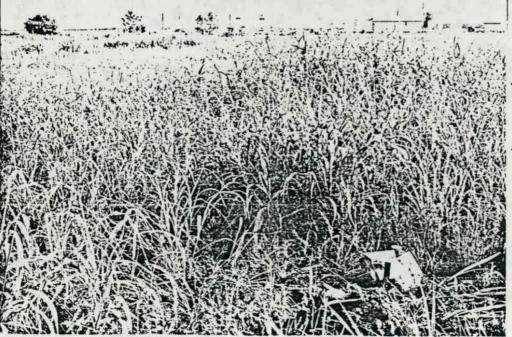

Photographer / Witness

Miles Bothen / Weldon Day

Date / Time / Direction

8/21/85/8:53/ North

Comments: Photograph 9

Sample Station F

Vertoc - Wost Helena West Helena, AR (AR361)




p. 60 of 110 Codar Chemical ARD 99060649 2-16-90

Miles Bolton/ Weldon Day

Date / Time / Direction 8/21/85/9:52/ South

Comments: Photograph 10

Sample Station G

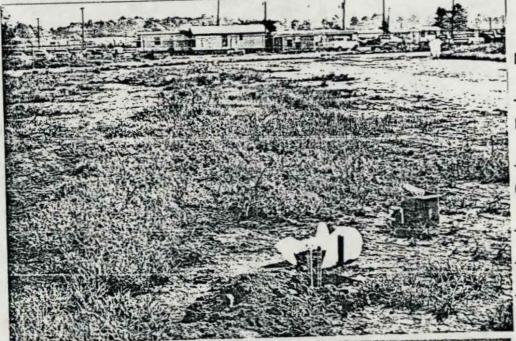

Photographer / Witness

Miles Bolton/Weldon Day

Date / Time / Direction

8/21/85/9:54/ North

Comments: Photograph 11

Sample station #



Photographer / Witness

Miles Bolton/ Weldon Day

Date / Time / Direction

8/21/85/10:36/ South

Comments: Photograph 12

Sample Station I

Vertec - West Holena West Helena, AR (AR 361)

p. 61 of 110 codar Chemical ARD 990660649 2-16-90

RCRA COMPLIANCE INSPECTION REPORT GENERATORS CHECKLIST

Note: On multiple part questions, circle those not in compliance. Section A - EPA Identification NO. Does Generator have EPA I.D. NO.? (262.12 - EPA I.D. No.) a. If yes, EPA I.D. No. A R D 9 9 0 6 6 0 6 4 9 Section B - Hazardous Waste Determination 1. Does generator generate hazardous waste(s) listed in Subpart D (261.30 - 261.33 - List of Hazardous Waste) a. If yes, list wastes and quantities on attachment (Include EPA Hazardous Waste No.) Yes V Not in last 2 years. (Provide waste name and description.) 2. Does generator generate solid waste(s) that exhibit hazardous characteristics? (corrosivity, ignitability, reactivity, EP toxicity) (261.20 - 261.24 - Characteristics of Hazardous waste.) a. If yes, list wastes and quantities on attachment. (Include EPA Hazardous Waste No.) (Provide waste name and description) See Generator Nassative Attachment Does generator determine characteristics by testing or by applying knowledge of processes? Both testing and knowledge 1. If determined by testing, did generator use test methods in Part 261, Subpart C (or Equivalent)? Yes 2. If equivalent test methods used, attach copy of equivalent methods used. N/A Are there any other solid wastes deemed non-hazardous generated by generators? (i.e. process waste streams, collected matter from air pollution control equipment, water treatment sludge, etc.) Yes a. If yes, did generator determine non-hazardous charcteristics by testing or knowledge of process? Both testing and knowledge 1. If determined by testing, did generator use test methods in Part 261, Subpart C (or Equivalent)? Yes 2. If equivalent test methods used, attach copy of equivalent methods used. N/A List wastes and quantities deemed non-hazardous or processes from which non-hazardous wastes were produced. (Use narrative explanations sheet,) See Generator Narrative Attachment 4. Are any wastes recycled, reused or reclaimed on-site? L Yes

If yes, use narrative to describe the type and quantity of the waste and the

method used for reclamation Hadwent See Generator Naviative Attachment

Site Name: (edas Chemical 1.D. Number: ARD990660649 2-16-90

				ni ni	
5.	No	t at	wastes shipped off-site for reclamation?	24 Yes No	
	lf y its	es, dest	use narrative to describe the type and quantity of tination. Also give a description of storage prior	the waste and to shipment.	
Sec	tion	c -	Manifest		
1.			nerator ship hazardous waste off-site? : B - The Manifest)	Yes	No
	a.	If r	no, do not fill out Section C and D.		
	b.	If y	ves, identify primary off-site facility(s). (Use rative explanations sheet.)		
2.			erator shipped hazardous waste off-site since 19, 1980?	✓ Yes	No
3.	Is g	ene	rator exempted from regulation because of:		
	Sma1	1 q	uantity generator (261.5 - Special requirements)	Yes	No
	<u>OR</u>				
			s non-hazardous waste at this time - Exclusions)	Yes	No
4.			exempted does generator use manifest? - General requirements)	Yes	No
	a.	inf	yes, does manifest include the following ormation (262.21 - Required information) eak up items or circle ones not on manifest)		
		1.	Manifest Document No.	Yes	No
		2.	Generators Name, Mailing Address, Tele. No.	Yes	No
		3.	Generator EPA 1.D. No.	Yes	No
		4.	Transporter(s) Name and EPA I.D. No.	Yes	No
		5.	a. Facility Name, Address and EPA I.D. No.	v Yes	No
		6.	DOT description of the waste	Yes	No
		7.	a. Quantity (weight or volume) b. Containers (type and number)	Yes Yes	No No
		8.	Emergency Information (optional) (special handling instructions, Phone No.)	Yes	_ No
ffec 9/1/8		9.	Waste minimization certification	Yes	No.

Site Name: Calar Chemical

1.D. Number: ARD 990660649

2-16-90

		9.	manifest form?	Yes	No.
			This is to certify that the above named materials are properly classified, described, packaged, marked and labeled and are in proper condition for transportation according to the applicable regulations of the Department of Transportation and the EPA.		
5.	Doe	es genera	tor retain copies of manifests?	Yes	_ No
	man	ifests w	leted manifests at random. Indicate how many ere inspected, how many violations were noted e of violation.)		
	If ite	yes, com	plete a through e. If questions contain more to e those not in compliance. (263.23 Use of the I	han one Manifest)	
	a.	(1) Did ins	generator sign and date all manifests pected?	Yes	_ No
		(2) Who	signed for generator? Name Soe Porter	Title Environme	utal Engin
	b.		generator obtain handwritten signature and e of acceptance from initial transporter?	Yes	
		(2) Who	signed for transporter? Name Various Judividuo	ds Title D,	ives
	٤.	Does ge generat	nerator retain one copy of manifest signed by or and transporter?	Yes	_ No
	u.		rned copies of manifest include facility perator signature and date of acceptance?	Yes	_ No
	e.	45 days	of manifest from facility was not returned with did generator file an exception report? - Exception reporting) None	hin Yes <u>N/A</u>	_ No
		(1) If Leg	yes, did it contain the following information: ible copy of manifest.	Yes	_ No
		AND			
			er letter explaining generators efforts to ate waste.	Yes	_ No
	f.	Does (w	ill) generator retain copies for 3 years?	Yes ·	No

Δ

Site Name: Codar Chemical
I.D. Number: ARD99066049

Sec	tion D - Pre-Transport Requirements		
1.	Does generator package waste?	Yes ·	_ No
	If no, skip to question 9. If yes, complete the following questions.		
	spect containers ready for immediate shipment. If ere are no such containers, skip to question 8. None Ready for immediate shipment		
2.	Does generator package waste in accordance with 49 CFR 173 178, and 179? (DOT requirements) (262.30 - Packaging)	Yes N/A	l No
3.	Are containers to be shipped leaking or corroding or bulging? Use narrative explanations sheet to describe containers and condition.	Yes	_ No
4.	Does the generator use DOT labeling requirements in accordance with 49 CFR 172 when containers are offered for shipment? (262.31 - Labeling)	Yes	_ No

shipment? (262.32 - Marking)

6. a. Is each container of 110 gallons or less marked with the following label when containers are offered for shipment?

Yes No

Label saying: <u>HAZARDOUS WASTE</u> - Federal Law Prohibits Improper Disposal. If found, contact the nearest police or public safety authority or the U.S. Environmental Protection Agency.

Does the generator mark each package in accordance with 49 CFR 172 when containers are offered for

Generator's Name and Address N/A

b. If other labels exist, list in narrative.

- If there are any vehicles present on-site loading or unloading hazardous waste, inspect for presence of placards. Note this instance on narrative explanation sheet. None present
- 8. Satellite Accumulation (effective June 20, 1985)
 - a. Does the generator accumulate waste in containers at or near "satellite" generation points?

If no, skip to question 9.

Manifest Document Number

If yes, complete the following.

Site Name: (cdar Chemical 1.D. Number: ARD 990660649

5

	b.	Are containers in good condition?	Yes	No
	c.	Is the waste compatible with the containers?	Yes	No
	d.	Is waste transferred from leaking containers or otherwicontrol leakage?	se managed to Yes	
	e.	Are containers closed?	Yes	No
	f.	Are containers marked with the words "hazardous waste" of the contents?	or identification	
	g.	Has waste accumulation exceeded one (1) quart of acutel (261.33 e.) or 55 gallons of other hazardous waste?	y hazardous v	vaste No
		If yes,		•
		1. Has the container holding the excess amount been mathematical the date the excess began accumulating?	rked with Yes	No
		2. Have excess amounts remained in the satellite accumarea longer than three (3) days?	nulation Yes	No
9.	Acc	umulation Time (262.34 - Accumulation Time)		
	a.	Is the site a permitted/interim status storage facility	? Yes _	✓ No
		If yes, skip to Section E, and complete and attach the TSD checklist and appropriate supplemental checklists. If no, answer rest of question #9.		
	b.	Is hazardous waste shipped offsite within 90 days?	_ ves	No
	c.	Is waste stored in containers or tanks?	Yes	No
	d.	Is the beginning date of accumulation time clearly indicated on each container?	Yes	No
	e.	Is each container or tank marked with the words "Hazardous Waste"?	Yes	No
	f.	Complete and attach the containers/tanks supplemental checklists as appropriate.		
	9.	If generator accumulates waste on-site for less than 90 days, complete RCRA Generators Checklist Supplement.		

Site Name: <u>Cedar Chemical</u>
I.D. Number: <u>ARD 990660649</u>
2.16.90

Section E - Recordkeeping and Reporting

1.	Is generator keeping the following reports for a minimum of three (3) years? (262.40 - Recordkeeping)		
	a. Manifests and signed copies from designated facilities?	Yes	_ No
	 Biennial reports (or reports as required by state agencies) 	Yes	_ No
	c. Exception Reports None	Yes _N//-	A No
	d. Test results, where applicable.	Yes	_ No
2.	Where are records kept (at facility or elsewhere)? Facility		10
3.	Who is in charge of keeping the records? Name Soe Poster	Title Environm	ental Engin
	tion F - Special Condition		
1.	Has generator received from or transported to a foreign source any hazardous waste? (262.50 - International Shipments)	Yes	No
lf,	yes,		
	a. Has a note been filed with the R.A.?b. Is this waste manifested and signed	Yes NA	
	by Foreign Consignee? c. If generator transported wastes out of the country has he received confirmation of	Yes	_ No
	delivered shipment?	Yes	_ No
	d. Has the generator filed an annual report (by March 1 of each year) giving the type, quantity, frequency and destination of all exported hazardous waste? (Per HSWA 1984)	Yes	
		-	

Cedar Chemical Corp. ARD990660649 February 16, 1990

GENERATOR NARRATIVE ATTACHMENT

Section B - Hazardous Waste Determination

- 2.a. D001 Permethrin Wastewater 315,133 pounds per month to Empak, Inc., Deer Park, TX.
 - D001 Permethrin Wastewater 11,143 pounds per month to Gibraltar Chemical, Winona, TX
 - D001 Cypermethrin Wastewater 1,110,783 pounds per month to Empak, Inc., Deer Park, TX
 - D001 Cypermehrin Wastewater 96,317 pounds per month to Gibraltar Chemical, Winona, TX
 - D007 Waste calcium chloride solution containing chromium inhibitor 13,323 pounds per month to Rollins Environmental, Plaquemine, LA

All monthly generation rates are based off 12 month generation and do not actually represent monthly generation rate. Calcium chloride was a one-time waste created when Cedar changed refrigeration system out.

- 3.b. Biological treatment system treats approximately 45,833 gallons per month averaged over a 12 month period. Elementary neutralization of propionic acid with anhydrous ammonia and surface drainage are the sources of water.
- 4. Cedar Chemical reclaims or reformulates some off-spec products on-site. At the time of the inspection there were 126 drums of Propanil and 82 drums of Permethrin/Cypermethrin in storage. The products were manufactured for sale in a foreign country, according to Joe porter, and are not a sellable product in the U.S. but are not considered waste by Cedar. These off-spec products are stored in drums prior to reformulation and are segregated from the hazardous waste drum storage area. These off-spec chemical products are exempt from RCRA regulations as far as I can tell. I was concerned about the condition of some of the containers. I observed open drums and damaged drums of off-spec product. These drums were on a concrete pad but were not protected from the weather and could ultimately result in a release to the environment considering the condition of the drums.

A 6808 110

2-16-90

Site Name: Codar Chamical I.D. no.: ARD990660649

RCRA GENERATORS CHECKLIST

SUPPLEMENT

Personnel	Training
-----------	----------

		facility personnel successfully completed a program of cla ne-job training?	ssro		No
i	a. '	Does the training program include instructions in the foll	owin	g:	
(:	1)	procedures for using, inspecting, repairing and replacing emergency and monitoring equipment		lity Yes	No
(2	2)	key parameters for automatic waste feed cut-off systems _	1	Yes	No
(:	3)	operation of communication or alarm systems	1	Yes	No
(4	4)	response to fires, explosions and groundwater contamination	on in	cidents Yes	No
(!	5)	shutdown of operations	/	Yes	No
(6)	general hazardous waste management procedures	V	Yes	No
1	b.	Is the program directed by a person trained in hazardous wanagement procedures?	vaste	Yes	No
(c.	Have personnel completed annual training reviews?	V	Yes	No
	d.	Does the owner/operator maintain the following documents:			
(:	1)	job title, job description and name of employee for each the facility related to hazardous waste management	posit	ion at Yes	No
(:	2)	written description of the type and amount of both introducentinuing training	uctor	y and Yes	No
t	3)	written documentation that the training has been complete personnel	d by	facilit Yes	y No
Pre	epar	edness and Prevention			
1.	th	there evidence of fire, explosion or contamination of me environment? (265.31 - Maintenance and operation of acility)		Yes	N

If yes, use narrative explanations sheet to explain.

See RCRA Generator Supplement Narrative

2.	Is t	he facility equipped with (265.32 - Required equipmen	nt)		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
	a.	Internal communications or alarm system 1. Is it easily accessible in case of emergency?	-	Yes_ Yes_	No
	b.	Telephone or two-way radio to call emergency response personnel	F	_Yes_	No
	c.	Portable fire extinguishers, fire control equipment spill control equipment and decontamination equipment		✓Y es_	No
		1. Is this equipment tested to assure its proper operation?		VY cs_	No
	d.	Water of adequate volume for hoses, sprinklers or water spray system		Yes_	No
		1. Describe source of water Helena and West H	eleva		
		 Indicate flow rate and/or pressure and storage capacity, if available. DK 			
3.	Requ Has	here sufficient aisle space to allow unobstructed ment of personnel and emergency equipment?(265.35-ired Aisle Space) the owner/operator made arrangements with the local orities to familiarize them with characteristics of		Y es	No
	the ous faci to r	facility? (layout of facility, properties of hazard- waste handled and associated hazards, places where lity personnel would normally be working, entrances oads inside facility, possible evacuation routes.) .37 - Arrangements with local authorities)		✓Yes_	1.0
1f men	no, h	as the owner/operator attempted to make such arrange-		Y es\	UAlio
5.	depa	he case that more than one police or fire artment might respond, is there a designated eary authority? (265.37 - Arrangements with local porities)	✓Yes	No	
	If	yes, indicate primary authority west Heleva			
	a.	Is the fire department a city or volunteer fire department?			
6.	agr e	the owner/operator have phone numbers of and ements with State emergency response teams, gency response contractors and equipment liers?	Yes	No	
	Are (265.	they readily available to the emergency coordinator? 37 - Arrangements with local authorities)	✓ Yes	No	

		Site	Name: Codar Chemi	ml
7.	Has the owner/operator arranged to familiarize locar hospitals with the properties of hazardous waste handled and types of injuries that could result from fires, explosions, or releases at the facility? If no, has the owner/operator attempted to do this? (265.37 - Arrangements with local authorities)	Yes	No.: ARD990660 3-16-90 No.: ARD990660	649
8.	If the State, or local authorities decline to enter into the above referenced agreements, has this situation been entered in the operating record? (265.37 - Arrangements with local authorities)		N/A No	
Cor	ntingency Plan and Emergency Procedures			
1.	Does the facility have a contingency plan? (265.52 Content of Contingency Plan) a. If yes, does it contain:	Yes	No	
	 actions to be taken in response to emergencies description of arrangements with police, fire and hospital officials list of names, addresses, phone numbers of persons qualified to act as emergency coordinator list, including the location and physical desciption of all emergency equipment evacuation plan for facility personnel including signals, primary and alternate routes 	Yes Yes Yes Yes	No No No No No No	
2.	Is a copy of the contingency plan maintained at the faci (265.53 - copies of contingency plan)	ity?	No	
3.	Has a copy been supplied local police, fire depts., and hospitals? (265.53 - Copies of contingency plan)	Yes	No	
4.	Has the contingency plan been updated and amended as necessary?	Yes_	No	
5.	Is the plan a revised SPCC Plan? (265.52 - content of contingency plan)	∠Yes	No :	
6.	Is there an emergency coordinator on-site or within short driving distance of the plant at all times?	Yes	110	
	If yes, list primary emergency coordinator: See Por	les		

Cedar Chemical Corp. ARD990660649 February 16, 1990

RCRA GENERATOR SUPPLEMENT NARRATIVE

Preparedness and Prevention

There is evidence of an explosion and contamination of the environment on the site. The BSC unit blew up on September 25, 1989, requiring implementation of the contingency plan. ADPC&E investigated the site and Cedar filed a report with this department. A copy of this report is on file.

There are several areas around the plant property which have yellow stained soil. According to Joe Porter, the yellow stains are from previous owners, Ansel Corporation, burying Dinoseb on the site. On particular area is in the vicinity of the warehouse where, according to information I have read, approximately 250 drums are encapsulated in clay and covered by the concrete foundation. I have not been able to obtain information concerning the contents or the exact number of drums.

There are three pre-RCRA surface impoundments which were closed in 1978. It is apparent that the impoundments are contaminated due to the lack of vegetation covering them and the results of the soil borings in the attached report form EPA.

Groundwater contamination has been detected and verified both by Cedar Chemical's lab and by samples split with ADPC&E. Groundwater samples were split on the day of this CEI. Purged water was discharged directly onto the ground and was found to be contaminated after lab analysis, further contributing to on-site contamination.

A drum disposal site was unearthed during construction of a drainage ditch. Eight drums were dug up and, according to information I received, contained Dinoseb (P020). Cedar anticipates more drums being buried in this area and has submitted a plan to remove the drums and possibly locate other buried drums in an area they plan to expand the plant.

Site Name: <u>Cedar Chemical</u>
I.D. Number: <u>ARD490660099</u>
2-16-90

CONTAINERS STORAGE CHECKLIST (Subpart I - Use and Management of Containers 265.170)

		-		
1.	Does the facility store hazardous waste in containers?	r _v	Yes	No
	If no, do not complete this form.			
2.	Are the containers in good condition? (check for leaks, corrosion, bulges, etc.) No containers in storage. If no, explain in narrative and document with photograph		Yes <u>N/</u>	<u>4</u> No
3.	If a container is found to be leaking, does the operator transfer the hazardous waste from the leaking container?	Yes	No	
4.	Is the waste compatible with the containers and/or its liner?	✓ Yes	No	
	If no, explain in narrative.			
5.	Are the stored containers closed? No containers in storage If no, explain in narrative.		Yes N/	<u>4</u> No
6.	Are containers holding hazardous waste opened, handled or stored in such a manner as to cause the container to rupture or leak?		Yes _	No
	If yes, explain in narrative.		Trap.	
7.	Are each of the containers inspected at least weekly?	Yes	No	
	If no, explain in the narrative the frequency of inspect	ion.		
8.	Are containers holding ignitible or reactive wastes located at least 15 meters (50 feet) from the facility property line?	Yes	No	
	If no, explain in narrative and document with photograph			
9.	Are incompatible wastes stored in the same containers? No incompatibles, If yes, explain in narrative.		Yes N	<u>/4</u> No
10.	Are containers holding incompatible wastes kept apart by physical barrier or sufficient distance? No incompatibles. If no, explain in narrative.		Yes NA	A No
	· · · · · · · · · · · · · · · · · · ·			

Revised: February, 1987

See Naviative

Site Name: Codar Chamical
ID Number ARD 990660649
2-16-90

GROUND WATER MONITORING CHECKLIST Note: Checklist used for guidance only.

1. GROUND WATER MONITORING STATUS:
Note: Ground water monitoring installed as required by CAD LIS 86-027
Complete the table for each Waste Management Area (WMA):
Note: There are no interim status or permitted RCRA units.

AMA	Description of Units in WMA	Status	Monitoring Status	Wel:	er of
1	Codar Chemical Physical Plant	Generator	Detection	10	8 D
2				U	D
3				U	D
4				U	D
		Total	of MW's @ Facil		
•	Provide diagram showing locations and indicate date of installation			ound e	ach Wh
	Has the facility installed at lea each WMA? If No, explain in narrative See Narrative		Yes	No V	-
•	If yes, does the background well upgradient of the WMA? If No, explain in narrative. See Navadive	(s) appear to	yes	No N/	lly A
	Has the facility installed at least monitoring wells for each WMA? If No, explain in narrative. See Naveline	ast three haz	Yes		
	If yes, do the detection wells and downgradient of the WMA? If No, explain in narrative.	ppear to be 1	ocated hydraulic Yes		VA_
	See Naviative Does the facility have a GW Samp If Yes, Does it include?	ling and Anal	ysis Plan? Yes	<u>~</u> N	o
	 Sample collection procedures Sample preservation and ships 	ment	Yes Yes	No No	
	c. Analytical procedures		Yes V	_ No	7 9
	d. , Chain of Custody procedures			No No	_
	e. QA/QC procedures Does the facility have GW Quality	v Assessment	Yes V		No

		Si 1.	te Name : _ D. Number:	Cedar Chemical ARD 99 0660649 2-16-90
8.		the facility been granted an alternate groundwatial waiver? See Name toe	ter monitor Yes	
	a.	If yes, is an approved sampling and analysis pl followed?	an Yes	No N/A
	b.	If yes, give date of approval		N/A
9.	Doe	s the facility keep records of the following?		
	a.	Analyses for ground water parameters?	Yes	No
		Calculations of means and variances?	Yes	No To
	c.	Water surface elevations taken at each well	Service Silver	Tally a P
	12	sampling event?	Yes _ V	No
	d.	Analyses of duplicate samples for contamination		/
		confirmation?	Yes _ V	No
	e.	Analyses of samples taken as a result of implementing the Ground Water Quality Assessmen	+	
		Plan? See Marrative	Yes	No N/A
	f.		A STATE OF THE PARTY OF THE PAR	No N/A
		(1) Rates of Migration? See Nauvalice	Yes	No NIA
		(2) Concentration of hazardous waste and/or	1 1 To	10/7
		constituents thereof? See Nariative	Yes	No N/A
		(3) Analyses of quarterly ground water sampling	? Yes	No N/A
	g.	Copies of annual reports of the groundwater		
		monitoring program?	Yes	No
7.	Are	plete the remaining checklists as applicable to a. Indicate which checklists are completed. First Year Background Sampling Semi-Annual Detection Monitoring GW Assessment Monitoring	each Waste	Management
Com	ment	s: <u>See Narrative</u>		
		Cedar Chemical Corporation is a generator only.		
		with ground water monitoring. All units are pr		
		Groundwater monitoring was required by CA		
		ine if past apprations contaminated ground up	ter, Conta	mination
la		hope detected and fiture along me expected		

Site Name: Calar Chemical
ID Number: ARD 990660649
2-16-90

FIRST YEAR BACKGROUND SAMPLING

(Cor	mplete only for those facilities presently doing background sampling)
Wast	ce Management Area(s) <u>Cedar Chemical Physical Plant</u>
1.	Are all samples analyzed for:
	EPA Drinking Water Standards? See Navative Ground water quality parameters? See Navative Contamination indicator parameters? Yes No No
2.	Are 4 replicate measurements of contamination indicator parameters made for each well sample? Yes No
3.	Are ground water surface elevations determined at each well sampling event? Yes $\underline{\hspace{1cm}}$ No $\underline{\hspace{1cm}}$
4.	Briefly explain why facility is performing first year sampling at this time:
	See Groundwater Monitoring Narvative
	Note: Cedar Chemical Corporation is a generator only. There are no
	regulated units with groundwater monitoring. All units are pre-RCR
	or not RCRA units. Ground water monitoring was required by CAO
	LIS 86-027 to determine if past operations contaminated ground water
	Contamination has been detected and future plans are expected.

Site Name: (edas Chemical ID Number ARD 990660649 2-16-90

GW SEMI-ANNUAL DETECTION MONITORING

(To be completed for those facilities that have completed the first year of background sampling)

as	te Management Area(s)	-	N/A
	Was the first year background sampling program completed?	Yes	No _
	Are wells sampled and analyzed annually for ground water quality parameters?	Yes	No
-	 a. Are wells sampled and analyzed semi-annually for contamination indicator parameters? b. Are 4 replicate measurements of indicator parameter made for each upgradient and downgradient well 	Yes	No
	sample?	Yes	No _
	Are ground water surface elevations determined at each well for each sampling event?	Yes	No
	Were ground water surface elevations evaluated annually to determine whether monitoring wells are properly placed?	Yes	No
	a. If no, explain		
	Are statistical comparisons, using the Student t-test at the 0.01 level of significance, performed?	Yes	No
	a. If no, explain		
	Did the statistical comparisons show a significant ind (or pH decrease) of indicator parameters in the upgrad well(s)?		No
	a. If yes, did (will) the facility submit this information in the annual ground water monitoring report?	mation Yes	No

2-16-90

Site Name: Coda Chemical I.D. Number: ARD 99060649

8. Did the statistical comparisons show a significant increase (or pH decrease) of indicator parameters in the downgradient wells? 9. If significant increases (or pH decreases) in downgradient wells were detected, did the company: a. Resample the "affected" well(s), split the sample in two, and re-analyze for the parameter(s) that showed significant difference? No b. Confirm the significant difference? Yes No c. Notify the Director within 7 days of confirmation? No d. Submit a certified Ground Water Quality Assessment Plan within 15 days of notifying Yes the Director? No 10. Has the facility substituted other indicator parameters in place of pH, conductivity, TOC and/or TOX? Yes No b. List the parameters: c. Date of approval Comments:

Site Name: Codas Chemical
ID Number: ARD 990660649

7-16-90

GW ASSESSMENT MONITORING

(To be completed for those facilities that have entered Assessment Phase of Monitoring)

Was	te Management Area(s)	N	/A
1.	Has the facility started to implement an approved Ground Water Quality Assessment Plan? Give date plan was started	No _	
2.	If the plan is in progress, give projected completion date describe actions to date:	- A-1	and
	a. Is the facility on schedule? Yes	No _	de
3.	If the plan has been completed, give date of Ground Water Qualit Assessment report:	ty	
4.	Do results indicate that hazardous waste or constituents have been detected?	No _	
	a. If yes, has an Assessment Monitoring Program been implemented? b. If no, was detection monitoring reinstated? c. If the facility has not responded appropriately, explain which in comments.	No - No -	
	Note: If answer to 4b is yes, Stop Here.		1
5.	List the hazardous waste constituents detected:	10	
6.	Has the facility Sampling and Analysis Plan been revised to include these parameters? Yes	No	
7.	Quarterly, since completion of assessment, has the facility continued to:		
	a. Sample and analyze for hazardous waste or constituents? Yes	No	
	b. Determine rate and extent of migration of hazardous waste or constituents? Yes	No	

Site Name: Cedar Chemical
I.D. Number: ARD990660649
2-16-90

8.	Yearly, has the facility reported the results of the assessment program (with annual waste report), to include the calculated (or measured) flow rate in ground water during the reporting period? YesNo NA
9.	Has the assessment detected hazardous waste or constituents in ground water at this regulated unit? Yes No
	a. If yes has the facility sampled and analyzed for all hazardous waste constituents (Appendix VIII, 40 CFR 261) to characterize the plume in accordance with 40 CFR 270.14(c)(4)? YesNo
Com	ments:
-	

Note: This ground water monitoring checklist is designed for site verification during routine CEI inspections and is not intended to be used to evaluate the technical aspects of a ground water monitoring program. All technical evaluations will be found in the Compliance Monitoring Evaluation report.

Cedar Chemical Corp. ARD990660649 February 16, 1990


GROUNDWATER MONITORING NARRATIVE

Cedar Chemical Corporation installed an approved groundwater monitoring system as part of CAO LIS 86-027. The CAO required that Cedar submit a hydrogeologic investigation plan for approval, conduct a hydrogeologic investigation (after approval of the plan) and submit results of that investigation and implement a groundwater monitoring plan as a result of that investigation. The groundwater monitoring plan has been implemented and sampling has been done on an accelerated sampling plan. They are currently in the last round of sampling and will do the last round sampling in April, 1990. A final report on the findings is due shortly after sampling is completed. It should be noted that Cedar Chemical is not operating RCRA waste management units and, therefore, is not under a permit or interim status at this time. There are three pre-RCRA surface impoundments on-site which are closed and have been found to have contamined soils.

The Groundwater Monitoring Checklist used in this report is applicable to interim status monitoring and is only used for guidance purposes. Much of the checklist is not applicable because there are no RCRA regulated waste management units. The monitoring system was installed to assess whether or not this facility has impacted groundwater quality and not to determine the impact of each individual waste unit. Wells are not installed at the individual closed units so questions 2-5 are not applicable to this situation.

A Groundwater Sampling and Analysis Plan was included in the Groundwater Monitoring Plan. A Groundwater Quality Assessment Plan Outline was not included in the CAO so questions on the checklist about implementation of the GWQAP are not applicable. Since contamination has been detected additional work is expected.

Monitoring wells were being sampled on the day of the inspection. I observed the wells purged directly onto the ground. Laboratory analysis confirmed the water to be contaminated on this day. See attached memo from Jay Justice to Mark Simpson, attached photos and Introductory Narrative for the violation.

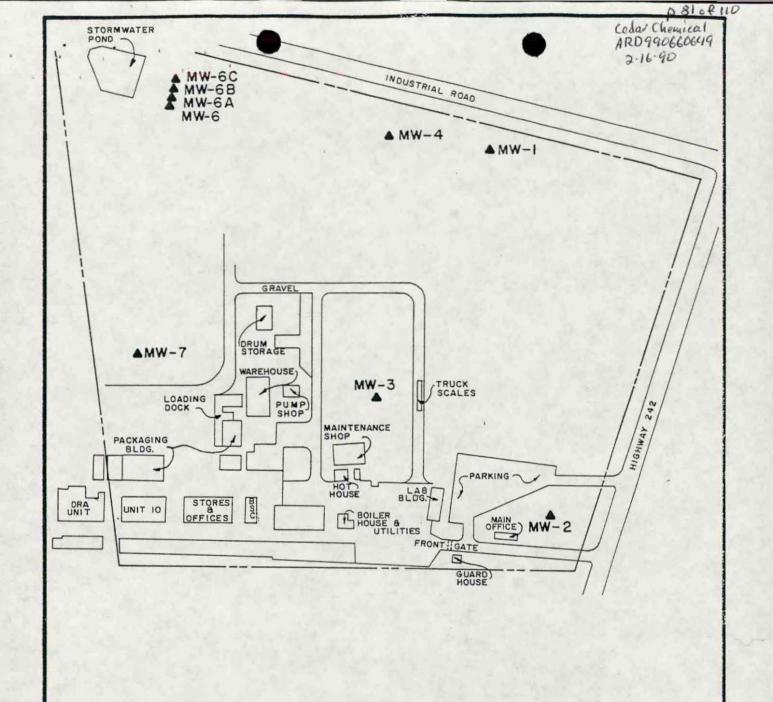

MONITOR WELL LOCATIONS

CEDAR CHEMICAL COMPANY WEST HELENA, ARKANSAS

> SCALE |" = 170'



p. 82 of 110 Cedar Chemical ARD 990660649 2-16-90

18

<0.04

ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TOC

Semivolatile organics

TO : David Hartley, Geologist II, Groundwater Sec., H.W.

FROM : Jay Justice, Hazardous Waste Chemist, T.S.

DATE : 10-APR-1990

SUBJECT : Results taken from analyses performed on samples

taken from monitoring wells located at Cedar Chemical

Company on February 16, 1990


The samples taken from monitoring wells located at Cedar Chemical Company on February 16, 1990, have been analyzed for TOC and semivolatile organics. The results from these analyses are listed below and are expressed in mg/l.

	MW 1	
TOC 1,2-Dichlorobenzene		5.8 0.04
	MW 2	
TOC Semivolatile organics		2.2
	*	
	MW 3	
TOC 1,2-Dichlorobenzene Dichloroanilines (1) Propanil (1)		21 0.28 0.13-0.25 0.04-0.09
	MW 4	
TOC Bromacil (1) (2)		11 0.04-0.07
	MW 6	

NW 6A

TOC Semivolatile organics	2.1 <0.04
MW 6B	
TOC 1,2-Dichlorobenzene Chloroanilines (1) Dichloroanilines (1) Bromacil (1) (2)	77 0.06 0.32-0.63 14-28 0.07-0.13
MW 6C	
TOC Chloroanilines (1) Dichloroanilines (1) Propanil (1) Bromacil (1) (2)	73 0.16-0.31 13-25 0.15-0.3 0.04-0.09
MW 7	
TOC Substituted monochlorinated Benzotriazoles (1) (2)	10 0.08-0.17
Field Duplicate (MW 6)	
TOC Semivolatile organics	NA(3) <0.04
Spike	
(Percent Recovery)	
Phenol 54 2-Chlorophenol 74 1,4-Dichlorobenzene 59 N-Nitroso-di-n-propylamine 37 1,2,4-Trichlorobenzene 60 4-Chloro-3-methylphenol 71 Acenaphthene 86 Pentachlorophenol 81 Pyrene 96	

- This value is an estimate
 Tentatively identified; not confirmed with a standard
 Not analyzed for this parameter



ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TO : Mark Simpson, Geologist, R.S.T. Div.

FROM : Jay Justice, Hazardous Waste Chemist, T.S. Div.

DATE : 7-DEC-1989

SUBJECT : Results from analysis on groundwater samples taken

at Cedar Chemical Company on October, 17, 1989.

The groundwater samples taken October 17, 1989, at Cedar Chemical Company located at West Helena have been analyzed for Semivolatile Organics and Total Organic Carbon. The results from these analyses are listed below and are expressed in mg/l.

Well #3

TOC	41
Methoxybenzene (1)	0.02
Dichlorobenzene (1)	0.15
Propanil (1)	0.17

Well #6C

TOC	67
Dichloroanilines (1)	25
Chloroaniline (1)	0.1

Well #6A

TOC	1.5
Phenylaniline (1)	0.025


Field Duplicate (Well #6C)

TOC	71
Dichloroanilines (1)	25

(1) Denotes a concentration that has been estimated.

cc: Jim Rigg, Geologist II, Groundwater Section Hazardous Waste Division 04-23-90 09:06 AM

FROM CEL CHEMICAL COR

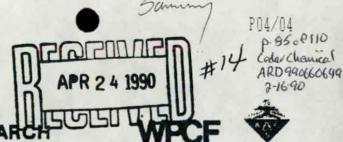

501 572 3795+



CONSULTANTS

PLANNERS

For



SORRELLS RESEARCH

8002 STANTON ROAD LITTLE ROCK, ARKANSAS 72209

(501) 562-8139

REPORT OF ____LABORATORY ANALYSIS

Date of Report: MARCH 5, 1990

Date Received: FEBRUARY 21, 1990

CEDAR CHEMICAL CORPORATION P.O. BOX 2749 WEST HELENA AR 72390

Job __ CEDAR CHEMICAL CORPORATION - TOC & TOH ANALYSIS - MONITORING WELLS

AS LISTED BELOW

LABORATORY NO.	SAMPLE I.D.	DATE/TIME	TOH UG/L	TOC MG/L	
E835.001	MW 1	02-16-90	648	5.72 +06	
E835.002	MW 2	02-16-90	20	2.74 +1	
E835.003	MW 3 FIELD	02-16-90 REPLICATE	4370 3360	24.97 +3 24.44 +-2.1	
E835.004	H₩ 4	02-16-90	1970	12.63 +05	
E835.005	MW 6	02-16-90	53	22.8 +5	
E835.006	MW 6A	02-16-90	62	2.81 +06	
E835.007	MW 6B	02-16-90	44000	19,99 +1	
E835.008	MW 6C	02-16-90	12200	101.8 +52	
£835.009	MW 7	02-16-90	3500	14.03 +1	
E835.010	FIELD BLANK	02-16-90	22	2.24 +04	

ANALYSIS BY: K. E. SORRELLS/CECIL SORRELLS
COLLECTED BY DFK FEB 90 / TRANSPORTED BY KEVIN HALL FEB 2

SAMPLE PRESERVATION AND LABORATORY ANALYSIS CONDUCTED ACCORDING TO EPA 40 CFR 136. *TEST/ANALYSIS/TIME/COEFF. VAR. *

OR PLAN FILED WITH A. D. P. C. & E. INCLUDES 10 % REPLICATION & 10% RECOVERY STUDIES BY RANDOM SELECTION. CALIB. RECORDS


MAINTAINED.

TDC/CAS/03-01/* TOH/KES/02-22-90/S.D. 13%

Copies to 2-ABOVE; ATTN: MR. JOE PORTER

Laboratory No. E385.001 - .010 CEDA LSH REVIEWED BY 1- C MINING M.S.

04-23-90 09:06 AM FROM CED CHEMICAL COR





For



SORRELLS RESEARCH LABORATORY AND FIELD SERVICES





8002 STANTON ROAD LITTLE ROCK, ARKANSAS 72208

(501) 562-8139

LABORATORY ANALYSIS

Determinent of December 21, 1989

Date of Report:

Date Bessived DECEMBER

Date Received:

13, 1989

CEDAR CHEMICAL CORPORATION P.O. BOX 2749 WEST HELENA AR 72390

Job CEDAR CHEMICAL CORPORATION - TOC & TOH ANALYSIS ON MONITORING WELLS

Sample From AS LISTED BELOW

TRANSPORTED BY SURRELLS RESEARCH.

LABORATORY NO.	SAMPLE I.D.	DATE/TIME	TOH UG/L	TOC MG/L
E492.001	MM T	12-11-87	657	4.96403
E492.002 FIELD	MW 2 REPLICATES	12-11-69 12-11-69	65.5 771.2	1.74 + :01 >2A2 3.1 + :02 >2A2
E492.003	MW 3	12-11-89	4970	26.2 + .3
E492.004	MW 4	12-11-69	1780	9.72 + .1
E492.005	MW 6	12-11-89	273	19.34 + .2
E492.006	MW 6A	12-11-89	35.3	2.37 + .09
E492.007	MW 6B	12-11-89	31500	84.7 +6
E492.008	MW 6C	12-11-89	44800	74.8 +9
E492.007	MW 7	12-11-69	979	8.77 +09
E492.010	FIELD BLANK	12-11-89	29	.664 +02
E492.011 B10	3191, B103192	12-11-69	< 3	.323 + .03
E492.012	B103194	12-11-69		.25 + .02

ANALYSIS BY:

K. E. SORRELLS/CECIL SORRELLS

Remarks

SAMPLE PRESERVATION AND LABORATORY ANALYSIS CONDUCTED ACCORDING TO EPA 40 CFR 136. *TEST/ANALYSIS/TIME/COEFF. VAR. **

GA PLAN FILED WITH A. D. P. C. & E. INCLUDES 10 % REPLICATION & 10% RECOVERY STUDIES BY RANDOM SELECTION. CALIB. RECORDS HAINTAINED.

TOC/CAS/12-18(0900)/*

TOH/KES/12-14-89/S.D. 8% S.R. 106.1 %


Coples to

2-ABOVE; ATTN: MR. JOE PORTER

Laboratory No. E492.001 - .014 CFDA DKS

REVIEWER BY K. Flavelle M.S.

04-23-90 09:06 AM FROM CED CHEMICAL CORP





PLANNERS



SORRELLS RESEARCH LABORATORY AND FIELD SERVICES





8002 STANTON ROAD LITTLE ROCK, ARKANSAS 72209 (501) 562-8139

REPORT OF LABORATORY ANALYSIS

Date of Report OVEMBER 20, 1989

Date Received CTOBER 18, 1989

For DEDAR CHEMICAL CORPORATION P.O. BOX 2749 WEST HELENA AR 72390

Job DEDAR CHEMICAL CORPORATION - TOC & TOH ANALYSIS ON MONITORING WELLS

Sample From AS LISTED BELOW

TRANSPORTED BY SORRELLS RESEARCH.

LABORATORY NO.	SAMPLE I.D.	DATE/TIME	TOH UG/L	TOC MG/L
E202.001 FIELD R	MW 1 EPLICATES	10-17 -09 10-17 -09	783 765	4.59
E202.002	MW 2	10-17-89	37.9	2.06 + .06
E202.003	MW 3	10-17-89	6570	38.4 ← .3
E202.004	MW 4	10-17-89	1840	10.1 ← .05.
E202.005	MW 6	10-17-89	81.8	3.64 +08
E202.006	MW 6A	10-17-87	201	2.31 + .05
E202.007	MW 68	10-17-89	39100	85.95
E202.008	MW 6C	10-17-89	50800	78.7 ← 3.6
E202.009	MW 7	10-17-89	602	7.5 +07
E202.010	FIELD BLANK	10-17-89	23	1.23 + .02

ANALYSIS BY:

K. E. SORRELLS/CECIL SORRELLS

SAMPLE PRESERVATION AND LABORATORY ANALYSIS COMDUCTED ACCORDING TO EPA 40 CFR 136. \$TEST/ANALYSIS/TIME/CGEFF. VAR. \$

QA PLAN FILED WITH A. D. P. C. & E. INCLUDES 10 % REPLICATION & 10% RECOVERY STUDIES BY RANDOM SELECTION. CALIB. RECORDS
MAINTAINED.
TOC/CAS/10-24(0830)/.83%*TOH/KES/10-27(0900)/S.D. 12% S.R. 98.6%

Copies to

2-ABOVE; ATTN: MR. JOE PORTER

AS South ms

Laboratory No. 5202 001 - 010 PERS THE

P. 88 of 110 Facility Name: Cedas Chemical EPA Id Number: RD 990660649

LAND DISPOSAL RESTRICTION CHECKLIST FOR FY 1989

Form A - Restricted Waste Determination

Note	: This form must be completed during all RCRA Compliance Inspections (CEIs). Additional forms (B through F depending on types of wastes generated or handled.						
Section I. Wastes restricted on November 7, 1986 (F-solvents and Dioxins) Check each box that applies (see Appendix A):							
	F002	F026 F027 F028					
1 Ap	None of the wastes listed above are handled by the generator. Complete Section II of this form. One or more of the wastes listed above are handled by the generator. Complete Form C - Manifesting Restricted Wastes and Form D - Testing and Management of F-solvents and Dioxins. Applicable only if waste is ignitable.						
Section II. Wastes restricted on July 8, 1987 (California List) Check each box that applies:							
	containing free cyanides at concentration greater than 1000 mg/L. Liquid hazardous wastes or liquids associated with solids or sludges						
	containing one or more of the following concentrations: Arsenic or compounds containing arsenic greater than 500 mg/L; Cadmium or compounds containing cadmium greater than 100 mg/L;						

Page 1 Revision: 1/1989

Form A - Restricted Waste Determination (cont'd)

	-							
		Chronium	or c	ampounds cont	taini	ng chromium q	great	er than 500 mg/L;
		Lead or o	campo	unds contain	ing 1	ead greater t	than !	500 mg/L;
		Mercury o	or œ	mpounds conta	ainin	g mercury gro	eater	than 20 mg/L;
		Nickel or	r com	pounds contai	ining	nickel great	ter ti	han 134 mg/L;
		Selenium	or c	ampounds cont	taini	ng selenium q	great	er than 100 mg/L; or
		Thallium	or c	ampounds cont	taini	ng Thallium o	great	er than 130 mg/L.
0								equal to 2.0.
				ations between				Propries
	-			d hazardous v			-	enated organic 1000 mg/Kg.
	One Com	or more of	ion I f the C -		orm. ed a b Restr	ove are hand icted Wastes	led b	enerator. y the generator. Form E - Testing
Sect	ion :	III. Wastes	res	tricted on A	ugust	8, 1988 (Fi	rst T	hird List)
1. H	ard I	Hammer Wast	tes (see Appendix	B)			
В	. Al:	l others						
	J ,	F006 ¹		KOOl		K004 ¹		K0081
	□ ,	K015		K016		K018		K019
	□ ,	K020		K021 ¹		K0221		K024
	ο,	K025 ¹		K030		K0361		K037

Page 2

Facility Name: _______ Chemical EPA Id Number: _______ 10 990660649 7-16-90

Form A - Restricted Waste Determination (cont'd)

	K044		K045		K046 ¹		K047
	K048 ²		K049 ²		K050 ²		K0512
	K052 ²		K060 ¹		K0611		K062
	K0691		K071		K0831		K0863
	K087		K099		K100 ¹		K1014
	K1024		K103		K104		
3 So so 4 Al As	oft hammered l wastewate , high As w	city subca rs an astew	y, wastewate Extension the stegory, other of nonwasteward raters have be see Appendix	rough r sub ters een s	May, 1990. categories h with less th	ave b	een
	astewaters			-,			
	F006 K022		K004 K025		K008		K021 K046
	K060		K061		K069		K083
	K086		K100		K101		K102
B. A	11 others						
	F007		F008		F 009		F019
	K011		K013		K014		K017
	K031		K035		K036		K 069
	K073		K083		K084		K085
	K086		K101 ¹		K1021		K106

2.

Page 3 Revision: 1/1989

A9108110

Facility Name: Cedar Chemical
EPA Id Number: ARD 990660649
2-16-90

Form A - Restricted Waste Determination (cont'd)

P001	P004		P005	P010
P011	P012		P015	P016
P018	P020		P030	P036
P037	P039		P041	P048
P050	P058		P059	P063
P068	P069		P070	P071
P081	P082		P084	P087
P089	P092		P094	P097
P102	P105		P108	P110
P115	P120		P122	P123
U007	U009		U010	U012
U016	U018		U019	U022
U029	U031		U036	U037
U041	U043		U044	U046
U050	U051		U053	U061
U063	U064		U066	U067
U074	U077		U078	U086
U089	U103		U105	
U115				U108
	U122		U124	U129
U130	U133		U134	U137
U151	U154	_	U155	U157
U158	U159		U171	U177

Page 4 Revision: 1/1989

Facility Name: P-93 of 110
Cedar Chemical
EPA Id Number: RD 990660649

LAND DISPOSAL RESTRICTION CHECKLIST FOR FY 1989

Form B - Treatment, Storage and Disposal

Note: This form should be completed only if the generator or handler stores restricted wastes onsite for greater than 90 days or operates RCRA-regulated treatment or disposal units. Small quantity generators who accumulate restricted wastes for less than 180(270) days are exempt from the following requirements.

_(Generator Only	N/	A
Se	ection I. General facility standards		
1.	Has the facility's waste analysis plan been revised in accordance 264.13(b)(6) or 265.13(b)(6) to reflect requirements under 268.7 ?	Yes _	_ No
2.	Has the facility obtained representative chemical and physical analysis of wastes and residues in accordance to 264.13 or 265.13 ?	Yes _	_ No
	if yes,		
	A. Chemical and physical analyses of F-solvents and Dioxi	ins	
	i. Has testing included analyses for all F-solvent constituents?	Yes _	_ N o
	ii. Were all F-solvent constituents analyzed by employing the Toxicity Characteristic Leaching Procedure (TCLP) ?	Yes _	_ No
	B. Chemical and physical analyses of California List wast	tes	
	i. Were the following analyses conducted on California List wastes:	a	
	a. pH ?	Yes _	_ No
	b. Concentrations of PCBs ?	Yes _	No.
	c. Concentration of Halogenated Organic Compounds	? Yes _	No.
	d. Heavy Metal concentration ?	Yes _	No.
	e. Cyanide concentration ?	Yes _	_ No

Page 1

Form B - Treatment, Storage and Disposal (cont'd)

	C. Chemical and physical analyses of First Third List Wastes	
	i. Has the facility tested wastes with established treatment standards (hard hammer wastes) ?Y	es WA No
	if yes,	
	a. List these wastes and the test procedures used to determine concentrations below:	
3.	Were these analyses conducted onsite or offsite ?	
	A. If offsite, identify lab:	1
4.	Describe the frequency of sampling restricted wastes below:	
	ction II. Storage of Restricted Wastes	
1.	Have restricted wastes exceeding treatment standards been stored?	es No
	if yes,	
	A. Have all containers been clearly marked to identify contents and date(s) entering storage?	es No
	B. Do operating records track location, quantity, and dates that restricted wastes entered and were removed from storage?	es No
	C. Do records agree with container labeling ?	es No
	D. Are restricted wastes stored for less than 1 year ?Y	es No
	E. Have tanks been emptied at least once per year, and do operating records show that volumes of restricted wastes removed from tanks at least equal tank volume?Y	es No

Page 2 Revision: 1/1989

Facility Name: Cedar Chemical
EPA Id Number: ARD 990660649
3-16-90

Form B - Treatment, Storage and Disposal (cont'd)

	F. Have restricted wastes been stored for more than one year?	Yes N	<u>/</u> 4 No
	i. If yes, can the owner/operator demonstrate that the purpose of such storage has been solely conducted for accumulating sufficient quantities of restricted wastes to facilitate proper recovery, treatment, or disposal?	Yes _	_ No
Sec	tion III. Storage or treatment in surface impoundments		
1.	Have restricted wastes exceeding treatment standards been placed in surface impoundments ?	Yes _	_ No
	A. If yes, have these wastes and their residues been removed at least annually ?	Yes _	_ No
	B. If no, skip the remainder of this section.		
2.	Have these wastes been placed for treatment ?	Yes _	_ No
	A. If yes, describe treatments processes below:		
3.	Is the only recognizable "treatment" occurring in the impoundment either evaporation, dilution, or both ?	Yes _	_ No
4.	Did the facility submit a certification of compliance with minimum technology and groundwater monitoring requirements and the waste analysis plan to the Agency?		No.
5.	Have minimum technology requirements been met ?	Yes _	No
	A. If no, have waivers been granted for each restricted waste management unit ?	Yes _	No.
6.	Have all 264/265 Subpart F groundwater monitoring requirements been met ?	Yes _	No

Page 3 Revision: 1/1989

P-96 of 110 Cedar Chemical ARD 990660649 7-16-90 Facility Name: EPA Id Number:

Form B - Treatment, Storage and Disposal (cont'd)

7.	Have representative samples of sludge and supernatant from applicable surface impoundments been tested adequately and in accordance with sampling frequency and analysis specified in the waste analysis plan?	_ Yes M	/A No
	A. Are test results maintained in the operating record ?	Yes _	_ No
	B. Did hazardous waste residues (i.e. sludge or liquid) exceed treatment standards as specified in 268.41?	_ Yes _	_ No
	C. Provide the frequency of analyses conducted on treatment residues below:		
	D. Do operating records adequately document results of waste analyses performed in accordance with 268.41?	_ Yes _	_ No
8.	Has supernatant been determined to exceed treatment standards?	_ Yes _	_ No
	A. If yes, is annual throughput greater than surface impoundment volume ?	_ Yes _	_ No
9.	If residues were removed annually, have adequate precautions been taken to protect liners and do records indicate that inspections of liner integrity are performed?	_ Yes _	_ No
10	. When removed, were solvent wastes managed subsequently in another surface impoundment ?	_ Yes _	_ No
11	. When removed, were wastes treated prior to disposal ?	_ Yes _	_ No
	A. If yes, are waste residues treated onsite or offsite?		
	B. Describe management method below:		

Page 4 Revision: 1/1989

p. 9708 110

Facility Name Coda/ Chemical
EPA Id Number: ARD 990660649
3-16-90

Form B - Treatment, Storage and Disposal (cont'd)

Section IV. RCRA-regulated Treatment (not including surface impoundments

	Did the facility operate treatment facilities for restricted wastes? If no, skip the rest of Section IV. Describe processes for each restricted waste treated onsite:	_ Yes N	A No
3.	Does the facility treat soft hammer wastes ?	_ Yes _	No
	If yes,		- 3
	A. Is treatment occurring as described in the facility's certification/demonstration?	_ Yes _	No.
	B. Did the treatment facility certify all soft hammer waste as per the facility's demonstration and maintain copies of all certifications?	_ Yes _	No.
	C. Did the facility send a copy of the demonstration and certification to the receiving treatment, recovery, or storage facility?	_ Yes _	No
4.	Does the treatment facility test the treatment residuals in accordance with an acceptible waste analysis plan?	_ Yes _	No.
5.	Do treatment residuals exceed treatment standards?	_ Yes _	No
	If yes,		PA.
	A. Describe processes used to handle those residuals ?		1
	B. Describe the frequency of testing of treatment residuals below:		
6.	Was dilution used as a substitute for treatment?	_ Yes _	No No

Page 5

Form B - Treatment, Storage and Disposal (cont'd)

7.	Are certifications and results of waste analyses kept in the operating record?	_ Yes	N/A No
If di	any treatment residuals were shipped offsite for further tre- sposal, complete Form C - Manifesting Restricted Wastes.	atment	OT .
Se	ction V. Land Disposal		
1.	Were restricted wastes placed in land disposal units (i.e. surface impoundments, waste piles, wells, land treatment units, salt domes/beds, mines/caves, concrete vaults, or bunkers) for other than treatment purposes?	_ Yes	No
2.	Did the facility have appropriate notices or certifications from generators or treatment facilities in its operating record [268.7(a-b)]?	_ Yes	No
3.	Did the facility obtain waste analyses of restricted wastes to determine if such wastes were in compliance with applicable treatment standards [268.7(c)]?	_ Yes	No
4.	Were restricted wastes exceeding the applicable treatment standards or prohibition levels placed in land disposal units excluding national capacity variances?	_ Yes	No
	If yes,		
	A. Did the facility have an approved waiver based on "no migration" petition, approved case-by-case, capacity extension, or treatment standard variance?	_ Yes	No
5.	Were restricted wastes, subject to national or case-by- case capacity variances or extensions, disposed?	_ Yes	No
	If yes,		30
	A. Were these wastes disposed of in a hazardous waste management unit that meets minimum technology requirements?	Yes	No
6.	Are adequate records of disposal maintained?	Yes	No

Page 6

p. 99 00 110

Facility Name: Pedar Chemical
ARD 99066 0649
2-16-90

Form B - Treatment, Storage and Disposal (cont'd)

/.	extensions, or no migration petitions were disposed, does the facility have notices and records of disposal?	Yes N	A No
8.	If the facility has a case-by-case extension, is there data available to verify that the facility is making progress as described in progress reports?	Yes _	_ No
9.	If the facility is disposing of a soft hammer waste, are notices or certifications maintained onsite?	Yes _	_ No
	If yes,		
	A. Could any of these wastes be classified as California List wastes ?	Yes _	_ No
	B. Did the facility seek to verify whether these wastes are subject to all restrictions?	Yes	No

Page 7 Revision: 1/1989

Inspector's Initials: DH

P100 0P 110

Facility Name: Cedar Chemical
EPA Id Number: ARD 990660649
3-16-90

LAND DISPOSAL RESTRICTION CHECKLIST FOR FY 1989

Form C - Manifesting Restricted Wastes

Note: This form should be completed only if the generator or handler ships restricted waste offsite for treatment or disposal. The following requirements may also apply to treatment facilities (including incinerators) which ship residues, still bottoms, or ash offsite for additional treatment or disposal.

	for additional deadlest of disposar.		
1.	If restricted wastes which <u>exceed</u> treatment standards, and are not subject to case-by-case extensions, "no migration" exemption, or nationwide variance, did the generator or handler provide the following information along with each hazardous waste manifest during shipment:		
	A. Manifest document number ?		No
	B. EPA waste identification code ?	Yes	No
	C. Treatment standards for each restricted waste ?	Yes _	No
	D. Waste analysis data (if available) ?	Yes	No
	E. All applicable restrictions ?	Yes .	No
No	tice: Restricted wastes which exceed treatment standards ma for treatment (including incineration). Such wastes a from land disposal, unless there is a variance or ext applicable to the waste.	re prohib	
2.	Identify all offsite treatment facilities accepting wastes exceeding treatment standards: Empak, Inc Deer Park TX Gibraltor Chamical - Winesa TX Rollins Environmental - Plaguemine LA		
3.	If restricted wastes <u>do not exceed</u> treatment standards, are subject to case-by-case extension, have a "no migratio exemption, or a nationwide variance, did the generator or handler provide the following information along with each hazardous waste manifest during shipment:	n"	
	A. Manifest document number ?	Yes	N/A No

Page 1

P. 101 0 9 110

Facility Name: Coda Chemical
EPA Id Number: ARD 990660649

1-16-90

Form C - Manifesting Restricted Wastes (cont'd)

	B. EPA waste identification code ?	Yes N	14 No
,	C. Treatment standards for each restricted waste?	Yes _	_ No
1	D. Waste analysis data (if available) ?	Yes _	_ No
	E. All applicable restrictions ?	Yes _	_ No
	F. Date the wastes are subject to restrictions ?	Yes _	_ No
	G. The following certification ?	Yes _	_ No
Not	familiar with the waste through analysis and testing of knowledge of the waste to support this certification the complies with the treatment standards specified in 40 (Subpart D. I believe that the information I submitted a accurate and complete. I am aware that there are significant for submitting a false certification, including the pos- imprisonment. ice: The above certification statement must be signed by a representative of the facility.	nat the wast IFR Part 268 is true, ficant penal ssibility of	ties
	Identify all offsite treatment or disposal facilities		
	accepting wastes below treatment standards:	N/A	1
		Y	
6.	If waste is subject to a nationwide variance (e.g. solvent-water mixtures less than 1%), extension or petition has the facility provided notice to disposers that waste is exempt from land disposal restrictions? Does the generator or handler keep records of all notifications or certifications for waste sent to offsite facilities after August 16, 1988?	Yes N	

Page 2 Revision: 1/1989

Inspector's Initials: DH

Facility Name: Cedar Chemical
EPA Id Number ARD 990660649
2-16-90

Yes No

LAND DISPOSAL RESTRICTION CHECKLIST FOR FY 1989


Form D - Testing and Management of F-solvents and Dioxins

None		
 Has the facility correctly determined the appropriate treatability group [268.41] for F-solvents generated or handled onsite (see Appendix A) ? Has the facility determined whether F-solvent wastes exceed treatment standards based on the following: 	_Yes N	/A No
A. Knowledge of process ?	Yes _	_ No
i. If facility employs knowledge of process, note adequacies or inadequacies in their methods below:		
B. Toxicity Characteristic Leaching Process (TCLP) ? i. If yes, provide the following information:	Yes _	_ No
a. Last test date:	1	
b. Frequency of testing:		
c. Indicate any problems with testing procedure below:		
ii. Attach test results to report.		
iii. Were wastes tested using TCLP when processes or wastestreams changed ?	Yes _	_ No
<pre>iv. Was testing done prior to dilution or solidification ?</pre>	Yes _	_ No
C. Other (specify):		100

Page 1

Revision: 1/1989

standards upon generation [268.7(a)(2)]?



Form D - Testing and Management of F-solvents and Dioxins (cont'd)

4.	Did the facility dilute the waste or treatment residuals as a substitute for adequate treatment [268.3] ?	Yes NA No	
5.	Were treatment residuals generated from 264/265 RCRA-exempt units or processes ?	Yes _	No.
	If yes,		
	A. List the type(s) of treatment and unit(s) below:		
	Note: If the residuals from a RCRA-exempt treatment unit treatment standards, the owner/operator is consid- generator of restricted waste. The inspector shoul whether the generator requirements, particularly identification requirements, have been met for the residuals.	ered a ld determin waste	è
6.	Have F-solvents or dioxin wastes been stored for greater than 90 days ?	Yes _	_ No
	If yes,		
	A. Is facility operating under interim status or final permit ?	Yes _	_ No
TF	the answer was was for either 6 or 60 complete from R - T	matmont	A-14

If the answer was yes for either 6 or 6A, complete Form B - Treatment, Storage and Disposal.

Page 2

Revision: 1/1989

Inspector's Initials: PH

Facility Name: Cedar Chemical
EPA Id Number ARD 39066 0649
2-16-90

LAND DISPOSAL RESTRICTION CHECKLIST FOR FY 1989

Form E - Testing and Management of California List Wastes

Note: This form should be completed only if the facility generates or handles California List wastes at the concentrations listed in Form A - Restricted Waste Determination.

_			
1.	wast	the facility conducted any testing of restricted es to determine whether the concentrations qualify as California Wastes ?	Yes No
	If n	ο,	
	wast	the facility retained records documenting that the e is not restricted under the California List by cledge of process ?	Yes NANo
2.	as d	the Paint Filter Liquids Test (PFLT) been performed escribed by SW-846 to determine whether California wastes (except halogenated organic compounds) are iquid form?	Yes No
3.		rastes have been determined to be in liquid form, these wastes solidified using an absorbent?	Yes No
	A. I	f yes, note type of absorbent used:	
	в. 1	indicate which wastes were solidified by aborbent below	7:
	Chec	k each box that applies:	
	П	Liquid hazardous wastes or liquids associated with so containing free cyanides at concentration greater that	
		Liquid hazardous wastes or liquids associated with so containing one or more of the following concentration	
		Arsenic or compounds containing arsenic greater	than 500 mg/L;
		Cadmium or compounds containing cadmium greater	than 100 mg/L;
		Chromium or compounds containing chromium greate	er than 500 mg/L;
		Lead or compounds containing lead greater than !	500 mg/L;

Page 1

P-10508 110

Facility Name: Solar Chemical EPA Id Number: ARD 990660649 7-16-90

	Form E - Testing and Management of California List Wastes (cont'd)
	Mercury or compounds containing mercury greater than 20 mg/L;
	Nickel or compounds containing nickel greater than 134 mg/L;
	Selenium or compounds containing selenium greater than 100 mg/L; or
	Thallium or compounds containing Thallium greater than 130 mg/L.
	Liquid hazardous wastes exhibiting a pH less than or equal to 2.0. Liquid hazardous wastes that also contain polychlorinated biphenols
15	(PCBs) at concentrations between 50 to 500 mg/L.
L	Liquid or nonliquid hazardous waste containing halogenated organic compounds at concentrations greater than or equal to 1000 mg/Kg.
e p	as the facility determined whether concentration evels of the analytes (not extracts or filtrates) qual or exceed prohibition levels or whether the H of the wastes is less than or equal to 2.0 based in:
A	. Knowledge of process ?Yes No
	i. If facility employs knowledge of process, note adequacies or inadequacies in their methods below: Knowledge of process is adequate
В	3. Testing ?
В	i. Did the facility determine if concentration levels in PFIT extracts exceed cyanide or metal treatment standards? Yes No
В	i. Did the facility determine if concentration levels in PFLT extracts exceed cyanide or metal treatment standards? Yes No ii. List the test methods used: Method 412C Titvimetric Method, Standard Methods of Water
В	i. Did the facility determine if concentration levels in PFIT extracts exceed cyanide or metal treatment standards? Yes No ii. List the test methods used: Method 412C Titvimetric Method, Shudad Methods of Water and Wastewater Analysis 15th Edition iii. List constituents and respective concentration levels for wastes found to exceed prohibition levels below:
В	i. Did the facility determine if concentration levels in PFIT extracts exceed cyanide or metal treatment standards? Yes No ii. List the test methods used: Method 412C Titvimetric Method, Standard Methods of Water and Wastewater Analysis 15th Edition iii. List constituents and respective concentration levels for wastes found to exceed prohibition

Page 2 Revision: 1/1989

P 10600 110

Facility Name: eda Chemical
EPA Id Number: ARD 99066 0649 ARD 99066,0649

Form E - Testing and Management of California List Wastes (cont'd)

5. Has the facility treated waste onsite or offsite: onsite (elementary neutralization is an exempt process)

A. If onsite, complete Form B - Treatment, Storage, and Disposal.

B. If offsite, complete Form C - Manifesting Restricted Wastes.

Page 3

Revision: 1/1989

Inspector's Initials: DH

Facility Name: Codar Chemical
EPA Id Number: ARD 990660649
2-16-90

LAND DISPOSAL RESTRICTION CHECKLIST FOR FY 1989

Form F - Testing and Management of "First Third" Wastes

Note: This form should be completed only if the facility generates or handles wastes restricted under the "First Third" list (August 17, 1988).

_		N/	<u>A</u>
ı.	Hard Hammer Provisions	4	
1.	Has the facility correctly determined the appropriate treatability group for hard hammer wastes generated or handled onsite ?	_Yes _	No.
2.	Has the facility determined whether hard hammer wastes exceed treatment standards based on the following:		
	A. Knowledge of process ?	_ Yes _	No.
	i. If facility employs knowledge of process, note adequacies or inadequacies in their methods below:		
	B. Toxicity Characteristic Leaching Process (TCLP) ? i. If yes, provide the following information:	Yes _	_ No
	a. Last test date:		
	b. Frequency of testing:		
	c. Indicate any problems with testing procedure below:		
	ii. Attach test results to report.		
	iii. Were wastes tested using TCLP when processes or wastestreams changed ?	_ Yes _	_ No
	iv. Was testing done prior to dilution or solidification?	Yes	No

Page 1

p- 108 of 110

Facility Name: Coda Chemical
EPA Id Number: ARD 990660649
2-16-90

Form F - Testing and Management of "First Third" Wastes

	C. Other (specify):	N/	A
3.	Did the hard hammer wastes exceed their applicable treatment standards upon generation [268.7(a)(2)]?	Yes _	_ No
4.	Is there any reason to believe that the facility may have diluted these wastes to change the applicable treatment standard (based on review if process operation, pipe routing, point of sampling, etc.) ?	Yes	_ No
5.	Did the facility ascertain whether hard hammer wastes were appropriately assigned wastewater on non-wastewater designations (nonwastewaters are > 1% TOC and > 1% suspended solids) ?	Yes _	_ No
6.	Does the facility handle K061 wastes ?	Yes	_ No
	If yes,		
	A. Were nonwastewaters appropriately classified in either the high or low zinc subcategories (> 15% Zn) ?	Yes _	_ No
7.	Does the facility handle K101 or K102 wastes ?	Yes _	_ No
	If yes,		1
	A. Were nonwastewaters appropriately classified in either the high or low arsenic subcategories ?	Yes _	_ No
8.	Have hard hammer wastes been stored for greater than 90 days ?	Yes	_ No
	If yes,		
	A. is facility operating under interim status or final permit ?	Yes _	_ No

If the answer was yes for either 8 or 8A, complete Form B - Treatment, Storage and Disposal.

Page 2

p-109 08 110

Facility Name Codal Chemical EPA Id Number. 1200 990660649

Form F - Testing and Management of "First Third" Wastes

II. Soft Hammer Provisions

1.	Has the facility submitted demonstrations and certifications for each soft hammer waste destined for disposal in landfills or surface impoundments to the Regional Administrator prior to the shipment of the waste to the disposal facility?	Yes	s <u>MA</u> No
	If yes,		
	i. Has the facility retained a copy of each demonstration onsite ?	Yes	s No
	ii. Has the facility retained copies of all certifications sent to the disposal facility?	Yes	s No
2.	Has the facility sent copies and kept copies of the following information with each shipment of soft hammer wastes:		
	A. Manifest document number ?	Yes	s No
	B. EPA waste identification code ?	Yes	s No
	C. All applicable restrictions ?	Yes	s No
	D. Waste analysis data (if available) ?	Yes	s No
	E. Applicable certifications ?	Yes	s No
3.	Do facility records indicate that soft hammer wastes are destined for disposal in landfills or surface impoundments?	Yes	s No
	If yes,		
	A. List the name of the waste(s) destined for disposal:		
	B. Name the facility where the waste is destined:		
			-

Page 3 Revision: 1/1989

P-110 08 110

Facility Name: Cedar Chemical
EPA Id Number: ARD 990660649

Form F - Testing and Management of "First Third" Wastes

4. Have soft hammer wastes been stored for greater than 90 days?

A. If yes, is facility operating under interim status or final permit?

Yes ___ No

If the answer was yes for either 4 or 4A, complete Form B - Treatment, Storage and Disposal.

Page 4 Revision: 1/1989

Inspector's Initials: DH

STATE OF ARKANSAS
DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583
LITTLE ROCK, ARKANSAS 72209
PHONE: (501) 562-7444

May 9, 1990

CSN: 540060 permit No.

Media: Air, Water. Sail Sandous, Superfund, UST
Sort: Permit, Compliance

Mr. Joe Porter Cedar Chemical Corporation P.O. Box 2749 West Helena, AR 72390

RE: Cedar Chemical Corporation Site Characterization

Dear Mr. Porter:

The Department has reviewed the draft documents concerning the site characterization and drum disposal area delineation work plan, dated April 1990, for Cedar Chemical Corporation, located in West Helena, Arkansas.

Enclosed are the Department's comments to the draft work plan. Cedar Chemical Corporation should be aware that an approval for remedial activities short of a facility wide investigation will not be approved by the Department.

If you have any questions or concerns, please feel free to call.

Sincerely,

Mike Bates

Chief

Hazardous Waste Division

DW:LTR132

ENCLOSURE

cc: Ken Bown, Manager, Technical Branch, HWD Derick Warrick, Engineer II, Tech Branch, HWD David Hartley, Geologist, Hazardous Waste Division

Cedar Chemical Corporation

SITE CHARACTERIZATION AND DRUM DISPOSAL AREA DELINEATION WORK PLAN

April 1990

Deficiency List

- The laboratory QA/QC plan as referenced in Appendix B is not included.
- Cedar Chemical Corporation proposes to test for only DNBP in this particular 1.2 acre area. Parameters for soil testing should be expanded to include a range of constituents which were historically manufactured at the facility, since any number of them could possibly be buried.
- 3. The plan states a clean-up level of 80 ppm DNBP based on a health based standard. This level may not be protective of the groundwater/surface water. The Department can only approve clean-up levels which are protective of human health and the environment, hence, eco-systems must also be considered in respect to clean-up levels. Clean-up levels should include other parameters than only DNBP.
- A leachability study of the contaminated soil should be done to determine an acceptable concentration to be left-in-place.
- 5. Cedar Chemical Corporation has proposed to composite soil boring samples at five (5) foot intervals. Soil borings taken in contaminated zones should not be composited.
- 6. Based on the information the Department has, DNBP is extremely toxic and has a probable oral lethal dose of 5-50 mg/kg (7 drops to 1 teaspoon) for a 70 kg person. Level D should not be implemented on any site with respiratory or skin hazards. A minimum of level C should be worn by all personnel who will be in direct contact with the drums during excavation or sampling due to the toxicity of DNBP.
- 7. The health and Safety Plan should recognize the hazards associated with trenching. Any workers working in a trench should be in at least Level C protection.
- 8. The sampling and analysis plan does not incorporate a plan for sampling the bottom of excavation for the assurance of complete removal of contaminated soils.

CSN: 54-000 PERMIT NO.

MEDIA: AIR, WATER, SOLID, HAZARDOUS

SORT: PERMIT, COMPLIANCE

FEES:

ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TO : Mike Bates, Chief, Hazardous Waste Division

THROUGH : Jim Rigg, Geologist III, Hazardous Waste Division

FROM : David Hartley, Geologist II, Hazardous Waste Division Dr

DATE : 7-MAY-1990

SUBJECT: April 27, 1990 Draft document submittal, Cedar Chemical Corp

I have reviewed the draft documents concerning site characterization and drum removal and have the following comments.

- 1. The magnetometer/gradiometer survey appears to be adequate to locate buried metal drums. The proposed 10 foot station spacing should be sufficient to locate magnetic anomalies and delineate areas of probability that drums would be buried at, that is, assuming that these are metal drums.
- 2. Cedar has proposed to do the magnetometer/gradiometer survey in only the 1.2 acre site of their planned expansion. I have discussed this with Joe Porter and have recommended to him that, at a minimum, the area they are building their new offices should also be included. He did not seem to have any objections. The soil boring plan should also include this area as well. I do not have any objections to Cedar starting the magnetometer survey if they include the office complex site. The remainder of the site will have to be addressed in their final report.
- The sampling and analysis plan appears to be deficient in the following areas.
 - a. The laboratory QA/QC plan has apparently been left out of the submittal. A detailed description of the QA/QC plan is referenced to be in Appendix B, which is not in the plan.
 - b. Cedar is proposing to do their own analysis and have only proposed to test for DNBP. Parameters should be expanded because historically the plan has manufactured numerous chemicals and any number of them could be buried.
 - c. Clean-up level has been proposed at 80 ppm DNBP. I have not confirmed this to be an acceptable level. DNBP is extremely toxic and, according to the CAMEO printout I have, has a probable oral lethal dose of 5-50 mg/kg (7 drops to 1 teaspoon) for a 70 kg. person. DNBP is a "first third" waste but currently does not have an established treatment standard under land ban.

Clean-up level should include other parameters than only DNBP.

- d. Cedar has proposed to composite soil borings at 5 foot intervals. If we require expanding the analytical parameters, composite samples may not be adequate for all types of samples such as volatiles.
- e. The health and safety plan calls for modified level D protection for all workers including sampling and drum removal based on air monitoring. Modified level D does not include respiratory protection. Level D should not be worn on any site with respiratory or skin hazards. Level C should be worn by all personnel who will be in direct contact with the drums during excavation or sampling due to the toxicity of DNBP and due to the fact that Cedar Chemical does not know what is buried there.
- f. The health and safety plan should recognize hazardous associated with trenching. Any workers working in the trench definitely should be in at least Level C protection.

DH/ckh:MEM323

cc: Derrick Warrick

CHARLES W. METCALF, 1840-1924 WILLIAM P. METCALF, 1872-1940 JOHN W. APPERSON, 1896-1985

CHARLES METCALE CRUMP JERRE G. DUZANE JOHN B. MAXWELL, JR ALLEN T. MALONE PHILIP G. KAMINSKY ROBERT L. DINKELSPIEL MICHAEL E. HEWGLEY JAMES F. RUSSELL JOHN L. RYDER THOMAS R. BUCKNER TONI CAMPBELL PARKER MELODY W. OLIVER WILLIAM B. MASON, JR. STEVEN N. DOUGLASS

SAMUEL RUBENSTEIN OF COUNSEL

RANDY S. GARDNER

LAW OFFICES APPERSON, CRUMP, DUZANE & MAXWELL

SUITE 2110


ONE COMMERCE SQUARE

MEMPHIS, TENNESSEE 38103

901/525-1711

TELECOPY 901/521-0789

April 30, 1990



EAST OFFICE

SUITE 100 KIRBY CENTRE 1755 KIRBY PARKWAY MEMPHIS, TENNESSEE 38119 901/756-6300 TELECOPY 901/757-1296

EXPRESS MAIL

CSN: 5.4 206 SPERMIT NO.

SORT: PERMIT, COMPLIANCE

FEES:

MEDIA: AIR, WATER, SOLID, HAZARDOUS

Mr. David Hartley Geologist Hazardous Waste Division Arkansas Department of Pollution Control & Ecology 8001 National Drive Little Rock, Arkansas 72209

Cedar Chemical Corporation

West Helena Plant

Dear David:

Enclosed is EPA's "Health-Based Criteria For Systemic Toxicants," which is included as Table 8-7 in the "Interim Final RCRA Facility Investigation (RFI) Guidance" document, Volume I. EPA's Region IV has confirmed that the clean-up standard for DNBP (dinoseb) in soil (8E+01MG/KG) means 80 parts per million. is the basis for the clean-up level indicated in Woodward-Clyde's draft work plan for remediation of any contaminated soil in the vicinity of the buried DNBP drums which were recently discovered at the West Helena Plant.

We appreciate your spending time with Joe Porter and me last Friday. As we discussed, Cedar would like to proceed with the investigation phase outlined in the Woodward-Clyde document this week, so we would appreciate input from the Department as soon as possible.

This also confirms that Cedar will be prepared to begin discussing with the Department a voluntary, expanded RFI at the West Helena Plant following submission of the groundwater monitoring report required by the 1986 Consent Administrative Order.

Finally, this also confirms that, per my previous understanding with Karen Williams, Joe Porter and I should both be notified prior to the formal rejection of the West Helena Plant's previous RCRA Part B Application. While the company has APPERSON, CRUMP, DUZANE & MAXWELL Mr. David Hartley April 30, 1990 Page Two indicated its desire to withdraw the application and, as I understand it, has been removed from the TSD Regulatory Scheme under RCRA since the clean closure of its waste storage areas, it is possible that Cedar may decide in the future to amend the application to provide for an on-site incinerator. Sincerely yours, Allen T. Malone ATM: jw Enclosure cc: Mr. Joe Porter

Table 8-7. Health-Based Criteria for Systemic Toxicants1

Constituent	CAS No.	(mg/kg/day)	Soil (mg/kg)	Water (µg/l)	Air (ug/m³)
Acetone	67-64-1	1E-01	8E + 03	4E + 03	
Acetonitrile	75-05-8	6E-03	5E+02	2E + 02	
Acetoprenone	98-86-2	18-01	8E + 03	4E + 03	
Aldicarb	116-06-3	1E-03	8E+01	4E + 01	5E + 00
Aldrin	309-00-2	3E-05	2E + 00	1E+00	-
Allyl alconol	107-18-6	5E-03	4E + 02	2E + 02	
Aluminum phosphide	20859-73-8	4E-04	3E + 01	1E+01	
Antimony	7440-36-0	4E-04	3E + 01	1E+01	
Barium	7440-39-3	5E-02	4E+03	See MCL	
Barium cyanide	542-62-1	7E-02	6E + 03	2E+03	
Benzidine	92-87-5	2E-03	2E + 02	7E + 01	**
Beryllium	7440-41-7	5E-03	4E+02	2E + 02	
Bis(2-ethylhexyl) phthalate	117-81-7	2E- 02	2E+03	7E + 02	-
Bromodichloromethane	75-27-4	2E-02	2E+03	7E + 02	7E + 01
Bromoform	75-25-2	2E-02	2E+03	7E + 02	-
Bromomethane	74-83-9	4E-04	3E+01	1E+01	-
Calcium cyanide	592-01-8	4E-02	3E+03	1E+03	*
Carbon disulfide	75-15-0	1E-01	8E+03	4E + 03	**
Carbon tetrachloride	56-23-5	7E-04	6E+01	See MCL	
Chlordane	57-74-9	5E-05	4E+00	2E + 00	-
Chiorine cyanide	506-77-4	5E-02	4E+03	2E + 03	
Cnlorobenzene	108-90-7	3E-02	2E + 03	1E+03	
1-Chloro-2.3 epoxypropane (Epichlorohydrin)	106-89-8	2E-03	2E+02	7E + 01	*
Chloroform	67-66-3	1E-02	8E + 02	4E + 02	
Chromium (III)	16065-83-1	1E + 00	8E+04	4E + 04	
Chromium (VI)	7440-47-3	5E-03	4E + 02	See MCL	**
Copper cyanide	544-92-3	5E-03	4E + 02	2E + 02	-
Cresols	1319-77-3	5E-02	4E + 03	2E + 03	-
Crotonaldehyde	123-73-9	18-02	8E + 02	4E + 02	
Cyanide		2E-02	2E+03	7E + 02	
Cyanogen	460-19-5	4E-02	3E + 03	1E+03	
2.4-D	94-75-7	1E-02	8E + 02	See MCL	
160	50-29-3	5E-04	4E + 01	2E + 01	
Di-n-butylphthalate	84-74-2	1E-01	8E + 03	4E + 0	-

Note: These criteria are subject to change and will be confirmed by the regulatory agency prior to use.

Table 8-7. (continued)1

10
11

Constituent	CAS No.	RfD2 (mg/kg/day)	Soil (mg/kg)	Water (µg/l)	Air (µg/m³)
Dichiorodifluoro- methane	75-71-8	2E-01	2E + 04	7E+03	1
1 1-Dichioroethylene	75-35-4	9E-03	7E + 02	See MCL	
Dichloromethane (Methylene chloride)	75-09-2	6E-02	5E + 03	2E + 03	**
2 4 - Dichlorophenol	120-83-2	3E-03	2E + 02	1E+02	1E+01
1 3-Dichloropropene	26952-23-8	3E-04	2E + 01	1E+01	-
Dieldrin	60-57-1	5E-05	4E + 00	2E + 00	
Diethyl ohthalate	84-66-2	8E-01	6E + 04	3E + 04	2 1 2
Dimethoate -	60-51-5	2E-02	2E + 03	7E + 02	-
2 4-Dinitrophenol	51-28-5	2E-03	2E + 02	7E+01	7E+00
Dinoseb	88-85-7	1E-03	8E + 01	4E + 01	
Dipnenylamine	127-39-4	3E-02	2E + 03	1E+03	101
Disu foton	298-04-4	4E-05	3E + 00	1E+00	-
Endosulfan	115-29-7	5E-05	4E + 00	2E+00	2E-01
Endothal	145-73-3	2E-02	2E + 03	7E + 02	-
Endrin	72-20-8	3E-04	2E + 01	See MCL	1E+00
Ethy benzene	100-41-4	1E-01	8E + 03	4E + 03	-
Heptachior	76-44-8	5E-04	4E + 01	2E+01	-
Heptachior epoxide	1024-57-8	1E-05	8E-01	4E-01	-
Hexachioroputa- diene	87-68-3	2E-03	2E + 02	7E + 01	- R-
Hexachiorocyclo- pentagiene	77-47-4	7E-03	6E + 02	2E+02	
nexachioroethane	67-72-1	1E-03	8E + 01	4E+01	
Hydrogen cyanide	74-90-8	2E-02	2E + 03	7E+02	-
Hydrogen sulfide	7783-06-4	3E-03	2E + 02	1E+02	
sobuty alcohol	78-83-1	3E-01	2E + 04	1E+04	1E+03
sapharone	78-59-1	2E-01	26+04	7E+03	1.1
chlorocyclohexane)	58-89-9	38-04	2E + 01	See MCL	
Maleic hydrazide	108-31-6	5E-01	4E + 04	2E+04	-
Methacrylonitrile	126-98-7	1E-04	8E + 00	4E+00	
Metnamyi	16752-77-5	3E-02	2E + 03	16+03	-
Methyl ethyl ketone	78-93-3	5E-02	4E + 03	26 + 03	
Metnylisobutyl- ketone	108-10-01	5E-02	4E + 03	2E + 03	-

Note: These criteria are subject to change and will be confirmed by the regulatory agency prior to use.

Table 8-7. (continued)1

Constituent	CAS No.	RfD2 (mg/kg/day)	Soil (mg/kg)	Water (µg/l)	Air (ug/m³)
2.3.4.6- Tetrachlorophenol	58-90-2	3E-02	2E + 03	1E+03	1E + 02
Tetraethyliead	78-00-2	1E-07	8E-03	4E-03	4E-04
Thailicoxide	1314-32-5	46-04	3E + 01	1E+01	
Thailium acetate	563-68-8	5E-04	4E+01	2E + 01	
Thailium carbonate	6533-73-9	4E-04	3E + 01	1E+01	
Thailium chloride	7791-12-0	48-04	3E+01	16+01	-
Thailium nitrate	10102-45-1	5E-04	4E+01	2E+01	
Thailium selenite	12039-52-0	5E-04	4E + 01	2E+01	-
Thailium suifate	10031-59-1	3E-04	2E+01	1E+01	-
Thiram	137-26-8	5E-03	4E + 02	2E + 02	
Toluene	108-88-3	3E-01	2E + 04	1E+04	
1.2.4- Trichlarobenzene	120-82-1	2E-02	2E+03	7E + 02	
1.1.1- Trichloroethane	71-55-6	9€-02	7E+03	See MCL	-
1.1,2- Trichloroethane	79-00-5	2E-01	2E+04	7E+03	
Trichloromono- fluoromethane	75-69-4	3E-01	2E + 04	1E+04	
2.4.5- Trichlorophenol	95-95-4	1E-01	8E + 03	4E + 03	4E + 02
2 4.5-Trichloro- pnenoxy acetic acid (2 4 5-T)	93-76-5	3E-03	2E+02	See MCL	-
1,1,2- Trichloropropane	598-77-6	5E-03	4E + 02	2E + 02	
1.2.3- Trichioropropane	96-18-4	16-03	8E+01	4E + 01	
Vanadium pentoxide	1314-62-1	2E-02	2E+03	7E + 02	*
Warfarin	81-81-2	38-04	2E + 01	1E+01	-
Xylene (total)	1330-20-7	2E+00	2E+05	7E+04	10 mg 12 mg
Zinc cyanide	557-21-1	5E-02	4E + 03	2E+03	
Z nc phosphide	1314-84-7	3E-04	2E + 01	1E+01	

¹ These criteria are subject to change and will be confirmed by the regulatory agency prior to use.

1882

· 秦松州中央公、14世 公、11日南山

² See Table 8-2 for the appropriate intake assumptions used to derive these criteria.

Table 8-7. (continued)1

Constituent	CAS No.	(mg/kg/day)	Soil . (mg/kg)	Water (ug/l)	Air (ug/m³)
Methyl mercury	22967-92-6	3E-04	2E - 01	16+01	
Methyl parath on	298-00-0	3E-04	25 - 01	16 - 01	'E - 00
Vickei	7440-02-0	2E-02	2E - 03	7E - 02	
Nitric oxide	10102-43-9	1E-01	8E + 03	4E + 03	*
Vitropenzene	98-95-3	5E-04	46 + 01	2E + 01	**
Vitrogen dioxide	10102-44-0	1E+00	8E - 04	46 - 94	
Octamethylpyro- phosphoram de	152-16-9	2E-03	2E + 02	7E+01	-
Parathion	56-38-2	36-04	2E + 01	16+01	
Pentachiorobenzene	608-93-5	8E-04	6E + 01	3E + 01	3E + 00
Pentacnioronitro- penzene	82-68-8	3E-03	2E + 02	1E+02	
Pentachiorophenoi	87-86-5	3E-02	2E + 03	1E+03	1E - 02
Perchioroethylene (Tetrachioro- ethylene)	127-18-4	1E-02	8E + 02	4E + 02	
Phenoi	108-95-2	48-02	3E+03	1E+03	
Phenyl mercuric acetate	62-38-4	8E-05	6E + 00	3E + 00	-
Phosphine	7803-51-2	3E-04	2E+01	1E+01	-
Potassium cyanide	151-50-8	5E-02	4E + 03	2E + 03	
Potassium silver cyanide	506-61-6	25-01	2E+04	7E + 03	
Pronamide (Kerb)	23950-58-5	8E-02	6E + 03	3E+03	-
Pyridine	110-86-1	1E-03	8E + 01	4E + 01	
Selenious Acid	7782-49-2	36-03	2E + 02	See MCL	-
Selenourea	630-10-4	5E-03	4E + 02	2E + 02	-
Silver	7440-22-4	3E-03	2E + 02	See MCL	
Silver cyanide	506-64-9	1E-01	8E+03	4E+03	
Silvex (2.4 5-TP)	93-72-1	8E-03	6E + 02	3E + 02	-
Sodium cyanide	143-33-9	4E-02	3E+03	1E+03	-
Strychnine	57-24-9	3E-04	2E + 01	1E+01	-
Styrene	100-42-5	2E-01	2E - 04	7E+03	
1.2,4.5- Tetrachiorobenzene	95-94-3	36-04	2E+01	1E+01	1E + 00

Note: These criteria are subject to change and will be confirmed by the regulatory agency prior to use.

- .-

1 %

. Arr

To Barrier

DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501) 562-7444 FAX: (501) 562-4632

April 24, 1990

Joe Porter Cedar Chemical Corporation P.O. Box 2749 West Helena, AR 72390 CSN. 540068 PERMIT NO.

MEDIA: AIR, WATER, SOLID, HAZARDOUS
SORT: PERMIT, COMPLIANCE
FEES:

Re: SAMPLE ANALYSIS TEST RESULTS FROM FEBRUARY 16, 1990 SAMPLING EVENT

Dear Mr. Porter:

Enclosed is a copy of the department's lab results of samples taken at Cedar Chemical on February 16, 1990. If I can be of further assistance, please contact me.

Sincerely,

David Hartley Geologist II

Hazardous Waste Division

DH/mw:cedar-chem-042490dh

Enc.

23-98 09:06 AM FROM CE. CHEMICAL CORP

MEDIA: AIR, WATER, SOLID, HAZARDOUS SORT: PERMIT, COMPLIANCE FEES:

CEDAR CHEMICAL CORPORATION

P.O. Box 2749, Hwy. 242 S. . West Helena, AR 72390 (501) 572-3701 . Fax No. 501-572-3795

TO: ARKANSAS Dept of Pollation Control & Ecology ATTENTION:

David Hartley

FAX NO: 562-4632

FROM: Jos E. Postero

DATE April 23, 1990

NO. OF PAGES: 3 + COVER

MESSAGE

Per your Request:

October, December, & February Results

04-23-80 09:06 AM FROM CE

CHEMICAL CORP









SORRELLS RESEARCH LABORATORY AND FIELD SERVICES





8002 STANTON ROAD LITTLE ROCK, ARKANSAS 72209 (501) 562-8139

REPORT OF LABORATORY ANALYSIS

Date of Report OVEYBER 20, 1989

Date Received CTOBER 18, 1989

For DEDAR CHEMICAL CORPORATION P.O. BOX 2749 WEST HELENA AR 72390

Job DEDAR CHEMICAL CORPORATION - TOC & TOH ANALYSIS ON MONITORING WELLS

Sample From AS LISTED BELOW

TRANSPORTED BY SORRELLS RESEARCH.

LABORATORY NO.	SAMPLE I.D.	DATE/TIME	TOH UG/L	TOC MG/L	
E202.001 FIELD RE	MW 1 PLICATES	10-17 -89 10-17- 89	783 765	4.59 4.64	
E202.002	MW 2	10-17-89	37.9	2.0606	
E202.003	MW 3	10-17-89	6570	38.4 ← .3	
E202.004	MW 4	10-17-89	1840	10.105	
E202.005	MW 6	10-17-89	81.8	3.6408	
E202.006	MW 6A	10-17-89	201	2.31 +05	
E202.007	MW 6B	10-17-69	39100	85.95	
E202.008	MW 6C	10-17-89	50800	78.7 ← 3.6	
E202.009	MW 7	10-17-69	602	7.5 +07	
E202.010	FIELD BLANK	10-17-89	23	1.23 + .02	

ANALYSIS BY:

K. E. SORRELLS/CECIL SORRELLS

SAMPLE PRESERVATION AND LABORATORY ANALYSIS CONDUCTED ACCORDING TO EPA 40 CFR 136. \$TEST/ANALYSIS/TIME/COEFF. VAR. \$

GA PLAN FILED WITH A. D. P. C. & E. INCLUDES 10 % REPLICATION & 10% RECOVERY STUDIES BY RANDOM SELECTION. CALIB. RECORDS

MAINTAINED.


TOC/CAS/10-24(0830)/.83%\$TOH/KES/10-27(0900)/S.D. 12% S.R. 98.6%


Copies to

2-ABOVE: ATTN: MR. JOE PORTER

Laboratory No. E202.001 - .010 CEDA DKS REVIEWED BY

J. E. Soull m.s.

















L'ABORATORY AND FIELD SERVICES

ST BASHAMBA, MOOR SITTL SOUR MOTHATS SOOR

HILEY MATABLE

SORBELLS BESEARCH

MEST HETEN


PANES-CRUED BY ECLOSETTE HERENACH.


TOP DETAIL OF EATEN COSCUSATION








































五百五五日

B 5

西 哥


IOCICWRYTO-EA(MOCKY-SEXION/KERVIO-ELIMBON) 121 8"8" 68"82 SRIALDIMED ON L'HA LIFED ALLA W. D. E. C. F. E. INCTOSE TO I BESFICHION F TON MECTARDA SIMDIES DI SUNDOM SETECITOR, CHIE REGONDE SPANCE MEERINDIEDH WAD TURINDIUCK HYVISIZ COMDUCIED WEODODING TO ENW 40 CAM 128" TESTVONWELAIR-KOREK A

of spigot



P04/04

FROM CE CHEMICAL CORP

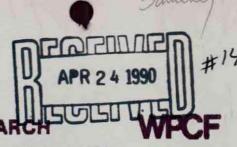



CONSULTANTS

For .



SORRELLS RESEARCH LABORATORY AND FIELD SERVICES

8002 STANTON ROAD LITTLE ROCK, ARKANSAS 72209 (501) 562-8139

REPORT OF _____LABORATE

LABORATORY ANALYSIS

Date of Report: MARCH 5, 1990

Date Received: FEBRUARY 21, 1990

CEDAR CHEMICAL CORPORATION P.O. BOX 2749 WEST HELENA AR 72390

Job _ CEDAR CHEMICAL CORPORATION - TOC & TOH ANALYSIS - MONITORING WELLS

AS LISTED BELOW

SAMPLE	I.D.	DATE/TIME	TOH US/L	TOC MG/L
MW 1		02-16-90	648	5.72 +06
MW 2		02-16-90	20	2.74 +1
MM 3	FIELD	02-16-90 REPLICATE	4370 3360	24.97 +3 24.44 +-2.1
MW 4		02-16-90	1970	12.63 +05
MW 6		02-16-90	53	22.8 +5
MW 6A		02-16-90	62	2.81 +06
MW 4B		02-16-90	44000	19.99 +1
MW 6C		02-16-90	12200	101.8 +52
MW 7		02-16-90	3500	14.03 +1
FIELD BL	ANK	02-16-90	22	2.24 +04
	MW 1 MW 2 MW 3 MW 3 MW 4 MW 6 MW 6 MW 6A MW 6B MW 6C MW 7	MW 2 MW 3 MW 3 FIELD MW 4 MW 6 MW 6A MW 6B MW 6C	MW 1 02-16-90 MW 2 02-16-90 MW 3 FIELD REPLICATE MW 4 02-16-90 MW 6 02-16-90 MW 6A 02-16-90 MW 6B 02-16-90 MW 6C 02-16-90 MW 7 02-16-90	MW 1 02-16-90 648 MW 2 02-16-90 20 MW 3 FIELD REPLICATE 3360 MW 4 02-16-90 1970 MW 6 02-16-90 53 MW 6A 02-16-90 62 MW 6B 02-16-90 44000 MW 6C 02-16-90 12200 MW 7 02-16-90 3500

ANALYSIS BY: K. E. SORRELLS/CECIL SORRELLS
COLLECTED BY DFK FEB 90 / TRANSPORTED BY KEVIN HALL FEB 2

SAMPLE PRESERVATION AND LABORATORY ANALYSIS CONDUCTED ACCORDING TO EPA 40 CFR 136. *TEST/ANALYSIS/TIME/COEFF. VAR. *

REPLAN FILED WITH A. D. P. C. & E. INCLUDES 10 % REPLICATION & 10% RECOVERY STUDIES BY RANDOM SELECTION. CALIB. RECORDS

MAINTAINED.

TDC/CAS/03-01/* TDH/KES/02-22-90/S.D. 13%

Copies to

2-ABOVE; ATTN: MR. JOE PORTER

Laboratory No. E385.001 - .010 CEDA LSM REVIEWED BY FEB.6A.R./FEB.4.I.

ESMINIS M.S.

P03/04



For .



RCV BY: XEROX TELECOPIER 7010 : 4-23-90

SORRELLS RESEARCH LABORATORY AND FIELD SERVICES



8002 STANTON ROAD LITTLE ROCK, ARKANSAS 72209 (501) 562-8139

LABORATORY ANALYSIS

REPORT OF .

DECEMBER 21. 1989

Date of Report:

13. 1989

Date Received: DECEMBER

501 572 3795+

CEDAR CHEMICAL CORPORATION P.O. BOX 2749 WEST HELENA AR 72390

CEDAR CHEMICAL CORPORATION - TOC & TOH ANALYSIS ON MONITORING WELLS Job -

AS LISTED BELOW Sample From.

TRANSPORTED BY SURRELLS RESEARCH.

LABORATORY NO	. SAMPLE I.D.	DATE/TIME	TOH UG/L	TOC MG/L
E492.001	MM T	12-11-89	657	4.96403
E492.002 FIEL	D REPLICATES	12-11-69 12-11-69	65.57112	1.74 + :01 >2A2
E492.003	MW 3	12-11-89	4970	26.2 +3
E492.004	MW 4	12-11-69	1790	9.72 + .1
E49/2.005	MW 6	12-11-89	273	19.34 +2
E492.006	MW 6A	12-11-89	35.3	2.37 +09
E492.007	MW 6B	12-11-89	31500	84.7 + .6
E492.008	MW 6C	12-11-89	44800	74.8 + .9
E492.009	MW 7	12-11-69	979	8.77 +09
E492.010	FIELD BLANK	12-11-69	29	.664 +02
E492.011 B	103191, B103192	12-11-89	< 3	.323 + .03
E492.012	B103194	12-11-89		.25 +02

ANALYSIS BY:

K. E. SORRELLS/CECIL SORRELLS

Remarks SAMPLE PRESERVATION AND LABORATORY ANALYSIS CONDUCTED ACCORDING TO EPA 40 CFR 136. **TEST/ANALYSIS/TIME/COEFF. VAR. **
GA PLAN FILED WITH A. D. P. C. * E. INCLUDES 10 % REPLICATION ** 10% RECOVERY STUDIES BY RANDOM SELECTION. CALIB. RECORDS MAINTAINED. TOC/CAS/12-18(0900)/\$ TOH/KES/12-14-89/S.D. 8% S.R. 106.1 %

Coples to

2-ABOVE: ATTN: MR. JOE PORTER

Laboratory No. E492.001 - .014 CEDA DKS 1.WED.NE

REVIEWED BY

STATE OF ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY 8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501)562-7444 MEDIA: AIR, WATLE, SOLID, MAZARDOUS April 13, 1990 SORT: PERMIT, COMPLIANCE FEES: Mr. Joe Porter Cedar Chemical Corporation P. O. Box 2749 West Helena, AR 72390 Dear Mr. Porter: I have enclosed a copy of a "Facility Investigation" guidance plan per your request for assistance in formulating a clean-up plan for Cedar Chemical's West Helena plant. The plan outlines the steps and tasks necessary to ascertain the extent of contamination present from wests. contamination present from waste management practices. If I can be of further assistance, please do not hesitate to contact me. Sincerely, Vsammy R. Bates Manager, Enforcement Branch Hazardous Waste Division SRB/ckh:LTR836 Enclosure

PERMIT NO.

PERMIT NO. MAZARDOUS

FEES.

ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TO : David Hartley, Geologist II, Groundwater Sec., H.W.

FROM : Jay Justice, Hazardous Waste Chemist, T.S.

DATE : 10-APR-1990

SUBJECT : Results taken from analyses performed on samples

taken from monitoring wells located at Cedar Chemical

Company on February 16, 1990

The samples taken from monitoring wells located at Cedar Chemical Company on February 16, 1990, have been analyzed for TOC and semivolatile organics. The results from these analyses are listed below and are expressed in mg/l.

TOC 5.8 1,2-Dichlorobenzene 0.04

MW 2

TOC 2.2 Semivolatile organics 2.2

MW 3

TOC 21 1,2-Dichlorobenzene 0.28 Dichloroanilines (1) 0.13-0.25 Propanil (1) 0.04-0.09

MW 4

TOC Bromacil (1) (2) 11 0.04-0.07

MW 6

TOC 18 Semivolatile organics (0.04

NW 6A

TOC Semivolatile organics		2.1
	MW 6B	
TOC 1,2-Dichlorobenzene Chloroanilines (1) Dichloroanilines (1) Bromacil (1) (2)		77 0.06 0.32-0.63 14-28 0.07-0.13
	MW 6C	
TOC Chloroanilines (1) Dichloroanilines (1) Propanil (1) Bromacil (1) (2)		73 0.16-0.31 13-25 0.15-0.3 0.04-0.09
	MW 7	
TOC Substituted monochlorinated Ber	nzotriazoles (1) (2)	10 0.08-0.17
	d Duplicate (MW 6)	
TOC Semivolatile organics		NA(3) <0.04
	Spike	
(Percei	nt Recovery)	
Phenol 2-Chlorophenol 1,4-Dichlorobenzene N-Nitroso-di-n-propylamine 1,2,4-Trichlorobenzene 4-Chloro-3-methylphenol Acenaphthene Pentachlorophenol	54 74 59 37 60 71 86 81	
1,2,4-Trichlorobenzene 4-Chloro-3-methylphenol Acenaphthene	60 71 86	

- (1) This value is an estimate
 (2) Tentatively identified; not confirmed with a standard
 (3) Not analyzed for this parameter

Analytical Results

Analytical data indicates the possibility of two separate sources of contamination indicators. The source of the constituents in the vicinity of MW-3 is unknown but the possibility of buried drums and/or surface soils impacted by plant operations should be considered. The source of the constituents in the vicinity of monitoring wells MW-4, MW-6a, MW-6b, and MW-7 could possibly be related to the radial flow of groundwater from the recharge associated with the biological treatment system. This does not eliminate other sources of the constituents. Consideration must also be given to the areas north and west of the plant being agricultural.

The general monitoring parameters are summarized on an attached table along with regression data for selected pairs of variables. The following table summarizes the ranges of these variables:

	рН	Conductivity	TOX	TOC
Minimum	6.39	700	0.020	1.93
Maximum	8.08	4500	50.800	101.80

The minimum values, except pH, appear to reflect background conditions in the aquifer. Since the aquifer should be greater than 7.0, a decrease in pH may be indicative of a release. Conductivity which reflects the concentration of dissolved electrolytes shows a five fold increase from minimum to maximum. TOX and TOC show increase of 2500 and 52 respectively. There are plots attached that show that as conductivity increases, the pH of the groundwater decreases. The plots also show that organic indicators increase with increasing conductivity.

Cedar Chemical Corporation has collected data from the plant groundwater monitoring system since August of 1988. The data consists of water level data and analytical data from groundwater samples. The water level data was collected from piezometers from August 1988 to June 1990 and from monitoring wells from August 1989 to June 1990. The analytical data was collected from the monitoring wells August 1989 to May 1990.

Monitoring wells were installed at locations recommended by Grubbs, Garnes, & Hoskyn, Inc., Consulting Engineers and based upon data gathered from piezometer measurements. Screened depths were recommended by ADPC & E.


Groundwater Movement


The evaluation of groundwater data from monitoring wells with screens located at approximately equivalent elevations indicates that groundwater movement is approximately from the north-northwest to the south-southwest. However, this movement is modified by one or a combination of the following: radial groundwater flow associated with recharge (perhaps from the biological treatment system impoundments); seasonal changes associated with rainfall; local agricultural uses.


Cedar Chemical Corporation - Monitoring Well Analysis Report Summary


Date	Well	pH	Sp. Cond.	TOH	TOC		
						TOH VS CONDUCTIVITY	
Oct-89	1	6.71	1850	0.774	4.62	Regression Output:	
Dec-89	1	7.28	1900	0.657	4.96	Constant -2.66097	
Feb-90	1	7.38	2000	0.648	5.72	Std Err of Y Est 13.88724	
Apr-90	1	6.94	2000	0.988	4.76	R, R Squared 0.445283 0.198276	
Oct-89	2	6.58	860	0.037	2.06	No. of Observations 36	
Dec-89	2	7.42	900	0.071	2.42	Degrees of Freedom 34	
Feb-90	2	7.81	850	0.020	2.74		
Apr-90	2	7.18	800	0.167	1.93	X Coefficient(s) 0.005964	
Oct-89	3	6.39	4500	6.570	38.40	Std Err of Coef. 0.002056	
Dec-89	3	6.66	3250	4.165	25.32		
Feb-90	3	6.70	3500	4.370	24.97	TOC VS CONDUCTIVITY	
Apr-90	3	6.43	4500	6.890	36.01	Regression Output:	
Oct-89	4	6.82	2800	1.840	10.10	Constant 0.937909	
Dec-89	4	7.42	2500	1.780	9.72	Std Err of Y Est 26.60908	
Feb-90	4	7.49	2900	2.062	12.57	R, R Squared 0.466432 0.217559	
Apr-90	4	7.32	2600	2.059	11.72	No. of Observations 36	
Oct-89	6	7.56	1100	0.081	3.64	Degrees of Freedom 34	
Dec-89	6	7.77	1000	0.273	19.34		
Feb-90	6	8.00	1100	0.053	22.80	X Coefficient(s) 0.012116	
Apr-90	. 6	7.69	1100	0.089	13.56	Std Err of Coef. 0.003940	
Oct-89	6A	7.76	700	0.201	2.32		
Dec-89	6A _	7 50	700	0.035	2.37	TOH VS TOC	
Feb-90	6A	7.71	760	0.062	2.81	Regression Output:	
Apr-90	6A	7.46	775	0.072	2.94	Constant -0.91977	
Oct-89	6B	7.33	3500	39.100	85.90	Std Err of Y Est 9.659551	
Dec-89	6B	7.46	3100	31.500	84.70	R, R Squared 0.782376 0.612112	
Feb-90	6B	7.37	3900	44.000	19.99	No. of Observations 36	
Apr-90	6B	7.23	3000	33.900	71.82	Degrees of Freedom 34	
Oct-89	6C	7.43	2100	50.800	78.70	Logicol of Frederica	
Dec-89	6C	7.54	2100	44.800	74.80	X Coefficient(s) 0.403380	
Feb-90	60	7.07	2100	12.200	101.80	Std Err of Coef. 0.055069	
Apr-90	6C	7.04	2000	24.400	66.63	DU DIE 01 00011 0.00000	
Oct-89	7	7.62	840	0.602	7.50	PH VS CONDUCTIVITY	
Dec-89	7	7.83	850	0.979	8.77	Regression Output:	
Feb-90	7	8.08	960	3.500	14.03	Constant 7.793157	
Apr-90	7	7.65	1500	7.280	10.36	Std Err of Y Est 0.344945	
uht-an		7.00	1300	1.200	10.00	R, R Squared 0.624893 0.390491	
Minimum		6.39	700	0.020	1.93	No. of Observations 36	
Maximum		8.08	4500	50.800	101.80	Degrees of Freedom 34	


X Coefficient(s) -0.00023 Std Err of Coef. 0.000051

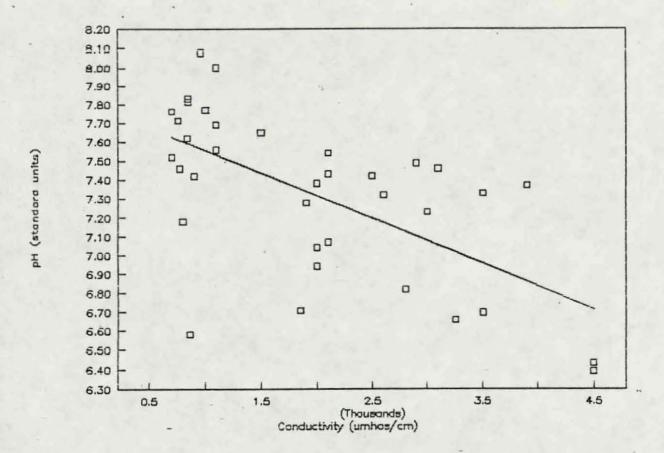

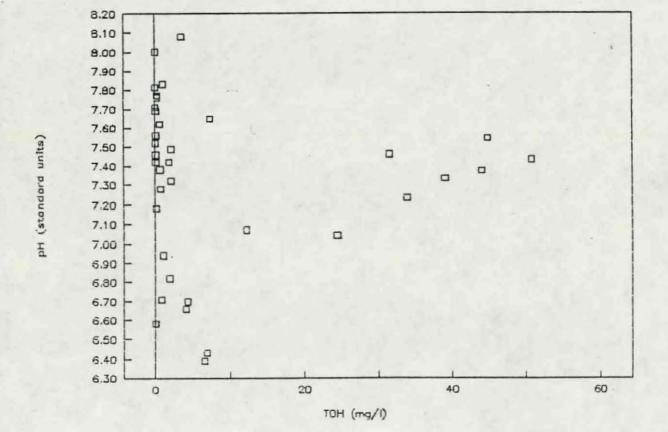

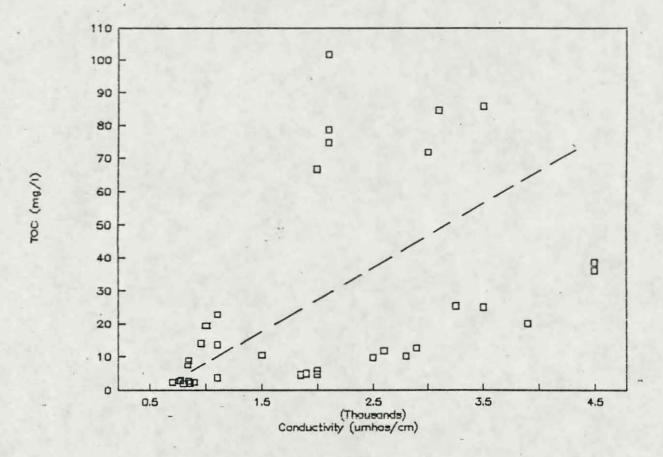

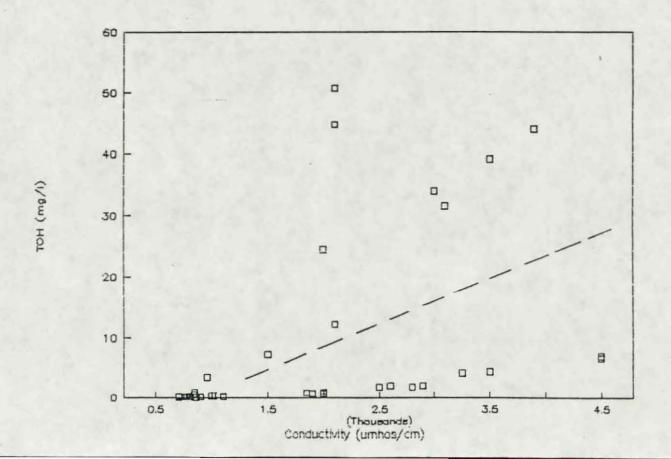

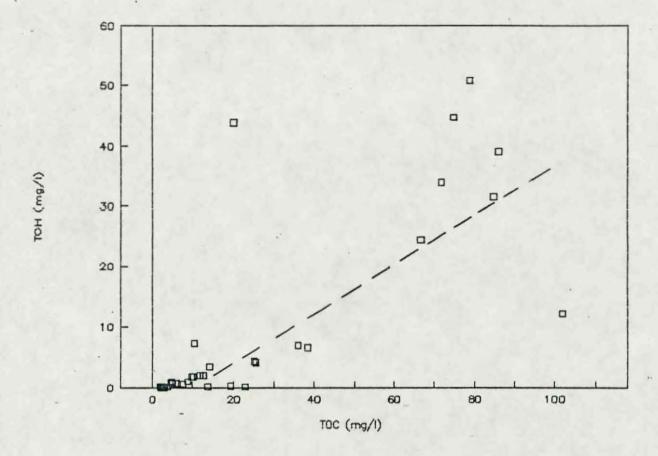

CEDAR CHEMICAL CORPOR 24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348 REPLY TO: P. O. BOX 2749 WEST HELENA, AR 72390 (501) 572-3701 April 6, 1990 Mike Bates Arkansas Department of Pollution Control & Ecology 8001 National Drive P.O. Box 9583 CSN: 540068permit No. Media: Air, Water, Solid, Hazardous, Superfund, UST Little Rock, AR 72209 Sort: Permit, Compliance Excavation Re: Dear Mike: To follow up on our phone conversation, we have uncovered what we believe to be a small drum burial area. We were digging a trench as part of a construction project on our stormwater drainage system. At approximately 6 feet below grade a drum was uncovered. Continued digging of the area uncovered approximately eight drums in a six foot long, four foot wide trench down to a depth of twelve

feet below grade. An area map is attached.

Approximately 250 cubic feed of contaminated soil has been removed. We have ordered a hazardous waste bin from Rollins ChemPak, Inc. for containment of the excavated material. It is currently covered with plastic sheets and does not pose a threat from rainwater run The excavated area was filled with fresh dirt and construction continued. There is no analytical data as of now. The material appears to be emulsifier and dinitro compounds.

We will have the firm of Woodward-Clyde involved in additional investigation. We would like to have your assistance and guidance in cleaning up this area.

Sincerely,


Joe E. Porter

Environmental Engineer

J.H. Miles cc:

T.J. Lodice

J.R. Tomblin

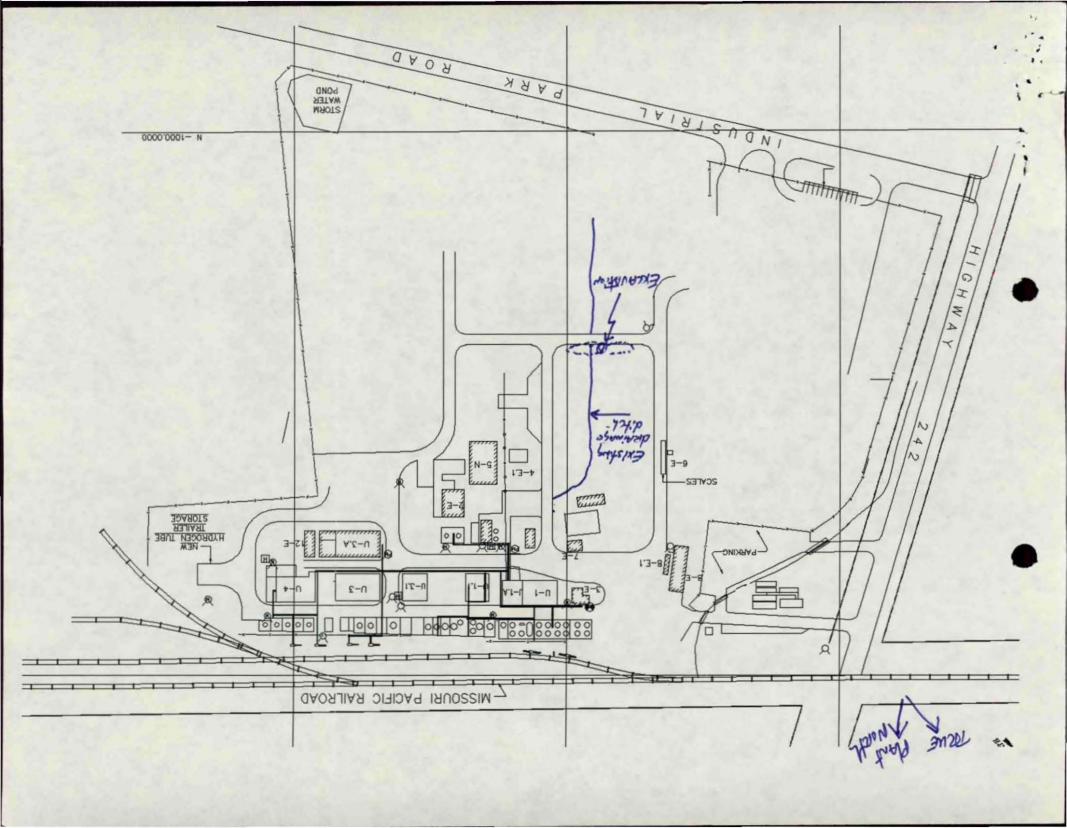

CEDAR CHEMICAL CORPORATION 24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348 REPLY TO: P. O. BOX 2749 WEST HELENA, AR 72390 (501) 572-3701 April 6, 1990 Mike Bates Arkansas Department of Pollution Control & Ecology 8001 National Drive P.O. Box 9583 Little Rock, AR 72209 Re: Excavation Dear Mike: To follow up on our phone conversation, we have uncovered what we believe to be a small drum burial area. We were digging a trench as part of a construction project on our stormwater drainage system. At approximately 6 feet below grade a drum was uncovered. Continued digging of the area uncovered approximately eight drums in a six foot long, four foot wide trench down to a depth of twelve feet below grade. An area map is attached. Approximately 250 cubic feed of contaminated soil has been removed. We have ordered a hazardous waste bin from Rollins ChemPak, Inc. for containment of the excavated material. It is currently covered

with plastic sheets and does not pose a threat from rainwater run off. The excavated area was filled with fresh dirt and construction continued. There is no analytical data as of now. The material appears to be emulsifier and dinitro compounds.

We will have the firm of Woodward-Clyde involved in additional investigation. We would like to have your assistance and guidance in cleaning up this area.

Sincerely,


Joe E. Porter

Environmental Engineer

cc: J.H. Miles

T.J. Lodice

J.R. Tomblin

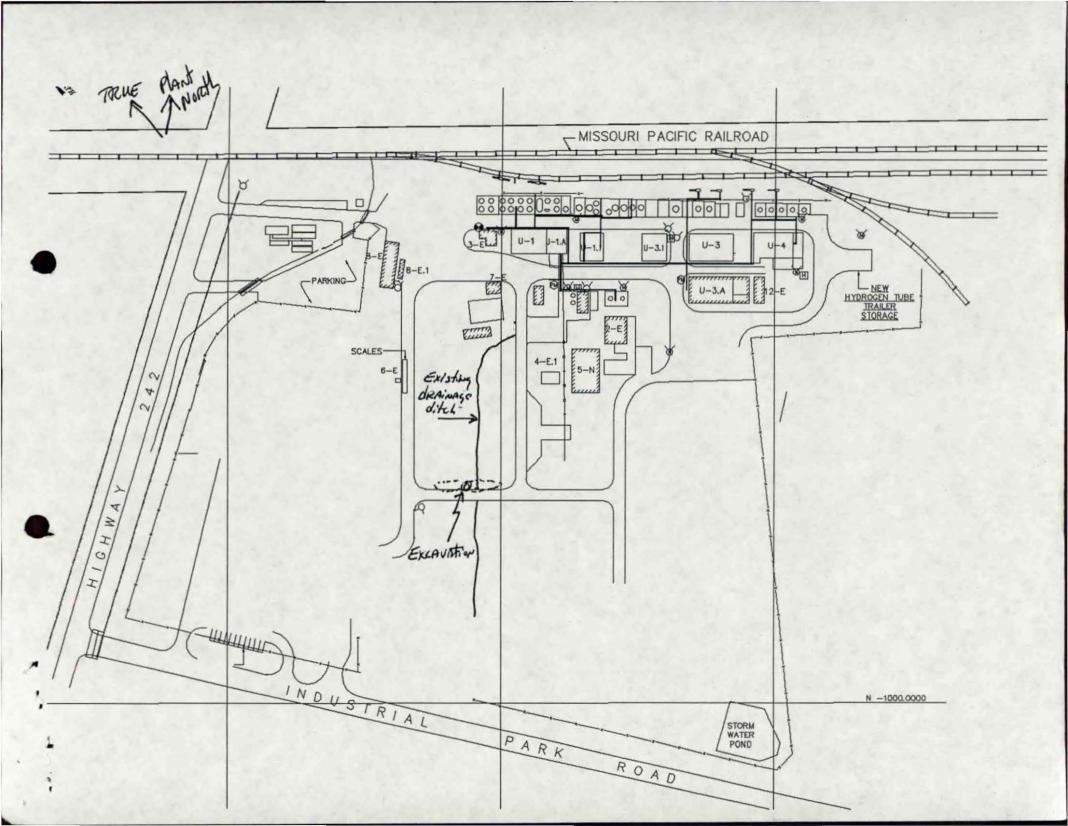

a company and particles are

+06-90 17:16 AM FROM CALA CHEMICAL CORP

P01/03

CEDAR CHEMICAL CORPORATION

P.O. Box 2749. Hwy. 242 S. . West Helena, AR 72390 (501) 572-3731 . Fax No. 501-572-3795

TO: ARKANSON Department of Pollutions
Contract & Ecology

ATTENTION: Mike Bates

FAX NO: 501-562-4632

FROM: JOE E. Porten

DATE: April 6, 1990

NO. OF PAGES: 2 + corn


MESSAGE

the first proper provide the


Per our conversation. Thanks for the help!

I Posters

CSN: 54006 SPERMIT NO. MEDIA: AIR, WATER, SOLID, HAZARDOUS SORT: PERMIT, COMPLIANCE FEES:

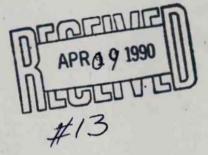

1-06-90 14:16 AM FROM CE. A CHEMICAL CORP



24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348

REPLY TO: P. O. BOX 2749 WEST HELENA, AR 72390 (501) 572-2701

April 6, 1990

Mike Bates
Arkansas Department of Pollution Control & Ecology
8001 National Drive
P.O. Box 9583
Little Rock, AR 72209

Re: Excavation

Dear Mike:

To follow up on our phone conversation, we have uncovered what we believe to be a small drum burial area. We were digging a trench as part of a construction project on our stormwater drainage system. At approximately 6 feet below grade a drum was uncovered. Continued digging of the area uncovered approximately eight drums in a six foot long, four foot wide trench down to a depth of twelve feet below grade. An area map is attached.

Approximately 250 cubic feed of contaminated soil has been removed. We have ordered a hazardous waste bin from Rollins ChemPak, Inc. for containment of the excavated material. It is currently covered with plastic sheets and does not pose a threat from rainwater run off. The excavated area was filled with fresh dirt and construction continued. There is no analytical data as of now. The material appears to be emulsifier and dinitro compounds.

We will have the firm of Woodward-Clyde involved in additional investigation. We would like to have your assistance and guidance in cleaning up this area.

Sincerely,


Joe E. Porter

Environmental Engineer

cc: J.H. Miles

T.J. Lodice

J.R. Tomblin

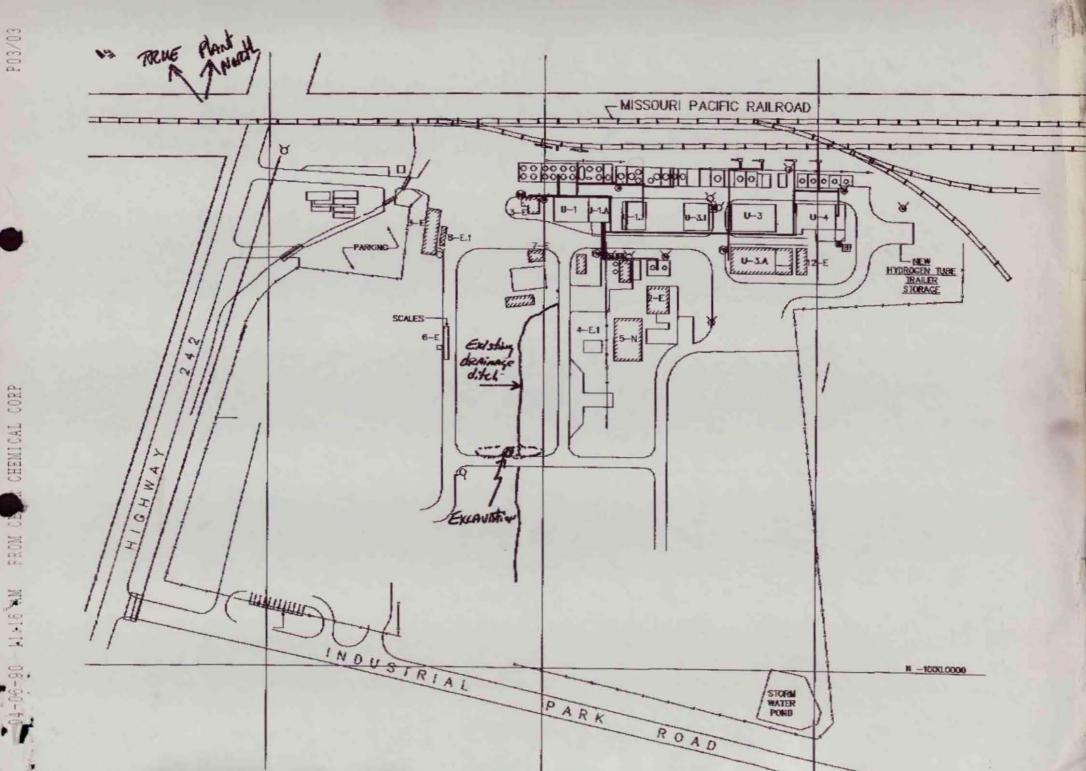

34750;#

12:09PM

BY: XEROX TELECOPIER 7010

PART I

805-10-90

MAR 0 1 1990

THIS FORM MUST BE COMPLETED BY ALL GENERATORS AND TSD FACTURE

		POUNDS OF	FHAZAR	DOUS WAST	E PER CALENDAR MONTH,
AND IS CONDITIONALLY E	EXEMP1.				
Section I:					
A. Site name Cedar Chemical Corpor		NAME OF THE OWNER, OF THE OWNER, OF THE OWNER, OF THE OWNER, OWNER, OWNER, OWNER, OWNER, OWNER, OWNER, OWNER,	A identification RD 990 660		
C. Physical location address Hwy 242 South			+		
D. City West Helena	E. County Phillips			F. State AR	G. Zip code 72390
Section II:					
A Mark here if mailing a	ddress is same	as physical	address	S	
B. Mailing address P O Box 2749			1.4	MAIN	
C. City		D. State		E. Zip code	
West Helena		AR		72390	
Section III:					
Print Company contact: A. Last name Porter		F	irst nam	e Joe E.	
B. Title		C. 1	Telephor	ne	
Environmental Eng	ineer			501-572-	3701
Section IV:					
Print Standard Industrial Class	sification Code:	5			





I certify under penalty of law that I have personally examined and am familiar with the information submitted in this and all attached documents, and that based on my inquiry of those individuals immediately responsible for obtaining the information, I believe that the submitted information is true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment.

FORM IC: DENTIFICATION AND CERTIFICATION

PART II

Α.	Name change: NA previous name: new name:
B.	Ownership change: NA
C.	Date facility closed: NA
D.	Waste stream change: NA
E.	Process change: NA
F.	Generation status of this site for this reporting year: X Category 1 (generated 2200 pounds or more per calendar month) Category 2 (generated between 220 pounds per calendar month) Category 3 (generated less than 220 pounds per calendar month)
G.	Was hazardous waste generated as a one-time event during the reporting year? (spill clean-up, remedial actions, one-time elimination of on-site waste)
Н.	List total amount of hazardous waste generated during the reporting year: 18,570,400 pounds
l.	List total amount of hazardous waste carried over from the previous year that was shipped in the reporting year. -0-

FORMWR: FACILITY ACTIVITY REPORT

Section I:

A. Did this site TSD on-site in RCRA-regulary Yes X No If yes, briefly describe the TSD methods to	
B. Was TSD for excluded wastes: — YesX No If yes, briefly describe the TSD method us	sed.
C. Did TSD occur in exempt units: X Yes No If yes, briefly describe the type of units. Treatment: Elementary neut Alkaline Chlorination in total	cralization ally enclosed systems.
D. Has this TSD site notified for closure: X Yes No Date of closure	December 12, 1988
E. Is this TSD site in closure ∕loost-closure	
F. List the following cost estimates: Facility closure NA Post-closure monitoring and maintenance	eNA

FORM WR: FACILITY ACTIVITY REPORT

Section II:

A. List storage amount	ts: NA - No stora	ge more than 9	00 days.
	Handling Codes	Amounts	Units of Measure
January 1, 1989	0.500	0	
December 31, 1989		0	

B. Describe briefly this site's groundwater monitoring activity and attach monitoring report for surface impoundment, landfill, or land treatment.

Not applicable for this report. However, a groundwater monitoring plan has been initiated.

FOR WR: FACILITY ACTIVITY REORT

Section I: Facility identification

NA - No waste accepted from off-site.

Section II. Generator i			D 990 660 Corporation			
A. Generator EPA Ider	ntification N N	umber ame ddress				
		city	state		_ zip .	
Section III: Waste iden						
WASTE DESCRIPTION	WFC	EPA WC	AMOUNT	UOM	D	S
*						
		W.				

FOR WR: FACILITY ACTIVITY REPORT

This form should be completed by facilities who generated hazardous waste on-site and treated, stored, or disposed of the hazardous waste on-site. Do NOT include waste shipped off-site. Do NOT include waste received from an off-site generator.

Section I: Facility identification NA - No waste treated, stored, or disposed of in RCRA-Regulated units.

A. Site EPA Identif	ication	Numbe	r_A	RD 990	660 649							
			N	ame Ce	dar Chem							
			city state zip									
Section II. Waste identification												
WASTE DESCRIPTION	SIC	WIC	SC	EPA WC	AMOUNT	UUM	D	ST				
			1									
100												
		HA										
100												
	H. A											
	1											
	1 8		16.4		142 39							



STATE OF ARKANSAS

DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

PHONE: (501) 562-7444

January 24, 1990

Mr. Joe Porter Cedar Chemical Corporation P. O. Box 2749 Highway 242 South West Helena, AR 72390 Dear Mr. Porter:

The 1988 Hazardous Waste Annual Report submitted by Cedar Chemical has been reviewed.

The report does not have an original signature and date on page 2. Form GS, page 8, lists shipments to LAD000777201; the Department manifest system does not reflect these shipments. Also, the annual report lists more shipments than the manifest printout.

I have enclosed printouts showing the information on file with the Department manifest system.

You must provide an amended annual report to my attention within fifteen (15) days of receipt of this letter. If you have any questions, please let me know.

Sincerely.

Vicky Renfrow

Administrative Assistant II Hazardous Waste Division

FORIES: GENERATOR ACTIVITY PORT

Section I: Generat A. EPA identificati B. Name			AR	2D 990	660 69 Kemical C	19 ORP OR	ation		= v
Section II: Transport A. EPA identification name address city	on numb	er Paci-	mo	D 000 Railron Street	968 101 L Mo	zip_	631	103	
Section III: TSD fa A. EPA identificati name address city	on numb	or T	XD	097 (673 149 Bond TX	zip.	775	36	
B. Amount of ha on-site:Form WR, Part III m	iust also l	pe com	- 10				, or di	sposed	of
Waste description	SIC	WFC	SC	EPA WC	AMOUNT	UOM	D	ОС	ST
Naste, Flammable Liguid UN 1993	2879			D001	17,121,000	P		A	M134
RQ Toluene									
	-							1. 1.	

Le constant

FORMERS: GENERATOR ACTIVITY REPORT

S	Section I: Generator identification	,
	A. EPA identification number ARD 990 660 649 B. Name CEDAR Chemical Corporation	V
F	Name CEDAR Chemical Corporation	

name Gibraltar Wastewaters, Inc
address 3800 Stone Road
city Kilgore state TX zip 75662

Section III: TSD facility identification

A. EPA identification number TXD 000 742 304

name Gibraltar Chemical Resources Deep Well

address PO Box 248 - Hwy 155

city Winord state TX zip 75792

B. Amount of hazardous waste generated on-site and treated, stored, or disposed of on-site: _____

Form WR, Part III must also be completed if on-site TSD took place.

Section IV: Waste identification

Waste description	SIC	WFC	SC	EPA WC	AMOUNT	UOM	D	OC	ST
Waste, Flammable Liquid, UN 1993	2879	B102	A37	D 001	663,420	ρ		A	MI34
RQ Toluene	H								
	-								
		48							

FORMES: GENERATOR ACTIVITY REPORT

A LUA idontificati		ication	AR	D 990	660 64	7			
B. Name	onnumb	CE	DAR	Chemie	Al Compose	tion			
Section II: Transpo					0		114	AR	
A. EPA identificati name	on numb	er	移	ARD	481 513 :	385			-
address	Koute	6	Box	5		4		1 -	
city	ER Po	RAdo		state_	AR	zip	7)	130	*
Section III: TSD fa				F. 16.23	Charles !				
A. EPA identificati	on numb	er	TX	000	742 304	,	//		
name	O B	ex 2	48 -	Hwn 1	esouples 1.	eep u	vell	79-5	-
city	NINON	4		state_	TX	zip	75	792	
Form WR, Part III m	nust also	be com	pieted	if on-site	SD took place	•		,	
Section IV: Waste	identifica	ation							
Section IV: Waste			SC.	EDA WC	AMOUNT	HOM	D	00	CT
Waste description	SIC	WFC	SC	EPA WC	AMOUNT	UOM	D	ОС	ST
	SIC	WFC			AMOUNT 626,100	UOM P	D	oc A	
Waste description Waste, Flammable	SIC	WFC					D		
Waste description Waste, Flammable Liquid, UN 1993	SIC	WFC					D		
Waste description Waste, Flammable Liquid, UN 1993	SIC	WFC					D		
Waste description Waste, Flammable Liquid, UN 1993	SIC	WFC					D		
Waste description Waste, Flammable Liquid, UN 1993	SIC	WFC					D		
Waste description Waste, Flammable Liquid, UN 1993	SIC	WFC					D		
Waste description Waste, Flammable Liquid, UN 1993	SIC	WFC					D		
Waste description Waste, Flammable Liquid, UN 1993	SIC	WFC					D		ST M134

FOR GENERATOR ACTIVITY PORT

Section I: Generator	identif	ication							
A. EPA identification B. Name	numb	er	AR	D 990 (ical Corpo	nation			
D. Hame		1 3527							
Section II: Transpor A. EPA identification				D 991	512 385				1/
name			Lee	's TRU	cking Ser	viee			
address			Row	te 6 1	30x 5		7(7	30	
Section III: TSD faci									
A EDA: 1 1/6 1			1 AD	000	178 514			10.1	41077
name Readdress Rt city Pla	11NS	ENUI	RONM	CRANTAL "	Services of	Louisia	ANA,	ENC	
city Pla	quem	ine	, ,	state	LA	zip	707	64	
	0								
B. Amount of haza	ardous	waste	genera	ated on-si	te and treated	d, stored	, or di	sposed	of
on-site:									
Form WR, Part III mu	st also	be com	oleted	if on-site	ISD took place				
Section IV: Waste id	entifica	ation							
Waste description	SIC	WFC	SC	EPA WC	AMOUNT	UOM	D	ОС	ST
HAGARDONS WASTE, Liquid, NOS, NA 9189 EPA Code DOO7	2869	8119	A69	D007	159, 880	P		A	M134
EPA Code DOO7			177		Part of the same	100			
	- 2					161			
AFTER LANGUE	11					16-		13.4	
	right.					7-1			
					And the				
	THE .	11.18						Fr.	
	-								
							6	1	
	II.	115						10+	17.5
		1.77							N YEL
						1.9			

BIIA - Aqueons satt Calcium Chloride Solution containing containing Chronium inhibitor
A69- Changeover to Ethylene Glycol

Page 2

FORM PS

	FORM PS	x800
Site nar addre	A identification number ARD990 660 649	98% of
	ste treatment, disposal, recycling system description Elementary neutralization of propionic acid. This material is usually in the ph range of 2 to 4. This is neutralized to a range of 7 to 9 prior to transfer to the biological treatment system. (NPDES).	this is non-hay
B. Sy	tem type M_1_2_1 C. Regulatory status0_2	
D. Op	erational status 0 1 E. Unit types 0 1	
Commo	Anhydrous Ammonia is used for neutralization. This also provides necessary nitrogen value to the biological system.	

page 8 of instructions, form PS: totally enclosed treatment units are not reported on form PS

Section II:

A. 1989 influent quantity
Total5_5_0_0_0_ UOM _1 Density8_5
RCRA (1) X lbs./gallon (2)sg
B. Maximum operational capacity
Total 2 0 0 0 0 0 0
RCRAD_K_
C. 1989 liquid effluent quantity
Total 5 5 0 0 0 0 UOM 1 Density 8.5
RCRA (1) _Xibs./gallon (2)sg
D. 1989 solid/sludge residual quantity
Total UOM Density
RCRA (1)lbs./gallon (2)sg
E. Limitations on capacity
(1) 0 9 (2) (3)
F. Commercial availability code1
G. Percent capacity commercially availableNA%

Section III:

A. Planned changes in maximum operational capacity —YES (continue to box B) XNO (Form is complete; stop here)
B. New maximum operational capacity
Total UOM
RCRA
C. Planned year of change
D. Future commercial availability code
E. Percent future capacity commercially available%

Site name _	Cedar Chemical (P O Box 2749 -	
address _	West Helena, AR	
Site EPA ide		ARD 990 660 649
Section I:		
A. Waste to	reatment, disposal, recy	ycling system description
This for	rm applies to seve	stally enclosed treatment systems. ral process systems which use ion to treat residual cyanide or
B. System	type M_0_7_5	C. Regulatory status 0 2
D. Operati	onal status 0 1	E. Unit types
After la cyanide sulfite	de present are tre aboratory analysis or sulfide, the se to remove excess	ess streams which have cyanide eated with sodium hypochlorite. demonstrating the absence of plution is treated with sodium hypochlorite and pH is adjusted treatments take place in process

Page 3

FORM PS

Section II:

A. 1989 influent of	quantity		
Total	D_K	UOM Density _	
RCRA		(1)lbs./gallon	(2) _sg
B. Maximum ope	rational capacit	у	
Total	D K		
RCRA			
C. 1989 liquid eff	luent quantity		
Total	D K	UOM Density _	
RCRA		(1)lbs./gallon	(2) _ sg
D. 1989 solid/slu	ıdge residu <mark>a</mark> l qu	uantity	
Total	-0	UOM Density _	n. S. C. od. Pa
		(1)lbs./gallon	
E. Limitations on	capacity		
(1) _0 _9 (2) _	(3)		
F. Commercial a	vailability code	_1	
G. Percent capac	ity commercial	ly availableNA %	

Page 4

FORM PS

Section III:

A. Planned changes in maximum operational capacity —YES (continue to box B) XNO (Form is complete; stop here)
B. New maximum operational capacity
Total UOM
RCRA
C. Planned year of change
D. Future commercial availability code
E. Percent future capacity commercially available%

doubertem PS 7089
Page 2

FORM PS

Site name Cedar Chemical P O Box 2749 West Helena, A	- Hwy 242 South
Site EPA identification number	ARD 990 660 649
Section I:	
	of spent scrubber medium. This ocess systems which use sodium
Elementary neutralization of form applies to several pr	of spent scrubber medium. This ocess systems which use sodium
Elementary neutralization of form applies to several pr	of spent scrubber medium. This ocess systems which use sodium

Scrubber systems are considered spent when sodium hydroxide concenstration reaches 1 to 3%. At this point, the solution is above the maximum level of ph 12.5. Therefore the solution is manually neutralized to below ph 10.

A specific scrubber may only operate for a portion of the year. Records are not maintained on all systems as to volumes. They may also be used to neutralize process materials.

Section II:

A. 1989 influent qu	antity			
Total	D K	UOM_	Density_	
RCRA		(1) _	_lbs./gallon	(2) _ sg
B. Maximum opera	tional capacit	ty		*-
Total	D_K			
RCRA				
C. 1989 liquid efflu	ent quantity	14,1		
Total	D K	UOM	Density_	
RCRA	-0-	(1)_	_lbs./gallon	(2) _ sg
D. 1989 solid/slud	ge residual q	uantity		
Total	-0	UOM	. Density _	
RCRA		(1) _	_lbs./gallon	(2) _ sg
E. Limitations on ca	apacity		W. A. Y.	
(1) 0 9 (2)	_ (3)			
F. Commercial ava	ilability code	_1		
G. Percent capacity	y commercial	l <mark>y</mark> availabl	e <u>NA</u> %	

Page 4

FORM PS

Section III:

A. Planned changes in maximum operational capacity
YES (continue to box B)
NO (Form is complete; stop here)
B. New maximum operational capacity
Total UOM
RCRA
C. Planned year of change
D. Future commercial availability code
E. Percent future capacity commercially available%

BEFORE COPYING FORM, ATTACH SITE IDENTIFICATION LABEL OR ENTER: SITE NAME LED AR Chemical Curporation	U.S. ENVIRONMENTAL PROTECTION AGENCY 1989 Waste Minimization Report
EPA ID NO. [A,R,D,9,9,0,6,6,0,6,4,9]	FORM IDENTIFICATION AND CERTIFICATION
INSTRUCTIONS: Read the detailed instructions beginning on page 6 of to	he 1989 Hazardous Waste Report booklet before completing this form.
THE BALL AND THE STATE OF THE S	The state of the s
C. Has the site name associated with this EPA ID changed since 1987?	
D. Street name and number. If not applicable, enter industrial park, building name or other physical location Same as label or Hwy 242 South - E. City, town, village, etc. Same as label or West Helena Phillips	G. State Same as label AR H. Zip Code Same as label 7 2 3 9 0 -
SEC. II Mailing address of site. Instruction page 6.	
A is the mailing address the same as the location address? 1 Yes (SKIP TO SEC. 2 No (COMPLETE S	
P.O. Box 2749	
C. City, town, village, etc. West Helena	D. State E. Zip Code 7, 2, 3, 9, 0, -
SEC. III Name, title, and telephone number of the person who should be contact	cted if questions arise regarding this report. Instruction page 6.
A Please print: Last name First name M.I. B. Tat For E. For	c. Telephone SUIRONMENTAL STOTE STOTE Extension Extension
SEC. IV Enter the Standard Industrial Classification (SIC) Code that describes the services rendered at the site's physical location. Enter more than of activities of the site. Instruction page 7.	he principal products, group of products, produced or distributed, or ne SIC Code only if no one industry description includes the combined
A 2869 B. 2879	0.
SEC. V I certify under penalty of law that I have personally examined and am fa documents, and that based on my inquiry of those individuals immedia submitted information is true, accurate, and complete. I am aware that the possibility of fine and imprisonment. A Number of form pages submitted	miliar with the information submitted in this and all attached tely responsible for obtaining the information, I believe that the there are significant penalties for submitting false information, including
Form IC 2 Form WM	002
B. Prease print: Last name First name D. Signature D. Signature	H. C. Title Plant Manager
John Huter	E. Date of signature OZ ZZ GO MO. DAY YR Page 1 of Z

Did this site begin or expand a <u>source</u> reduction activity during 1988 or 1989? Instruction page 8	B. Did this site be activity during Page 8	gin or expand a <u>recycling</u> 1988 or 1989?	C. Did this site conduct a source reduction or recyclin opportunity assessment during 1988 or 1989? Page 8
1 Yes 2 No	☐ 1 Yes ☑ 2 No		⊠ 1 Yes □ 2 No
What factors have limited this site from initial (CHECK ALL THAT APPLY) Page 8 O1 No factors have limited new source in the control of the c	reduction activities. rce reduction equipment rce reduction technique	nt or implement new source es, applicable to my specifi	e reduction practices.
O5 Concern that product quality may de O6 Technical limitations of the production O7 Permitting burdens. O8 Other (SPECIFY IN COMMENTS)	ecline as a result of sou		oroduction will not recover the capital investment.
What factors have limited this site from initia (CHECK ALL THAT APPLY) Page 8	ting new on-site or off-	site <u>recycling</u> activities durin	ng 1988 or 1989?
O1 No factors have limited new recyclin O2 Insufficient capital to install new recycling or implement new recycling practice O3 Lack of technical information on rec applicable to this site's specific proc	ycling equipment es. ycling techniques duction processes. ble: cost savings in	O8 Technical limits for recycling. O9 Techical limitat 10 Permitting burd 11 Lack of permitt	ed off-site recycling facilities. tify a market for recyclable materials.
O5 Concern that product quality may dof recycling. Requirements to manifest wastes in site for recycling.		E 15 Other (Gr Eon	THE COMMENTS OF
comments:			

BEFORE COPYING FORM, ATTACH SITE ID AFFICATION LABEL OR ENTER: SITE NAME CEDAR Chemical Corporation	TANKE TAL PROTECTO 15	U.S. ENVIRONMENTAL PROTECTION AGENCY 389 Waste Minimization Report
EPAID NO. [4,7,7,9,9,0,6,6,0,6,4,9]	FORM WM	WASTE MINIMIZATION
INSTRUCTIONS: Read the detailed instructions beginning on page form.	9 of the 1989 Waste Minimization	Report booklet before completing this
Sec. A Waste description Aqueous precess stream from Contains methyl morcaptan	m onganic chemius (reactive sulfide)	many Acturing;
B. EPA hazaroous waste code Page 11 Di 0,0,3	C. State hazardous weste code Page 11	
D. SIC code Page 11 [2,8,6,9] E. Source code Page 11 [A 8,9]	F. Form code Page 12	G. Origin Page 12 Code [] System type [M
	0,74.93.1 2	N,A
Sec. A Quantity generated in 1988 Instruction Page 13 1 1 9 5 3 1 8 0 B. Quantity generated in 1989 Page 13 C. 1 1 9 0 5 6 0	D. Density Page 13 Page 14 P 11	Was this weste recycled in 1989? Page 14 1 Yes (CONTINUE TO BOX F) 2 No (SKIP TO SEC. III)
F. On-site recycling Page 14 Quantity recycled on site in 1989		y recycled off site in 1989
Sec. A Acomy B. Other effects C. Quantity recycled in 1989 due to ne		E. Source Reduction Quantity
III Page 14 Page 14 Page 14	Page 15	Page 16
W 5 1 W 5 2 1 Yes	V.A. L.1.8	, J.5 ₁ Z ₁ 5 ₁ 0,0 ₁ 0 ₁
Comments: I.E. Aqueour process stream		
		Page / of 2

BEFORE COPYING FORM, ATTACH SITE IDE OR ENTER: SITE NAME CED AR Chem	ical Corporation	S. S	PROTECTION AGENCY 1989 Waste Minimization Report
EPA ID NO. [4,7,0,9,9,0,6,	6,0,6,4,9	FORM WM	WASTE MINIMIZATION
INSTRUCTIONS: Read the detailed if form.	nstructions beginning on page	9 of the 1989 Waste Minimi	ization Report booklet before completing this
Sec. A Waste description Aqueous Parameter Instruction Page 11 Contains	product which is AM	organic chemical organic misture	earthining sulfide (Reactive)
B. EPA hazardous waste code Page 11 D O O 3		C. State hazardous waste code Page 11	
TO 10	ge 11	F. Form code Page 12	G. Origin Page 12 Code System type M
H. TRI constituent Page 12 I. CAS numbers Page 13 3.		X T URG	2
	age 13	D. Density Page 13 P. Page 14 P. S.	E. Was this waste recycled in 1989? Page 14 1 Yes (CONTINUE TO BOX F) 2 No (SKIP TO SEC. III)
F. On-site recycling Page 14 Quantity recycled of	on site in 1989	G. Off-site recycling Page 14	Quantity recycled off site in 1989
Sec. A. Activity B. Other effects Page 14 Page 14	C. Quantity recycled in 1989 due to new Page 14	D. Activity/Production Page 15	n Index E. Source Reduction Quantity Page 16
W1511 W1512 01 Yes	^	1A 12.6	4 11 18,8,5,0,0,0
Comments: I.E. Aqueom procum strea I.I. Reduct: Allyl-N-Bu	m tyltrithiocarbonate		
			Page 2 of 2

10501 Stagecoach Road P.O. Box 5239 Little Rock, AR 72215 501-455-2536 Fax: (501) 455-4137

January 2, 1990 LR89-237

Cedar Chemical Corporation P. O. Box 2749 West Helena, AR 72390

Attention: Mr. Joe Porter

RE: Monitoring Well Installation

Cedar Chemical Company West Helena, Arkansas CSN: 59006 8 PERMIT NO.

MEDIA: AIR, WATER, SOLID, HAZARDOUS
SORT: PERMIT, COMPLIANCE
FEES:

Gentlemen:

Attached are the logs of the monitoring wells installed for the Cedar Chemical Company in West Helena, Arkansas. The well locations are shown on Plate 1. Soil stratigraphy and results of field tests are summarized on the log forms, Plates 2 through 10. The well completion diagrams are shown on the right-hand portion of the log forms.

The monitoring wells were installed using a potable water supply. Decontamination procedures were used between wells. The wells were each developed using an engine-driven compressor.

If you have any questions regarding this data or installation procedures, please contact us.

Very truly yours,


GRUBBS, CARNER & HOSKYN, INC.

Richard E. Ackley, P.E.

REA/jj

Copies Submitted: Cedar Chemical Corporation

Attn: Mr. Joe Porter

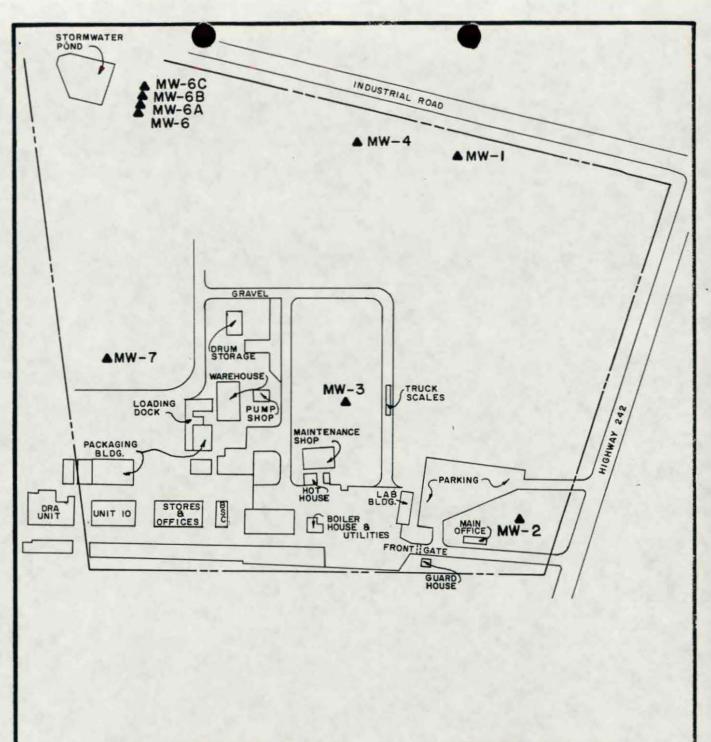

MONITOR WELL LOCATIONS

CEDAR CHEMICAL COMPANY WEST HELENA, ARKANSAS

> SCALE |" = 170'



E .)r	T	Auger to 13.5 ft & Wash	FT	CATIO			HES	ION,	TON/	_		.4
DEPTH, FT	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL	BLOWS PER	UNIT DRY WT	PLAS LIM	TIC	-	WA	TER TENT,	-	LIQU	
		2	SURF. EL: 196.47	8	2	10	20	30) 4	0	50		0
			Loose tan fine sandy silt Very stiff tan silty clay						Pr	otec	tive	Cov	er-Z
			Very stiff tan silty clay										
5			Stiff gray silty clay							nent	Gro	at -	2.
	И		-tan and gray below 6 ft						8				
-1	V											eter	
		1	-tan and light gray below 8.5 ft						ise		s st	eel	٧.
0/								7	8				
							-						
5								•	9				
20			-wet at 20 ft -firm atg20 to 21 ft				8		Ве	nton	ite	Seal	7.
5								8		Fi1	ter	Sand	~
0			-gray below 30.5 ft5					8					
			-tan and light gray and firm			6	9	3	S1	otte	d So	reen	2
54	М		<u>below 3</u> 4.5 ft						(0	.010	" SI	lots)	
			TION DEPTH: 35 ft DE		TO W								

. Jo	S	ER FT	Y WT FT		COHESI 0.4 0.6	ON, TON/	SQ FT	1.4
SYMBOL	DESCRIPTION OF MATERIAL (Based on Boring 2) SURF. EL: 197.65	BLOWS PER	UNIT DRY WT	PLASTIC LIMIT +		WATER ONTENT,	% 1	IQUID IMIT
	Stiff to very stiff tan claye silt	y		10	20 30 P	rotecti	ve Cov	rer -
						Cement	Grout	~
0	Stiff brown and tan silty clay					2-inch stainle riser		
5	Firm brown clayey silt							
0	Firm to soft gray and brown silty clay to very silty clay w/ferrous stains and rootlets -Gray below 24 ft					Benton	ite=Sea	11-2
0	Dense tan and gray silty fine sand -w/gray sandy silt seams at 29 to 30 ft					Slotted (0.010'	Scree Slots Ster Sa	*) ~
COM	PLETION DEPTH: 35 ft DE E: 8/15/89 IN	PTH	TO WA	ITER		DAT	F:	

DEPIH, FI	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL SURF. EL: 197.50	BLOWS PER FT	UNIT DRY WT LB/CU FT	0.2 0. PLASTIC LIMIT +	4 0.	CONT	8 1.	.0 1.	LIQU	IID	
			Stiff tan silty clay -w/gravel onesurfaces -slight odor					Prote	ecti	ve C	over	2.	1
5								Cer	ment	Gro	ut -	2.	
								2-in	⊗ • h d	iamo	tar		
0								stai rise	nles				
								8					
5			Stiff to firm gray silty clay -w/dark gray stains and odor -tan and gray without odor below 18.5 ft					8					0
5							8	Ben	toni	te S	eal-	2.	THE PARTY OF THE P
0-			Loose to medium dense gray sandy silt					Filt	er S	and		2.	
			-tan and gray silty clay below 34.5 ft					Slot (0.0				2	
5			Dense dark gray_sand/										

DEPTH, FT	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL	PER FT	UNIT DRY WT		0.4	0.6 0.8	1.0	1.2 1	
DEP	SYN	SAM	(Based on Boring 4) SURF. EL: 196.99	BLOWS PER	UNIT LB/	PLAST LIMI +-	т	CONTE		LIQU LIM 60 7	T
			Stiff tan clayey silt -w/some silty clay pockets					Prot	ective	Cove	17.
5								Ceme	nt Gro	out —	2_
			Stiff gray silty clay -w/ferrous stains and nodules -tan and gray below 8 ft						nless	ameter steel	
0			Stiff tan and gray clayey silt- -w/some silty clay pockets and seams								
5			-firm and wet below 18 ft								
5-			-gray below 24 ft							Seal -	
0			-more clayey below 32 ft						ted So		~
	-045		TION DEPTH: 35 ft DE		TO W						

SYMBOL	DESCRIPTION OF MATERIAL SURF. EL: 196.59	BLOWS PER FT	UNIT DRY WT	PLA	STIC	4 0.	6 0. WA	TER ENT, 9	.0 1	LIQU	
	Stiff brown clayey silt -w/odor						Pro	tect	ive	Cove	r 7.
	Very stiff gray and tan silty clay -w/ferrous stains				N. S.	8	Ceme	nt G	⊗ rout	_	2
	Stiff to firm greenish gray silty clay -w/odor -tan and gray below 15.5 ft				é			diam ss s		ris	er-2
0	Firm to stiff tan clayey silt -w/ferrous stains and slight odor -gray below 25 ft				8	⊗ ⊗					
0					8	8					
0	Loose to medium dense gray fine sandy silt Dense gray fine to coarse sand			8	8						
	-w/gravel below 65 ft		6":				Ben	toni	te S	eal	2.
0.00	-more gravel below 70 ft	50/	4" 5"				S1c	ter	Scr	een	2

Cedar Chemical Company West Helena, Arkansas

LOCATION: See Plate 1 TYPE: Wash COHESION, TON/SQ FT DRY WT PER 0.2 0.4 0.6 0.8 1.0 SYMBOL DEPTH. DESCRIPTION OF MATERIAL BLOWS ! PLASTIC LIQUID WATER CONTENT, % UNIT LB/ SURF. EL: 196.46 30 40 50 60 70 20 Stiff brown clayey silt Protective Cover -w/odor 5 Very stiff gray and tan silty Cement Grout --w/ferrous stains 10 Stiff to firm greenish gray silty clay 2-inch diameter -w/odor stainless steel -tan and gray below 15.5 ft 15 riser 20 Firm to stiff tan clayey silt w/ferrous stains and slight odor 25 -gray below 25 ft 30 Bentonite Seal 35 Filter Sand -40 45 Loose to medium dense gray Slotted Screen fine sandy silt (0.010" Slots) 50 COMPLETION DEPTH: DEPTH TO WATER 50 ft DATE: 8/9/89 IN BORING: DATE:


FT	7	ES		F	1.	N: See		HESIC		N/SQ F		4
DEPTH,	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL	BLOWS PER	UNIT DRY WT	PLAS LIM	TIC IT	C	WATER	iT,%	LIQU	IID
			SURF. EL: 196.47 Stiff brown clayey silt -w/odor			10	20	30	Prote	ective		o er ~
									Ceme	ent Gr	out -	2
5			Very stiff gray and tan silty clay -w/ferrous stains							nch dinless		
10 -			Stiff to firm greenish gray silty clay -w/odor									
15			-tan and gray below 15.5 ft						Bent	tonite	e Sea	1-7-
20-			Firm to stiff tan clayey silt-w/ferrous stains and slight odor-gray below 25 ft						Filte	er San	nd —	2
25 ⁻ 30-			323, 3323, 23						Slot (0.0	tted S	Scree) -2
			TION DEPTH: 30 ft DE 8/9/89 IN		TO W	ATER				ATE:		


LOG OF MONITOR WELL NO. 6C Cedar Chemical Company

West Helena, Arkansas

1		S		RFT	TWT			-	N, TO			
DEPTH, FT	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL	BLOWS PER	UNIT DRY WT	PLAS	TIC	_1_	WATER	1	LIC LI	1.4 QUID MIT
٥		/	SURF. EL: 196.40	BF(5	10	20	30	40	50	60	70
			Stiff brown clayey silt -w/odor					P	roted	tive	Cov	er -z
									Ceme	ent (Grout	2
5 -	W		Very stiff gray and tan silty				+	+			iame s st	
	W		clay -w/ferrous stains						rise		-	7
	1		w/ICIIOGO SCULIG				1		Bent	conit	te Se	a1 2
									F111	ter S	Sand -	2
0	1		Stiff to firm greenish gray									
	1/		silty clay -w/odor						Slot	tted	Scre	en
									(0.0		3100	Sy
5	И							1		+		
							1					
								1				
										1		
	COME		TION DEPTH: 15 ft DE		TO W		1					

	SYMBOL	SAMPLES	DESCRIPTION OF MATERIAL	BLOWS PER FT	UNIT DRY WT	0.2 PLASTI LIMIT	0.4 0 C		.8 1	.0 1		,
	later.	1	SURF. EL: 196.86	m	3	10	20 3	0 4	0 5	0 6	0 70	
100			Loose tan sandy silt Loose gray silt w/gravel and/ odor (yellow tint) Stiff to firm tan silty clay						tect ver	Lve .	2	-
	\mathbb{Z}	1		4				С	emen	Gr	out	2
		1					S		less	maet		
							8					
5			Stiff tan and grayyclayey silt				8					
2			Firm tan and gray silty clay w/ferrous stains				8					
5/		1	Stiff gray clayey silt				8	⊗ Ben	toni	te S	eal _	>_
			Stiff gray silty clay w/some wood fragments and sand seams					⊗ Fil	-	Sand	8	_
5			Dense gray silty fine sand -less silty fine to medium sand below 40 ft					S10 (0.	tted 010"	Scr Slo	een ts)	2





ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TO : Mark Simpson, Geologist, R.S.T. Div.

FROM : Jay Justice, Hazardous Waste Chemist, T.S. Div.

DATE : 7-DEC-1989

SUBJECT : Results from analysis on groundwater samples taken

at Cedar Chemical Company on October, 17, 1989.

The groundwater samples taken October 17, 1989, at Cedar Chemical Company located at West Helena have been analyzed for Semivolatile Organics and Total Organic Carbon. The results from these analyses are listed below and are expressed in mg/l.

Well #3

TOC	41
Methoxybenzene (1)	0.02
Dichlorobenzene (1)	0.15
Propanil (1)	0.17

Well #6C

TOC	67
Dichloroanilines (1)	25
Chloroaniline (1)	0.1

Well #6A

TOC	1.5
Phenylaniline (1)	0.025

Field Duplicate (Well #6C)

TOC		71
Dichloroanilines	(1)	25

(1) Denotes a concentration that has been estimated.

cc: Jim Rigg, Geologist II, Groundwater Section Hazardous Waste Division CSN. 54 0068 PERMIT NO.

MEDIA: AIR, WATER, SOLID, HAZARDOUS
SORT: PERMIT, COMPLIANCE

EC 6 1989

December 4, 1989

To: Sammy Bates

Arkansas Department of Pollution Control & Ecology

Dear Sammy:

I received a telephone call from Terry Perry informing me that our letter had been routed to a different department. However, for your records a copy of our report on contingency plan implementation is attached.

If we can help further please let us know.

Sincerely

Joe E. Porter

STATE OF ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY 8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501)562-7444 Rec'd Dec 4, 1989 November 27, 1989 Mr. Joe Porter Cedar Chemical Corporation P. O. Box 2749 West Helena, AR 72390 RE: Contingency Plan implementation on September 25, 1989 Dear Mr. Porter: I have been informed by our emergency coordinator, Terry Perry, of an accident on September 25, 1989, in which Cedar Chemical's contingency plan was implemented. To date, I am not aware of a written report having been submitted to our Department for review. Any facility implementing their contingency plan must submit a written report to this Department within 15 days after the incident as required by 40 CFR 265.56(j) as adopted by the Arkansas Hazardous Waste Management Code. You must submit a written report within 10 days to this Department regarding the incident in question. If you have already submitted a report, please send me a copy including the date sent. Sincerely, Jam R. Bots Sammy Bates Hazardous Waste Inspector Supervisor Hazardous Waste Division SB/ckh:LTR691 cc: Terry Perry

CEDAR CHEMICAL CORPORATION P.O. Box 2749, Hwy. 242 S. • West Helena, AR 72390 (501) 572-3701 • Fax No. 501-572-3795 Regional Administrator - Region VI October 10, 1989 U.S. Environmental Protection Agency 1445 Ross Avenue Dallas, Tx. 75202 CSN: 540068 PERMIT NO. . MEDIA: AIR, WATER, SOLID, HAZARDOUS Re: Contingency Plan Implementation SORT: PERMIT, COMPLIANCE ARD 990 660 649 FEES. Dear Sir: On September 25, 1989 at approximately 5:45 PM (est), the Cedar Chemical Corporation Contingency Plan was implemented. A chemical reactor in our Unit 3 ruptured due to a sudden increase in internal pressure. The rupture resulted in a flash fire which in turn ignited an unknown volume (less than 500 gallons) of 70% methyl alcohol and a nearby office building. The reactor contained final product, methylthiopinacolone oxime (CAS 39195-82-9), with a purity of 96.4% (approximately 14,000 pounds). The lead operator for the unit sustained 5% third degree and 50% second degree burns. He is currently in very good condition. A second operator sustained a very minor burn, was examined by the hospital emergency room, and released.

Fire in the processing area was secured by plant personnel within the first few minutes before local authorities arrived. Local fire departments then spent approximately 45 minutes controlling the office fire where paper records and insulation were stored. In the first minutes, plant employees also responded with contingency plan actions of securing other operating units, storage tanks, railcars, and emergency callouts.

All contingency plans were carried out as necessary including phone calls to proper authorities, securing plant processes, checks for hazardous waste generation, and securing the plant processes and storage tanks until power could be restored.

To the best of our knowledge and analysis, hazards to human health and the environment were held to an absolute minimum. Materials released did not result in hazardous wastes. All materials including firewater were contained on the plant site and no significant impact on our NPDES biological treatment system has been observed.

The plant is currently in total operating condition with the

exception of the affected unit. Plans for this units future have not been finalized. A representative from the Arkansas Department of Pollution Control & Ecology was on-site that very evening for an in-depth examination of the incident and its effects. Representatives from the Arkansas Department of Labor and Occupational Safety & Health Administration made visits in the following days. OSHA's visit extended into the community to verify/clarify reports given in television broadcasts and newspapers. Respectfully submitted, Joe E. Porter Environmental Engineer cc: J.H. Miles c:\Joe\Sep2589.EPA

STATE OF ARKANSAS

DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501) 562-7444

CSN 5400 6 8 Parmit No.

Sort: Permit, Compliance

Media: Air. Water, Solid Mazardois, Superfund, UST

September 14, 1989

Cedar Chemical P.O. Box 2749 72390 West Helena, AR

ATTN: Joe Porter

Dear Mr. Porter:

In an effort to coordinate the upcoming sampling and analysis of the recently installed monitoring wells, please furnish me your procedure for sampling the wells and the laboratory that will be analyzing the water samples for TOC and TOX. In addition, please include the schedule that will be followed.

The Department also request that you notify us three days prior to a sampling event to allow us time to prepare sample bottles should we want to split samples with your facility.

Sincerely,

Mark Simpson Geologist II

Mark Simpson

Hazardous Waste Division

MS/alb:LTR153

DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501) 562-7444

CSN. 54 006 8 pormit No.
Modia: Air W. Slid Hazardou Superfund, UST.

CERTIFIED MAIL

June 28, 1989

Mr. Joe Porter Environmental Engineer Cedar Chemical Corporation P.O. Box 2749 West Helena, Arkansas 72390

Dear Mr. Porter:

The Department has completed review of your submissions concerning piezometric data and proposed monitoring well locations pursuant to paragraph 10(a) of the Order. The groundwater monitoring program is hereby approved based on the following conditions:

- The proposed shallow monitoring well for the perched water at boring 6-A should be drilled to a depth of 15 feet with the bottom 5 feet being screened due to the depth to water being below 10 feet for the majority of the year.
- Screen intervals in wells MW-1, MW-2 and MW-3 should be set at 35 to 25 feet below the surface so that the silty clay material above the sand may be screened.
- 3. Monitoring wells should be installed in the area around piezometers B-3 and B-3A as groundwater flows in this direction for a significant time during a calendar year. The apparent perched water in the area of B-3 needs to be investigated.
- 4. Odors were noted during the drilling of several borings. To assist in contaminant identification, an organic vapor detector should be used while drilling to at least a depth of 25 feet below the surface.

Receipt of this letter shall serve to initiate implementation of the groundwater monitoring plan in accordance with paragraph 10(c) of the Order.

If you have any questions in the above matter, please feel free to contact me.

Sincerely,

Have Licere

Karen Deere Manager, Enforcement Branch Hazardous Waste Division

KD/alb:LTR76

cc: Mark Simpson

ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TO : Karen Deere; Manager, Enforcement Branch

FROM : Mark Simpson; Geologist II 70

DATE : 2-JUN-1989

SUBJECT : Cedar Chemical

Sort: Permit Compliance Superfund, UST

I have completed my review of Cedar Chemical's piezometric data and proposed monitoring well locations and have these comments.

- 1. Concerning the wells to monitor the perched water found by boring 6-A the proposed screen interval in the shallow well may be too shallow to be effective for much of the year. Extending the well depth to 15, with the bottom 5 feet being screened may be more effective. The reason for this is that the depth to water is below 10 feet for the majority of the year. The other proposed wells which are intended to be drilled to 50 feet and 30 feet are acceptable.
- 2. In regards to the proposed monitoring well locations, I agree with locations but not with the screen depth. I would prefer to see the screen interval in wells MW-1 MW-2 MW-3 set at 35 to 25 feet below the surface to have some of the silty clay material above the sand included in the screened interval. Even better, would be to have another well cluster with one well screened above the sand.
- 3. The monitoring system is void of any wells near the old closed out pits (area north of borings B-3 & B-3A) potentiometric surface maps indicate groundwater movement towards the piezometer B-3 & B3-A for a significant time during a year and would be an excellent location for detecting constituents that may be moving eastward.

Additionally in the area of B-3A there appears to be perched water: this needs to be addressed.

4. During drilling it was noted that an odor existed in boring 3 and boring 6, in boring 3 odor was noted from near surface to about 25 feet. It is not known if the boring B-3A had odors or not. Boring 6 had noticeable odors to 17 feet.

In light of this, I recommend that while drilling the monitoring wells that an organic vapor detector be used at least to a depth of 25 feet below the surface.

JMS/alb:MEMO14

Report 1-30-89
Review 3-10-89

Sonny

CSN. 540068 Parmit No.
Media: Air. Water, Solid, H. Cardous, Superfund, UST
Sort: Permit, Compliance RCRA INSPECTION SITE IDENTIFICATION Date E.P.A. ID # ARD990660649 1-24-89 Street (or other identifier) Site Name Cedar Chemial Corporation P.O. Box 2749 State West Helena 72390 Site Operator Information Telephone Number 501-572-3701 City Street Zip Code Site Description manufacturing of pesticides Type of Ownership County Municipal Private State Federal Transporter Treatment Storage Generator Disposal Exempted Small-generator Non-generator INSPECTION INFORMATION Principal Inspector Information Sammy R. Bates Hazardous Waste Inspector Organization Telephone No. (area code & No.) ANPCAE 501-562-7444 Inspection Participants

Joe Porter, Environmental Engineer, 572-3701

1-24-89 page 2 of 7 cedar Chem. ARD990600649

CLOSURE VERIFICATION NARRATIVE

Cedar Chemical "clean-closed" two hazardous waste storage units (i.e., tank TB112, and drum storage pad) in accordance with the closure plan submitted to the Department and approved May 24, 1988.

At the time of inspection, the two units were not in use and appeared to be closed in accordance with the approved closure plans. Mr. Porter stated that both had been closed in accordance with the plan and no substantial problems were encountered. The tank is to be removed from service completely and the container storage pad will be used for hazardous waste storage of less than ninety (90) days.

By "clean-closing" these two units, Cedar Chemical Corporation has effectively closed all of their interim-status storage units.

SB/ckh:CLOSE-CED

1-24-89 page 3 of 7 Site name: Cedas Chem. I.D. no.: ARD990660649

Closure

۹.	Doe	s the facility have a closure plan?	Yes	_No
	1.	Does the plan include:		
		a. A description of how and when the facility will be partially, then finally closed?	× Yes_	_No
		b. An up-to-date estimate of the maximum inventory of wastes in storage and treatment at any time during the life of the facility?		_No
		c. A description of decontamination procedures for facility equipment?	× Yes_	_No _
		d. An estimate of expected year of closure?	× Yes_	_No
	2.	Does the plan include a schedule for final closure? If yes, does it include:	\times_{Yes}	No
		a. Time estimates for each phase of closure for each area?	\times_{Yes}	No.
		b. Total time estimate for closure?	XYes_	_No
	3.	or ici summary or non one ractificy prans to	les.	+ment
	4.	Does the plan address all areas of hazardous waste management?	X Yes_	_No
	5.	Has the plan been amended as necessary to reflect changes in facility operations or design?	X _{Yes}	_No
	6.	Are cost estimates available and modified as necessary? If yes, give latest cost estimate and date of adjustments.	XYes	_No
3.	Hav	e closure activities begun at the facility?	_XYes_	_No
	1.	If yes,	,	
		a. Was the closure plan submitted to the Regional Administrator at least 180 days prior to beginning these activities?	X Yes_	_No
		b. Were all wastes treated or disposed of within 90 days of the final receipt of wastes?	Y Yes_	_No

1-24-89
page 4 of 7
Site Name: Ledar Chen.
I.D. no.:
All 990660649

	granted by Regional Administrator.	NA	Yes_	No
c.	Do the actual closure activities correspond to those written in the closure plan?	X	Yes_	No
	If no, include narrative explanation.			
.2.	Was closure completed within 180 days of receipt of final volume of wastes?	X	Yes	No
	If no, give explanation, including waivers or extensions granted by the Regional Administrator.	NA	Yes	No
3.	cation of closure to the Regional Administrator? If wes, was it signed by both the owner/operator	7.70		T A
	and an independent registered professional engineer? See attached letter from Department to Cedar Che approving certification.	mico	Yes	No

1-24-89 page 5 of 7 Cedar Chem. ARB990660649

STATE OF ARKANSAS



DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

PHONE: (501) 562-7444

August 31, 1988

Mr. Joe E. Porter Environmental Engineer Cedar Chemical Corporation P. O. Box 2749 West Helena, AR 72390

RE: Closure Plan

Extension Request

Dear Mr. Porter:

The Department has reviewed the letter dated August 23, 1988, requesting an additional ninety (90) day extension for closure activities.

The Department hereby approves the extension request of ninety (90) days to the original ninety (90) day closure period making the total time for closure a total of 180 days from initial approval. The date of initial approval is May 24, 1988, and all time-frames are based on this starting date.

If you have any questions or concerns, please contact Mr. D. G. Warrick at extension 205.

Sincerely,

Bul mens

Paul Means Director

DW/ckh:LTR232

cc: Mike Bates, Chief, Hazardous Waste Division Gary Martin, Manager, Technical Branch, HWD Derick Warrick, Engineer, Technical Branch, HWD

DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

December 12, 1988

Mr. Joe Porter Environmental Engineer Cedar Chemical Corp. P. O. Box 2749 West Helena, AR 72390

RE: Cedar Chemical Corp. Final Closure Tank and Container Storage

Dear Mr. Porter:

The Department has received correspondence dated November 21, 1988, containing the independent certification required for clean closure in respect to the container storage area and storage tanks, T-B112.

The Department hereby approves the final certification for the container storage area and storage tank T-B112. With this approval, all hazardous waste management units are closed at this facility, resulting in a final closure. The requirements of CAO paragraph 7 are also satisfied.

Cedar Chemical Corp. will be required to comply with 40 CFR 262.34 as per accumulation times of hazardous waste with the container storage area.

Sincerely,

Randall Mathis Acting Director

DW/ckh:LTR309

cc: Mike Bates, Chief, Hazardous Waste Division Gary Martin, Manager, Technical Branch, HWD Karen Deere, Manager, Enforcement Branch, HWD Derick Warrick, Engineer, Technical Branch, HWD

			Marketty Policy		
CARRAS PERSONAL OF POLIUTION CONTROL & Ecolog	9		\circ		
150000000000000000000000000000000000000				_	
Storage Pad Company	TIP-		Mit Had	the state of the s	
CATION: CEARL DAFTER					
W. Helenacounty: Phillips STATE: AR					
TE: 1-2 GENERAL STEEL CHOYL TRAIN I ISHOW!	10000	10000000000000000000000000000000000000		建制	
STOCKAPHER (SIg.) - and A.I.					
HERA: Pentax K-1000	Salar-				
EGATIVE LOCATION: ASA: 200T: 1/ :-				3	
PROCESSED BY: Wa Mart					

OFFICIAL PHOTOGRAPH	1 150		X		
Arkansas Department of Pollution Control & Ecology	10	-			

SUBJECT: Tank TB112 LOCATION: CEDAT Chemical Company

DATE: 1-24-89 TIME! 10:55 WEATHER: ISUNI (MAZE) ICLOUDY I TRAIN I ISNOW! PHOTOGRAPHER (SIg.) Son WITHESS: JOE K-1008 CAMERA: Pentax FILM TYPE: 35 MM ASA: 200T: 1/ 1: NEGATIVE LOCATION: ADDC 4 E FILE 1:

PROCESSED BY: Wal Mar-

:# OTCH?

OFFICIAL PHOTOGRAPH

Arkansas Department of Pollution Control & Ecology

SUBJECT: Jank TB112 LOCATION: Cedar Chemical

CITY: W. Helena COUNTY: Phillips STATE: DATE: 1-24-89 TIME! WEATHER: ISUNI PAZED ICLOUDY I TRAIN ISNO PHOTOGRAPHER (SIg.)_ WITNESS: The Porter CHERA: Rentax NEGATIVE LOCATION: ALPCAE FILE FI PROCESSED BY: Wal Mas

PHOTO #:





DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

PHONE: (501) 562-7444

December 12, 1988

Mr. Joe Porter Environmental Engineer Cedar Chemical Corp. P. O. Box 2749 West Helena, AR 72390

RE: Cedar Chemical Corp. Final Closure Tank and Container Storage

Dear Mr. Porter:

The Department has received correspondence dated November 21, 1988, containing the independent certification required for clean closure in respect to the container storage area and storage tanks, T-B112.

The Department hereby approves the final certification for the container storage area and storage tank T-B112. With this approval, all hazardous waste management units are closed at this facility, resulting in a final closure. The requirements of CAO paragraph 7 are also satisfied.

Cedar Chemical Corp. will be required to comply with 40 CFR 262.34 as per accumulation times of hazardous waste with the container storage area.

Sincerely,

Randall Mathis Acting Director

La dell Make

DW/ckh:LTR309

cc: Mike Bates, Chief, Hazardous Waste Division Gary Martin, Manager, Technical Branch, HWD Karen Deere, Manager, Enforcement Branch, HWD Derick Warrick, Engineer, Technical Branch, HWD

STATE OF ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY 8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209 PHONE: (501) 562-7444 CSN: 540068 Permit No. Media: Air, Water, Solid, Hazardous December 2, 1988 Sort: Permit, Comptiance, Legal, Misc. Mr. Joe Porter Environmental Engineer Cedar Chemical Corporation P.O. Box 2749 West Helena, Arkansas 72390 Dear Joe: Consent Administrative Order LIS 86-027 Department staff have completed review of the hydrogeologic assessment report which was submitted on August 4, 1988, and the groundwater monitoring program which was submitted on September 28, 1988. Comments on the hydrogeologic assessment report are as follows: The structure map on Plate 18 is constructed by using only two data points. This may not be an adequate amount of well control to complete this map. A data point near the middle of the site or additional data from USGS that reinforces this structural map should be provided to the Department. The map presented for recommending the monitoring well locations needs to show the approximate location of the three (3) closed and capped lagoons. This must be completed before the proper placement of wells can be determined. The area which Borings 6 and 6A were drilled is an appropriate location for the use of a two-well monitoring cluster locating the screens so as to monitor the perched zone and the uppermost sand interval. Screen depths should also be proposed for each monitoring well location. Comments on the groundwater monitoring program are as follows: The Department concurs with the gathering of water elevation measurements from the present to the end of March 1989 as providing enough data for evaluation of seasonal fluctuations in order to properly locate monitoring wells. It is recommended that the piezometers be measured for water levels at least twice a month with potentiometric surface maps being constructed for each measuring event. Also, the perched water observed in piezometer 6A should be monitored.

- * Monitoring well locations should be reevaluated and proposed after all water elevation data has been interpreted.
 - The recommended well depths of ten feet below minimum seasonal groundwater elevation are acceptable. The location of MW-4 would be an optimum location for a monitoring station screened at a shallow and medium depth if the potentiometric surface remains basically the same as the map in the submittal monitoring well plan. The location for upgradient well M-1 appears to be appropriate.
 - The use of stainless steel for construction of well casings and screens is appropriate for all wells. The ground level and top of casing must be surveyed after installation of each well.

If you have any questions about any of the above comments, please feel free to call Mark Simpson or myself. Otherwise, Cedar should proceed with implementation of the groundwater monitoring program.

Sincerely,

Level Dave

Karen Deere Enforcement Branch Manager Hazardous Waste Division

KD: fw:1498

cc: Mark Simpson, ADPC&E

CSN: 590068 Permit No.

ARKANSAS DEPARTMENT OF POLLUTION CONTROL WARD, ECOLOGYPHOUS

MEMORANDUM

TO : Karen Deere, Enforcement Branch Manager, HWD

FROM : Mark Simpson, Geologist, Hazardous Waste Division 1

DATE: November 14, 1988

SUBJECT : Cedar Chemical Groundwater Monitoring Well System

In reference to Cedar Chemical's plan for the installation of a groundwater monitoring system that was submitted September 28, 1988, I concur with the gathering of water elevation measurements from the present to March 1989. This schedule should provide enough data for the evaluation of seasonal fluctuations in order to properly locate monitoring wells that would intercept hazardous constituents in the groundwater during all seasons. Cedar Chemical needs to inform the Department how often the piezometers will be measured for water levels in a month between now and March 1989. I recommend at least twice a month. Potentiometric surface maps should be constructed for each measurement done.

Regarding the monitoring well locations, the locations indicted appear satisfactory, but should remain open to revisions until the all water elevation data has been interpretated, Also, the perched water observed in piezometer 6-A should be monitored.

The recommended well depths of ten feet below minimum seasonal groundwater elevation is acceptable, but the location of MW-4 would be an optimum location for a monitoring station screened at a shallow and medium depth if the potentiometric surface remains basically the same as the map in the submitted monitoring well plan. It also appears that the location for upgradient well MW-1 is an appropriate selection.

For the construction of the wells, stainless steel casing and screens are appropriate for all wells. The ground level and top of casing must be surveyed after installation of each well.

There are items from the hydrogeological study that Cedar Chemical need to address, some of this work and data needed can be done in conjunction with work already started and work that is planned. Comments are as follow:

- 1. The structure map on Plate 18 is constructed by using only two data points. This may not be an adequate amount of well control to complete this map. A data point near the middle of the site or more data may be available from the US Geological Survey that could reinforce this structural map should be made available to the Department. The values used to construct the map should be present on the map beside the respective well.
- 2. The map presented for recommending the monitoring well locations needs to show the approximate location of the three (3) closed and capped lagoons. This must be done before the proper placement of groundwater monitoring wells can be done. The area which Borings 6 and 6A were drilled is an appropriate location for the use of a two-well monitoring cluster locating the screens to monitor the perched zone and the uppermost sand interval. Proposed screen depths should also be noted for each proposed monitoring well location.

MS:fw:313

ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TO : Sammy Bates, Inspector, Hazardous Waste Div.

FROM : Jay Justice, Hazardous Waste Chemist, T.S.

DATE : 27-0CT-1988

SUBJECT : Results from analyses on soil samples taken at Cedar

Chemical on August 22, 1988

Six of the seven soil samples taken at Cedar Chemical Company on August 22, 1988, were extracted with an organic solvent and presented to the GC/MS to determine if any semi-volatile organic compounds were present in them. Two of the samples demonstrated that they had some semi-volatile organic compounds present in them. The organic compounds present and their estimated concentrations in the soil are listed below. All concentrations are expressed in mg/kg and reflect the amounts that are expected to be present in the samples if they are completely devoid of moisture. The soil sample that was not analyzed was labeled, "Corner of Hwy 242 and Industrial Park Road".

Southeast corner of storage pad

2,5-Cyclohexadiene-1,4 dione, 2,6-Bis(1,1-Dimethylethyl)	2
Bis (Dimethylethyl) Benzenediol	2
Z-Dibenzofuranamine	7
4-Dibenzofuranamine	5

North side of tank TB112

Dichloronitro Benzene	1
Bis(Dimethyl ethyl) Benzenediol	5
1,1'-(2,2-Dichloroethylidene) Bis (4-methoxy) Benzene	95
Diphenyl Sulfone	3000

OFFICIAL PHOTOGRAPH ATRANSAS DE TUMENT OF POLIUTION CONTROL & ECOLO SERVICE STUM STORAGE AREA CATION: Cedas Chemical, facing North of drum storage pad North of drum storage pad



Arkansas Department of Pollution Control & Ecology SUBJECT: Sample location # LOCATION: SE CORNET of drum storage Pad at Cedas Chemica CITY: W. HelenaCOUNTY: Phillips STATE: AR DATE: 8-22-88 TIME: 10:00 WEATHER: ISUNI IHAZEI ICLOUDYI IRAINI ISNOWI PHOTOGRAPHER (SIg.) WITNESS: Telly Very CAMERA: Pentax K-1000 FILM TYPE: 35 MMASA: 00 T:1/ PROCESSED BY: Wal Mait PHOTO 1: 2 of 9

OFFICIAL PHOTOGRAPH



SUBJECT: Sample location # 2 LOCATION: Eact Center of drum Storage Pad at Cedas Chemical CITY: W. Helenacounty: Phillips STATE: HR DATE: 8-22-88 TIME: 10:03 WEATHER: (SUN) IHAZEL ICLOUDYI TRAINI ISNOWI PHOTOGRAPHER (SIg.) James R. Sales WITNESS: Teiru Perry CAMERA: Pentay K-1000 FILM TYPE: 35 pm ASA: 100 T:1/ NEGATIVE LOCATION: ANCHE FILE 8: PROCESSED BY: Wa Mart PHOTO 8: 3 of 9

OFFICIAL PHOTOGRAPH
Arkansas Department of Pollution Control & Ecology




OFFICIAL PHOTOGRAPH Arkansas Department of Pollution Control & Ecolo EUBECT: Sample location #3 and C CCATION: West center of of um storage pad, at Cedar Chemical TITY: W. Helena COUNTY: Phillips STATE: AR DATE: 8-22-88 TIME: 10:05 EATHER: ISUND (HAZE) ICLOUDY) IRAINI ISHOW! PHOTOGRAPHER (SIg.) Som K. Bates HITNESS: Temu Parry CAMERA: Neutax K-01000 FILM TYPE: 35mm ASA: 100 T:1/ NEGATIVE LOCATION: AN PLAE FILE D: PROCESSED BY: Wal Mart : 0 OTCH?

OFFICIAL PHOTOGRAPH

Arkansas Department of Pollution Control & Ecology

SUBJECT: Sample location #5
LOCATION: NW corner of drum storage
pad, at Cedar Chemical
CITY: M. He enacounty: Aillies State: AR
DATE: 8->2-88 TIME: 10:10:8
WEATHER: (SUM IHAZEI ICLOUDY) IRAIN] ISNOW!
PHOTOGRAPHER (SIg.) Samp R. Gale
WITNESS: Terry Perry
CAMERA: Pentax K-1000
FILM TYPE: 35 mm ASA: 100T: 1/
NEGATIVE LOCATION: AND CAF FILE 5:
PHOTO 8: 5 of 9



Arkansas Department of Pollution Control & Ecology

SUBJECT: Drum Storage area

LOCATION: Ledar Chemidal drum

Storage area facing south

CITY: W. Helena COUNTY: Phillips STATE: AR

DATE: 8-22-88 TIME: 10:15

WEATHER: (SUN) [HAZE] [CLOUDY] [RAIN] [SNOW]

PHOTOGRAPHER (SIg.) Samy R. Raise

WITNESS: Terra Perru

CAMERA: Pental K-DOO

FILM TYPE: 35 mm ASA: 100 T:1/ f:

NEGATIVE LOCATION: ADPLATE FILE 8:

PHOTO 8: 6 of 9







OFFICIAL PHOTOGRAPH rkanses Papertment of Pollution Control & Ecolog sample #6 BECT: Cedas Chemica Scrap yard OCATION: 50 paces south of drum storage area ITY: W. Helenacounty: Phillips STATE: AR DATE: 8-22-88 TIME: 10:20 EATHER: (SUN) I-MAZET ICLOUDYT IRAINT ISNOWT PHOTOGRAPHER (SIg.) Som R Rates HITNESS: TETTU PETTU CAMERA: Pentax K.01000 FILM TYPE: 35 mm ASA: 100 T: 1/ NEGATIVE LOCATION: ANPLAE FILE 8: PROCESSED BY: Wal Mast : 01CH



OFFICIAL PHOTOGRAPH

Arkansas Department of Pollution Control & Ecology

SUBJECT: Sample #7, Cedat Chemical
LOCATION: Center of gate North of Tank
#TB112 at Cedat Chemia
CITY: UN Helenacounty: Phillips STATE: AR
DATE: B-22-8% TIME: 10:32
WEATHER: (SUND IMAZEL ICLOUDY) IRAINI ISNOW)
PHOTOGRAPHER (SIg.) January R. Sales
WITNESS: Tetry Petru
CAMERA: Pental K-1000
FILM TYPE: 35 mm ASA: 100 T:1/
NEGATIVE LOCATION: ALPCAE FILE 8:
PROCESSED BY: Wal Mait
PHOTO 8: 8 of 9



OFFICIAL PHOTOGRAPH

CEMAR Chemical off-site

SUBJECT: Sample #8, background sample

LOCATION: Cornet of Hwn 142 and IndiPark Road SW of Cedar Chemice

CITY: W. Helena COUNTY: Phillips STATE: AR

DATE: 2-2-88 TIME: 10: 43

WEATHER: (SUNI 14AZEI ICLOUDYI IRAINI ISNOWI)

PHOTOGRAPHER (SIg.) Samy R. Bales

WITNESS: Terry Perry

CAMERA: Partaw K-1000

FILM TYPE: 35 mm ASA: 100 T:1/

NEGATIVE LOCATION: ANCE FILE FILE FILE

PROCESSED BY: Wa Mart

to 9 :1 OTCH!



ARKANSAS DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

MEMORANDUM

TO : Sammy Bates, Inspector, Hazardous Waste Div.

FROM : Jay Justice, Hazardous Waste Chemist, T.S.

DATE : 27-0CT-1988

SUBJECT : Results from analyses on soil samples taken at Cedar

Chemical on August 22, 1988

Six of the seven soil samples taken at Cedar Chemical Company on August 22, 1988, were extracted with an organic solvent and presented to the GC/MS to determine if any semi-volatile organic compounds were present in them. Two of the samples demonstrated that they had some semi-volatile organic compounds present in them. The organic compounds present and their estimated concentrations in the soil are listed below. All concentrations are expressed in mg/kg and reflect the amounts that are expected to be present in the samples if they are completely devoid of moisture. The soil sample that was not analyzed was labeled, "Corner of Hwy 242 and Industrial Park Road".

Southeast corner of storage pad

2,5-Cyclohexadiene-1,4 dione, 2,6-Bis(1,1-Dimethylethyl)	2
Bis (Dimethylethyl) Benzenediol	2
2-Dibenzofuranamine	7
4-Dibenzofuranamine	5

North side of tank TB112

Dichloronitro Benzene	1
Bis(Dimethyl ethyl) Benzenediol	5
1,1'-(2,2-Dichloroethylidene) Bis (4-methoxy) Benzene	95
Diphenyl Sulfone	3000

OFFICIAL PHOTOGRAPH Thansas Department of Pollution Control & Ecology The Ect: Drum Storage area CATION: Cedas Chemical facing North of drum storage pad North of drum storage pad

OFFICIAL PHOTOGRAPH

Arkansas Department of Pollution Control & Ecology

SUBJECT: Sample location #

LOCATION: SE CORRECT OF DEAM STOTAGE

PART AT CERTIFICATION

CITY: W. He lena COUNTY: Millips STATE: AP

DATE: 8-22-88 TIME: 10:00

MEATHER: SUM I HAZEI ICLOUDYI IRAINI ISNOWI

MITNESS: Teivu Peivu

CAMERA: PENDAX K-1000

FILM TYPE: 35 MMASA: 100 T:1/

NEGATIVE LOCATION: MAPCE FILE 0:

PROCESSED BY: Wal Mait

PHOTO 0: 2 of 9



OFFICIAL PHOTOGRAPH

Arkansas Department of Pollution Control & Ecology


SUBJECT: Sample location # 2
LOCATION: Eact Center of dium Storage
Pad at Cedat Chemical


CITY: W. Helenacounty: Phillips STATE: HR

DATE: 8-22-88 TIME: 10:03
WEATHER: (SOWN I HAZEL ICLOUDY) IRAIN! ISNOW!
PHOTOGRAPHER (SIG.) James R. Sale
WITNESS: Telly Perry
CAMERA: Pental K-1000

SILM TYPE: 35 mm ASA: 100 T:1/
GATIVE LOCATION: A APLE FILE 0:
PROCESSED BY: Wal Mart
PHOTO 0: 3 of 9



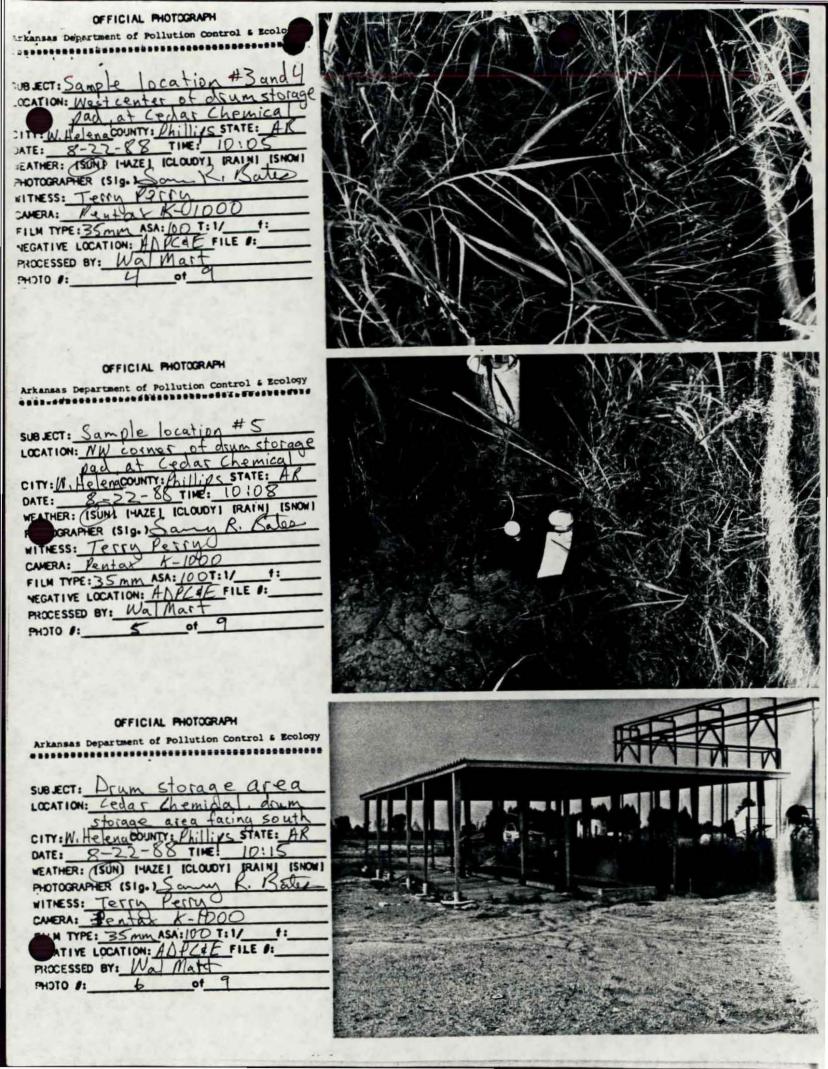

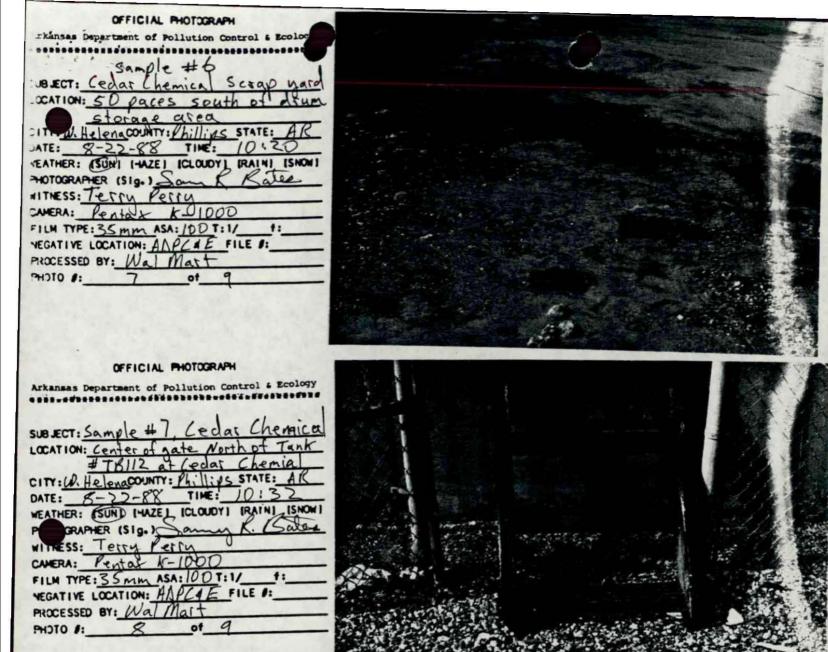

OFFICIAL PHOTOGRAPH

Cedar Chemical off-site

SUBJECT: Sample # 8, background sample

LOCATION: Corner of Hwn 742 and Indi.

Park Road SW of Cedar Chemice

CITY: W. Helena COUNTY: Phillips STATE: AR

DATE: R-D-88 TIME: 10: 43

WEATHER: (SUN) I HAZEI ICLOUDYI IRAINI ISNOWI

PHOTOGRAPHER (SIg.) Samy R. Rates

WITNESS: Terry Perry

CAMERA: Pental K-1000

FIN TYPE: 35 mm ASA: 100 T:1/ 1:

PROCESSED BY: Wa Mart

PHOTO 1: 9 of 9



5/10068 ARKANSAS DEPARTMENT OF POLLUTION TROL - AND - ECOLOGY CSN: . Media: Air, Water, Solid, Hazardous Sort: Permit, Compliance, Legal, Misc. MEMORANDUM TO : Karen Deere, Enforcement Branch Manager, HWD Mark Simpson, Geologist, Hazardous Waste Division FROM DATE October 7, 1988 : Review of Cedar Chemical's Hydrogeological Study SUBJECT After review of the study, I have noted some concerns on the proposed monitoring well locations. The areas discussed should be relatively simple to correct. Please comment on my observations and let me know how you want to respond to this study. Regarding the permeability of Stratum III as referenced on Page 7 states the basal stratum has an anticipated coefficient of permeability is 1.0 X 10 cm/sec. The section Results and The section Results and Conclusions have coefficient of permeability estimated by using falling head slug test having a much better permeability value for the same interval. Anticipating permeabilities is not acceptable. The permeability of basal stratum must be determined by lab or field test. Additionally, the estimated permeability for the interval tested in piezometer #6 indicates the continuing layer has not been defined. The structure map on Plate 18 is constructed by using only two data points. This may not be an adequate amount of well control to complete this map. A data point near the middle of the site or more data may be available from the US Geological Survey that could reinforce this structural map should be made available to the Department. The valves used to construct the map should be present on the map beside the respective well. The map presented for recommending the monitoring well locations needs to show the approximate location of the three (3) closed and capped lagoons. This must be done before the proper placement of groundwater monitoring wells can be done. The area which Borings 6 and 6A were drilled is an appropriate location for the use of a two-well monitoring cluster locating the screens to monitor the perched zone and the uppermost sand interval. The map should also clarify which of the proposed wells will be the upgradient well. Proposed screen depths should also be noted for each proposed monitoring well location. MS: fw: 306



Pinencial Connest:



PT 1988 FACILITY STATUS SEERT

e. IPA ID: IARIOARIOARIOARIA			2 a Bate Stat	se theat toh	mitted 213420
					The second second
b. Pacility Pase: Ledan Chemis	al	4000	b.First Tis	e Report _	Update _
is form only applies to facilities that have rm for only those facilities that are <u>not</u> on Facility Ground Water D = 265 Detect Wonitoring Status A = 265 lases (Choose one) W = Waiver (Market Market Mar	a permit	track for the		1.	complete this
			Compliance		Bazardous Waste
GTM Activity Reported with this Submission! (Nore than one Activity can be reported on	Agency E=EFA	Compliance Status Determined		Date Report Submitted	Constituent (EVC) Flag
01 Evaluation of Installation of Well System			1	шшшш	
1 02 Evaluation of Sampling, Analysis		1	1	шшшш	HIHHHHHH
and Evaluation Program		1			HUMANA
1 : 0) Notice of Significant Increase			IIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIII		mmmmm
in Concentrations			1		minimi
: 04 Groundwater				•	
		1		HIIIIIIII	111111111111111111111111111111111111111
06 GVM Records		1	BARRET		11 1111111111111111111111111111111111
1 07 Evaluation of Hydrogeologic				IIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIIII	
TY Comment:				Street or	
	Respon	. Determine	pliance Status ed or: Evaluated Applicable	Compliance : Y= Compliant H= Hon-Compliant B= Hon-Compliant	nce ! pliance!
C = Closure Assurance	15		0-88 1		
L = Post Closure Assurance		1	X		
\$ = \$udden Liability Instrument	15	1 9	30-88 1	N	
E = Fon-Sudden Liability Instrument	1		× 1		
1 = Corrective Action Assurance Instrument					

2.		NAME:_	10191910 Cec		1	UPDATE INSPECTOR:								
1					Lane Control					(3 1	nitials)			
		IS FOR	THIS REPORT			EVALU	Y RESONSIE ATION: ode in box	10		A ate ntractor/EP		ractor/S	State	
6.	TYPE OF BY THIS Put code	EVALUA REPORT in bo	ed:	83	2 = Sa 3 = Re 4 = Co 5 = Co	mpling cord mprehe mplia	ensive GWM nce Schedu Citizen C	on Evaluati le Evalua omplaint	on CM tion	8 9 E 10 11 12	- Other - C	ithdrawa losed Fa eneral* ase Deve	l Candida cility	
7.			TION COVERE		ent from 5):			7a. Ev	al.Com	•				
8.	CLASS and VIUL/PROBLEM-AREA				Class of				Area of Violation					
	'X' Vio		pecialties	1	iolation	CWM	CL/PC		Pt B	Cmpl Sch	Manifest	Land Ba	n Other	
			/Special. A	ct:	I			5	1		•			
	'Z' Pend		Special. A	ct:	11			0						
	'I' No !	SPECIA nsuran chedul	LTIES	8	Sa. COMMENT:	Add	ressed	by T	7-16-	87 CA	0			
	ENFORCE		TIONS:											
		Class	Area of Violation	(use cod	DATE ACTION	ON _	SCHEDULED	ACTU		ASSESSED ASSESSED	COLLECTED	- Agy Code	Resp Peri	
t_	Seq												No.	
t	Seq													
	Codes for Enforces		tion: 04 - 05 -	Final Or	ce Complaint		12 - File 14 - Refe 18 - Civi 19 - Fina	rral to E L Referra	PA 1 to A	S = :	for Resp A	EPA Over	sight	



STATE OF ARKANSAS

DEPARTMENT OF POLLUTION CONTROL AND ECOLOGY

8001 NATIONAL DRIVE, P.O. BOX 9583 LITTLE ROCK, ARKANSAS 72209

CSN: 540068

... Permit No. .

Madia: Air, Water, Solid, Wazardous

Sort: Permit, Compliance, Legal, Misc.

PHONE: (501) 562-7444

August 31, 1988

Mr. Joe E. Porter Environmental Engineer Cedar Chemical Corporation P. O. Box 2749 West Helena, AR 72390

RE: Closure Plan

Extension Request

Dear Mr. Porter:

The Department has reviewed the letter dated August 23, 1988, requesting an additional ninety (90) day extension for closure activities.

The Department hereby approves the extension request of ninety (90) days to the original ninety (90) day closure period making the total time for closure a total of 180 days from initial approval. The date of initial approval is May 24, 1988, and all time-frames are based on this starting date.

If you have any questions or concerns, please contact Mr. D. G. Warrick at extension 205.

Sincerely,

Bul mens

Paul Means Director

DW/ckh:LTR232

cc: Mike Bates, Chief, Hazardous Waste Division Gary Martin, Manager, Technical Branch, HWD Derick Warrick, Engineer, Technical Branch, HWD

RECD AUG 30 1988

CEDAR CHEMICAL CORPORATION

24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348

REPLY TO: P. O. BOX 2749 WEST HELENA, AR 72390 (501) 572-3701

August 23, 1988

Mr. Mike Bates Arkansas Department of Pollution Control & Ecology P.O. Box 9583-8001 National Drive Little Rock, Ar. 72209

Re: Closure Plan

Dear Mike:

Due to a very lengthy delay in obtaining acceptable laboratory data on soils analysis, we will not meet our original 90 day closure plan schedule. The storage tank has been empty since 1987 and all drums were removed in June. The remaining items are soils analysis and certification.

We request an additional 90 day period to complete this work. We are in the process of contacting another laboratory and anticipate obtaining a timely report.


Sincerely

Environmental Engineer

cc: J.H. Miles

G.L. Pratt

A.T. Malone



CEDAR CHEMICAL CORPORATION

24th Floor • 5100 Poplar Avenue • Memphis, TN 38137 • 901-685-5348

REPLY TO: P. O. BOX 2749 WEST HELENA, AR 72390 (501) 572-3701

8

Aug. 23, 1988

Mr. Sammy Bates

Arkansas Department of Pollution Control & Ecology

P.O. Box 9583-8001 National Drive

Little Rock, Ar. 72209

CSN. 540068 Permit No.

Madia: Air, Water, Solid Hazardous Sort: Permit, Compliante, Legal, Misc.

Re: Site Sampling Aug. 22, 1988

Dear Sammy:

On August 22, the Department obtained soil samples at our West Helena Plant. We request a copy of any and all, reports and documents generated as a result of this sampling visit.

We appreciate your assistance and look forward to working with you in the future.

Sincerely,

Joe E. Porter

Environmental Engineer

cc: J.H. Miles

G.L. Pratt